

# WLC

**WLC/C2 Precision Scale**  
**WLC/F1 Precision Scale**

## USER MANUAL

ITKU-103-05-06-19-EN



**RADWAG**® **RADWAG BALANCES AND SCALES**  
ADVANCED WEIGHING TECHNOLOGIES

JUNE 2019

# CONTENTS

<b>1. GENERAL INFORMATION</b>	<b>5</b>
<b>2. PRECAUTIONS</b>	<b>5</b>
2.1. Operation	5
2.2. Battery Power Supply	5
2.2.1. Worn out Batteries Replacement	6
<b>3. WARRANTY CONDITIONS</b>	<b>6</b>
<b>4. DESIGN</b>	<b>7</b>
4.1. Dimensions	7
4.2. Connectors Arrangement	9
4.3. Pins Overview	9
<b>5. UNPACKING AND INSTALLATION</b>	<b>9</b>
<b>6. START-UP AND OPERATION</b>	<b>10</b>
6.1. Levelling	10
6.2. Connecting the Scale to the Mains	10
6.3. Warm-Up Time	11
6.4. Battery Charge Status	11
6.5. Battery Charge Status Check	11
<b>7. MAINTENANCE ACTIVITIES</b>	<b>12</b>
7.1. Cleaning ABS Components	12
7.2. Cleaning Glass Components	12
7.3. Cleaning Stainless Steel Components	13
7.4. Cleaning Powder-Coated Components	13
7.5. Cleaning Aluminium Components	13
<b>8. OPERATION PANEL</b>	<b>14</b>
<b>9. KEYS</b>	<b>14</b>
<b>10. PROGRAM STRUCTURE</b>	<b>15</b>
10.1. Function Groups	15
10.2. Operating the Menu	15
10.3. Return to the Weighing Mode	16
<b>11. WEIGHING OPERATION</b>	<b>16</b>
11.1. Good Weighing Practice	16
11.2. Zeroing	17
11.3. Taring	17
11.4. Entering Tare Value Manually	18
11.5. Dual Range Devices	18
11.6. Units	18
11.6.1. Start Unit	18
11.6.2. Temporary Unit	19
<b>12. ADJUSTMENT</b>	<b>20</b>
12.1. External Adjustment	20
12.2. User Adjustment	21
12.3. Adjustment Report	21
<b>13. SCALE PARAMETERS</b>	<b>22</b>
13.1. Filter	22
13.2. Value Release	22
13.3. Ambient Conditions	22
13.4. Autozero Function	23
13.5. Tare Function	23
13.6. Tare: Enter Mode	24
13.7. Tare: Values Memory	24
13.7.1. Entering Tare Value to the Weighing Device Memory	24
13.7.2. Selecting Tare Value From Weighing Device Memory	25
13.8. Last Digit	25
<b>14. COMMUNICATION</b>	<b>26</b>
14.1. RS232 (1) Port	26
14.2. RS232 (2) Port	26
14.3. Wireless communication module	26
<b>15. PERIPHERAL DEVICES</b>	<b>27</b>
15.1. Computer	27
15.1.1. Computer Port	27
15.1.2. Continuous Transmission	28
15.1.3. Printout Interval for Continuous Transmission	28

15.2. Printer .....	28
15.2.1. Printer Port .....	28
15.3. Additional Display .....	29
15.3.1. Additional Display Port .....	29
<b>16. PRINTOUTS .....</b>	<b>29</b>
16.1. Adjustment Report .....	29
16.2. GLP Printout .....	30
<b>17. MISCELLANEOUS PARAMETERS.....</b>	<b>31</b>
17.1. Backlight .....	31
17.2. 'Beep' Sound .....	31
17.3. Automatic Shutdown .....	32
17.4. Date and Time .....	32
17.5. Default Operator Settings .....	32
<b>18. SCALE DATA .....</b>	<b>33</b>
<b>19. WORKING MODES – General Information.....</b>	<b>33</b>
19.1. Running Working Mode .....	33
19.2. Working Modes Local Settings .....	34
19.2.1. Working Mode Accessibility .....	34
19.2.2. Save Mode .....	35
19.2.3. Automatic Printout Time Interval .....	35
19.2.4. Lo Threshold .....	35
<b>20. WORKING MODE – WEIGHING.....</b>	<b>36</b>
20.1. Local Settings .....	36
<b>21. WORKING MODE – PARTS COUNTING .....</b>	<b>36</b>
21.1. Local Settings .....	36
21.1.1. Selecting Operation Mode .....	37
21.2. Setting Sample Mass by Entering Mass of a Single Part .....	37
21.3. Setting Sample Mass by Determining Mass of a Single Part .....	37
<b>22. WORKING MODE – +/- CONTROL .....</b>	<b>38</b>
22.1. Local Settings .....	38
22.2. Declaring Checkweighing Thresholds .....	38
<b>23. WORKING MODE – PERCENT WEIGHING.....</b>	<b>39</b>
23.1. Local Settings .....	39
23.1.1. Selecting Operation Mode .....	39
23.2. Reference Sample Mass Determined by Weighing .....	40
23.3. Reference Sample Mass Determined by Entering the Mass Value .....	40
<b>24. WORKING MODE – PEAK HOLD .....</b>	<b>40</b>
24.1. Local Settings .....	41
24.2. Peak Hold Operation .....	41
<b>25. WORKING MODE – TOTALISING .....</b>	<b>41</b>
25.1. Local Settings .....	41
25.2. Totalising Operation .....	41
<b>26. WORKING MODE – ANIMAL WEIGHING .....</b>	<b>43</b>
26.1. Local Settings .....	43
26.2. Animal Weighing Operation .....	43
<b>27. DIAGRAMS OF CONNECTION CABLES .....</b>	<b>44</b>
<b>28. TROUBLESHOOTING .....</b>	<b>44</b>
<b>29. ERROR MESSAGES .....</b>	<b>45</b>

## 1. GENERAL INFORMATION

WLC precision scale enables fast and accurate mass measurements under laboratory and industrial conditions. The device is equipped with an internal battery which allows its operation in places where there is no access to the mains. The WLC features a stainless steel weighing pan, and a backlit LCD guaranteeing clear weighing result presentation.

The WLC series enables weighing loads below scale (so called under-pan weighing). This is an alternative for loads of non-standard dimensions and shapes, and for loads generating magnetic field.




## 2. PRECAUTIONS

### 2.1. Operation

- A. Prior the first use, carefully read this User Manual. Use the device only as intended.
- B. Indicators to be decommissioned must be decommissioned in accordance with valid legal regulations.

### 2.2. Battery Power Supply




**WLC/F1, WLC/C2** scales are intended to be supplied by **NiMH** battery (*nikel metal hydride*) of **1800 - 2800mAh** capacity.

	<b><i>Do not let battery discharge in case of prolonged storage of the device in low temperature.</i></b>
	<b><i>Accumulators do not belong to regular household waste. The European legislation requires discharged accumulators to be collected and disposed separately from other communal waste with the aim of being recycled. Dear user, you are obliged to dispose of the worn out batteries as regulated.</i></b>
	<b><i>Notice: Symbols on batteries identify harmful compounds: Pb = lead, Cd = cadmium, Hg = mercury.</i></b>

### 2.2.1. Worn out Batteries Replacement

Worn out batteries of WLC/C2, WLC/F1 scales can be replaced by a user.

#### Procedure:
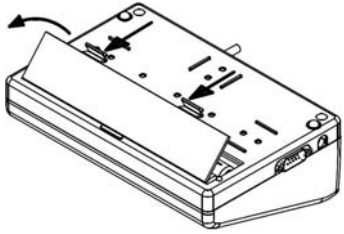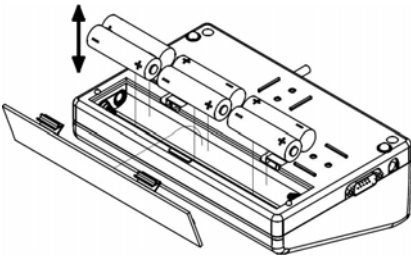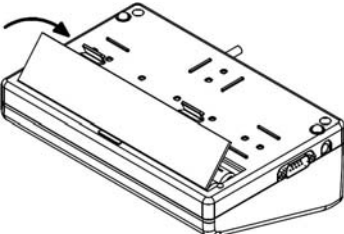
<p>Open battery container lid. The lid is to be found in the housing base.</p>	
<p>Take the worn out batteries out of the container, insert new accumulators, pay attention to +/- polarization.</p>	
<p>Close the lid.</p>	


## 3. WARRANTY CONDITIONS

- A. RADWAG feels obliged to repair or exchange all elements that appear to be faulty by production or by construction.
- B. Defining defects of unclear origin and means of their elimination can only be realized with assistance of manufacturer and user representatives.
- C. RADWAG does not bear any responsibility for damage or losses resulting from unauthorized or inadequate performing of production or service processes.


- D. The warranty does not cover:
- mechanical damage caused by product exploitation other than intended, damage of thermal and chemical origin, damage caused by lightning, overvoltage in the power network or other random event,
  - inappropriate cleaning habits.
- E. Loss of warranty takes place if:
- a repair is carried out outside RADWAG authorized service point,
  - service claims intrusion into mechanical or electronic construction by unauthorized people,
  - the device does not bear company security stickers.
- F. Warranty conditions outline the warranty period for rechargeable batteries attached to the device for 12 months.
- G. For detailed warranty conditions read the warranty certificate.
- H. Contact with the central authorized service: +48 (48) 386 63 30.

## 4. DESIGN


### 4.1. Dimensions

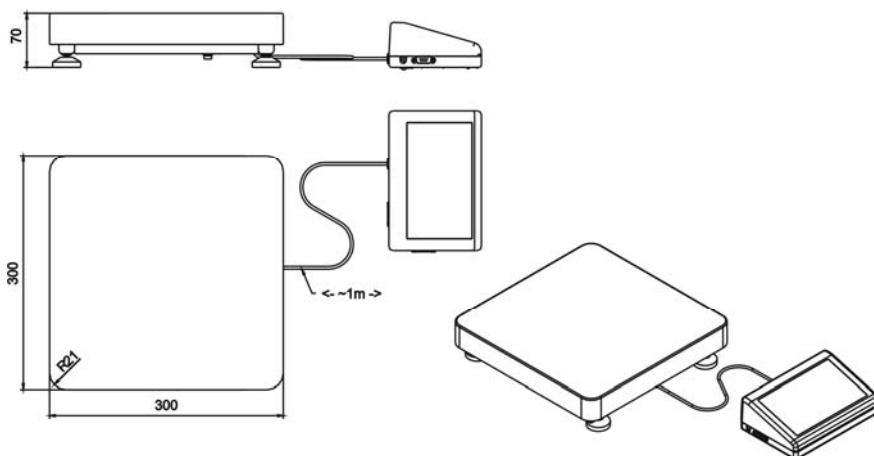


*Dimensions of WLC/F1/K scale*

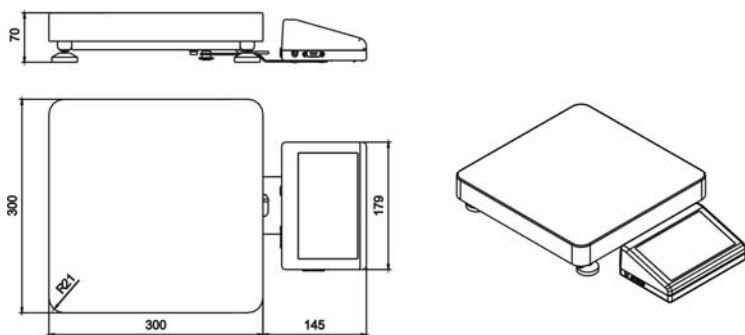

*Dimensions of WLC/F1/R scale*

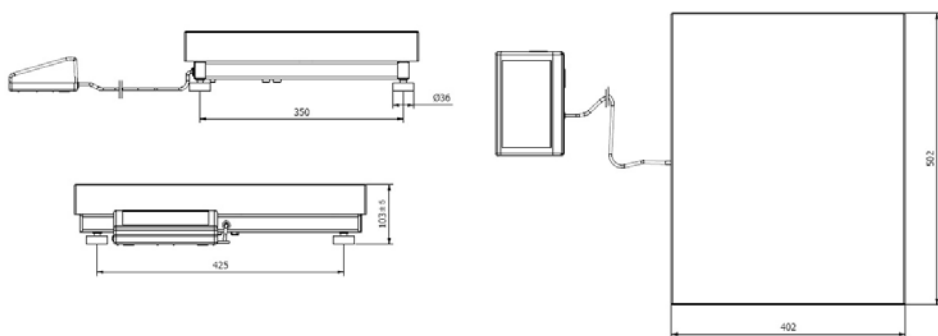



*Dimensions of WLC/C2/K scale*

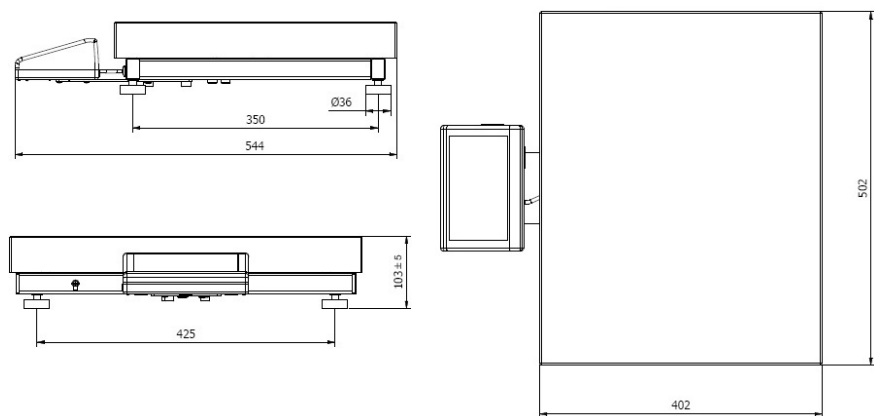

*Dimensions of WLC/C2/R scale*





4.2. Connectors Arrangement

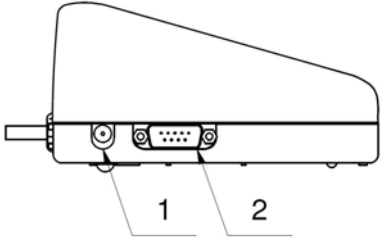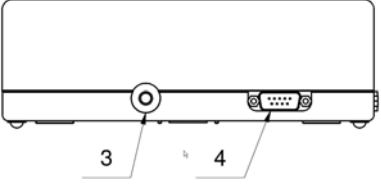	
<p>1 – power supply socket 2 – RS232 (1) connector</p>	<p>3 – weighing platform cable inlet 4 – RS232 (2) connector *</p>


\*) – option.

4.3. Pins Overview

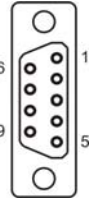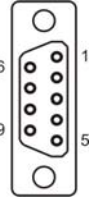	<p>Pin2 – RxD Pin3 – TxD Pin4 – 5VDC Pin5 – GND</p>	<p><b>RS232 (1) connector DB9/M (male)</b></p>
	<p>Pin2 – RxD Pin3 – TxD Pin4 – 5VDC Pin5 – GND</p>	<p><b>RS232 (2) connector DB9/M (male)</b></p>


5. UNPACKING AND INSTALLATION

- Unpack the device and place it on a flat and even surface. Keep it far away from any sources of heat.
- Remove transport lock.

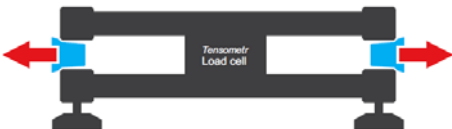

WLC/F1 WLC/C2 Scales


- Install the weighing pan, follow the below figures:

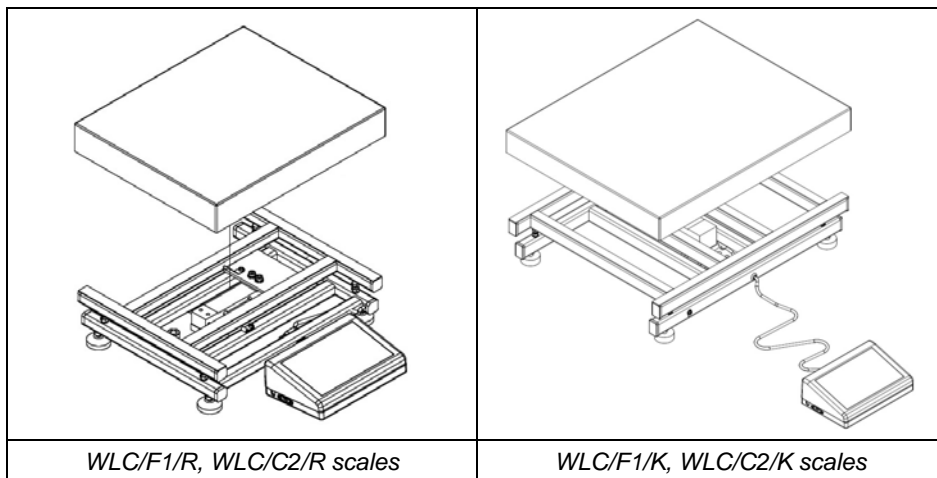

## 6. START-UP AND OPERATION

### 6.1. Levelling

To level the weighing instrument turn its feet. Keep turning the feet until the air bubble takes central position:

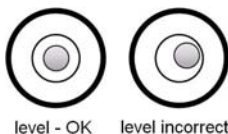

### 6.2. Connecting the Scale to the Mains

The weighing device can be connected to the mains only with a power supply that comes standard with the particular model. Nominal voltage of the power supply (specified on the power supply data plate) has to be compatible with the mains nominal voltage.

#### Procedure:

- Connect the power supply to the mains. Plug it to the power supply socket (back side of the scale housing).



- Press the key. The key is also used to switch the scale on/off.

- Display test proceeds (all symbols are backlit for a moment), program name and number is displayed first, ZERO indication with reading unit next (displayed reading unit is conditioned by scale type).
- In case the weighing result is not zero after indication stabilisation, press





key.

### 6.3. Warm-Up Time

- For correct scale operation, the workroom temperature must range between  $+15^{\circ}\text{C} \div +30^{\circ}\text{C}$ .
- It takes 30 minutes for the device to warm up.
- During the thermal stabilization, the indications on the screen can change.
- If you want to carry out adjustment operation, make sure that your device is thermally stable.
- Temperature and humidity variations during operation may cause indication errors. To remove the indication errors perform user adjustment.



### 6.4. Battery Charge Status

The scale of standard design is equipped with an internal battery. Battery state is signalled by  pictogram, the pictogram is displayed in the top bar of the display.

 pictogram display mode	Meaning
No pictogram	Battery charged. Regular scale operation.
Pictogram displayed continuously	Too low battery charge (the scale is about to shut down). Charge the battery immediately.
Blinking pictogram, blink frequency: ca. 1s	Battery charge in progress. The device is connected to the power supply charging the battery.
Blinking pictogram, blink frequency: ca. 0.5s	Battery error. Battery is damaged.

### 6.5. Battery Charge Status Check



- Press  and  keys combination.
- Battery charge state, given in %, is displayed for 2s.
- Next, home screen is displayed automatically.

## 7. MAINTENANCE ACTIVITIES

In order to ensure safety in the course of cleaning, it is necessary to disconnect the device from the mains. With this condition met, uninstall the weighing pan and other detachable components.



***Cleaning the weighing pan while still installed may cause damage of the measuring system.***

### 7.1. Cleaning ABS Components

To clean dry surfaces and avoid smudging, use clean non-colouring cloths made of cellulose or cotton. You can use a solution of water and detergent (soap, dishwashing detergent, glass cleaner). Gently rub the cleaned surface and let it dry. Repeat cleaning process if needed.

In the case of hard to remove contamination, e.g. residues of adhesive, rubber, resin, polyurethane foam etc., you can use a special cleaning agents based on a mixture of aliphatic hydrocarbons that do not dissolve plastics. Before using the cleanser for all surfaces we recommend carrying out tests. Do not use cleansers containing abrasive substances.

### 7.2. Cleaning Glass Components

Select dissolvent depending on a dirt. Never soak the glass panes in alkaline solutions since they interact with glass and may cause damage. Do not use cleansers containing abrasive substances.

For organic dirt use acetone first, next use water or detergent. For other than organic dirt use diluted acid solutions (soluble salts of hydrochloric or nitric acid) or base solutions (ammonium or sodium base). To remove ACIDS use protophilic solvent (sodium carbonate), to remove BASE use protogenic solvent (mineral acid of various concentration).

In case of heavy contamination use brush and detergent, nevertheless avoid detergents containing large and hard molecules which could potentially scratch glass panes.

At the end of the cleaning process rinse the pane using distilled water. Use soft brush with wooden or plastic handle exclusively in order to avoid risk of scratches. Do not use wire brush. Rinsing is a necessary cleaning process stage allowing to remove remaining soap, detergents and other cleansers from the panes prior their reinstallation. After preliminary cleaning process stage, rinse the pane using running water first, distilled next.

Avoid drying the panes either using paper towel or forced air circulation since some fibres, grains or contamination of other type could permeate into the panes thus causing weighing errors. We do not recommend using driers when drying measuring glass tools. It is a frequent treatment to leave glass components on a rack to dry.

### **7.3. Cleaning Stainless Steel Components**

Avoid using cleansers containing any corrosive chemicals, e.g. bleach (including chlorine). Do not use cleansers containing abrasive substances. Always remove the dirt using microfiber cloth to avoid damage of protective coating.

In case of a daily maintenance:

1. Remove the dirt using cloth dipped in warm water.
2. For best results, add a little bit of dishwashing detergent.

### **7.4. Cleaning Powder-Coated Components**

For preliminary cleaning process stage you need running water or wet sponge featuring large holes, this will help you to remove loose, heavy dirt. Do not use cleansers containing abrasive substances.

Next, using cloth and cleanser-water solution (soap, dishwashing liquid) gently rub the cleaned surface.


Avoid using cleanser without water since it may result with damage of the cleaned surface, please mind that large amount of water mixed with cleanser is a must.

### **7.5. Cleaning Aluminium Components**

While cleaning aluminium components use products acid by nature, e.g. spirit vinegar, lemon. Do not use cleansers containing abrasive substances. Avoid using hard brush, this may cause scratches. It is recommended to use microfibre cloth.

While polishing the surface use circular movements. Use clean, dry cloth to make the surface shine.

## 8. OPERATION PANEL

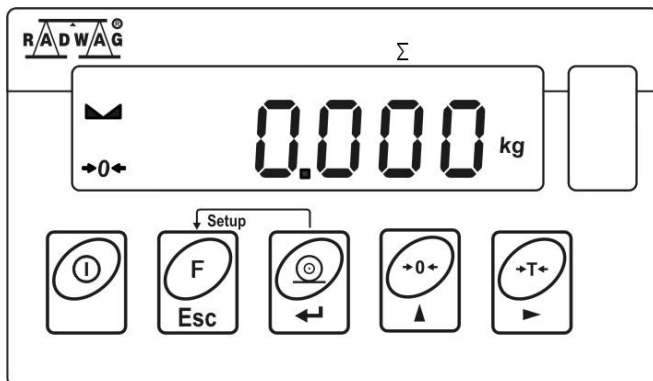

## 9. KEYS

	Press to switch the weighing device on/off – hold the key for about 1 second.
	Function key, press to change the working mode.
	Press to send the weighing result to a printer or computer.
	Press to zero the scale.
	Press to tare the scale.

	<p><b>Upon pressing  +  keys combination, functions of given keys change. Detailed information concerning use of  +  keys combination is to be found further down this manual.</b></p>
--	--

## 10. PROGRAM STRUCTURE










Program menu is divided into function groups. Function group is a group of interrelated parameters.



 
### 10.1. Function Groups

Function group number	Function group name	Description
P1	CAL	User Adjustment.
P2	rEAd	Readout parameters.
P3	Func	Working modes.
P4	Conn	Communication.
P5	ducE	Peripheral devices.
P6	Prnt	Printouts.
P7	Othr	Operation-related functions.
P8	InFo	Scale data.
P9	Unit	Units.


### 10.2. Operating the Menu

In order to navigate the program menu use the operation panel.


 + 	Press to enter the main menu.
 + 	Press to: <ul style="list-style-type: none"> <li>• enter tare manually.</li> <li>• enter tare from tare database.</li> <li>• change value by 1 digit up.</li> <li>• scroll the menu up.</li> </ul>
 + 	Press to check battery/accumulator state.
 + 	Press to view date/time.
	Press to: <ul style="list-style-type: none"> <li>• scroll the menu down.</li> <li>• change current parameter value.</li> </ul>



	Press to: <ul style="list-style-type: none"> <li>• enter given submenu.</li> <li>• modify given parameter.</li> </ul>
	Press to confirm modification.
	Press to: <ul style="list-style-type: none"> <li>• exit, function remains unmodified.</li> <li>• move one menu level up.</li> </ul>

### 10.3. Return to the Weighing Mode

Introduced menu modifications are automatically saved to scale memory upon return to the home screen. To return to the home screen press  key repeatedly.



## 11. WEIGHING OPERATION

Load the weighing pan. Read the result when  stability marker is displayed.



	<b><i>Only stable weighing results can be recorded (stability marker ).</i></b>
---	--

### 11.1. Good Weighing Practice

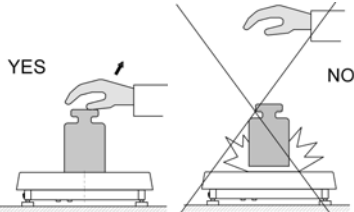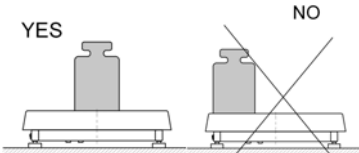

To assure long-term operation and correct mass measurements, follow the rules presented below:


Load the weighing pan steadily avoiding mechanical shocks.	
Place weighed loads centrally on the weighing pan (eccentricity errors are specified by PN-EN 45501 standard, point 3.6.2.).	

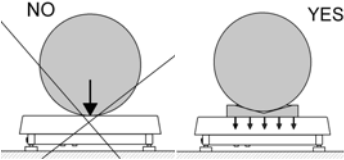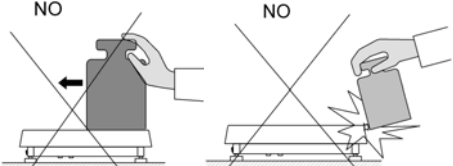



<p>Do not apply concentrated force (total load in one point).</p>	
<p>Avoid side loading, in particular side shocks.</p>	


## 11.2. Zeroing

To zero mass indication press  key. Zero indication and the following pictograms are displayed:  $\pm 0$  and . The instrument can be zeroed only when the indication is stable.





	<p><b>Indication can be zeroed only within <math>\pm 2\%</math> range of maximum capacity. If the zeroed value is greater than <math>\pm 2\%</math> of the maximum capacity, then the software displays &lt;Err2&gt; message, and short sound signal is heard.</b></p>
---	--



## 11.3. Taring


To determine net weight value, load the weighing pan with a packaging, wait for a stable indication and press  key. Zero indication and the following pictograms are displayed: **Net** and . The weighing device has been tared. Upon loading, net mass is displayed. Taring can be carried out repeatedly within the whole weighing range. Remember not to exceed the maximum capacity, i.e. sum of tare weight value and load weight value must be lower than the maximum capacity value. Upon unloading the weighing pan, the sum of tared masses with minus sign is displayed.

	<p><b>It is impossible to tare zero or negative values. When you tare zero or negative values, message &lt;Err3&gt; is displayed, short sound signal is heard.</b></p>
---	--


## 11.4. Entering Tare Value Manually

- Press  and  keys combination, tare value edit box is displayed.
- Enter tare value, to do it press  and  keys:

 


	Press to select digit that is to be edited.
	Press to set digit value, 0 - 9 .

- Press  key to confirm, the scale returns to the weighing mode, modified tare value with 'T' sign is displayed.
- You can enter tare value at any time during the weighing operation.

## 11.5. Dual Range Devices

Switching from weighing with the accuracy of the **I weighing range** to weighing with the accuracy of the **II weighing range** takes place automatically upon exceeding Max of the **I weighing range**. Upon switching to weighing with the accuracy of the **II weighing range**, respective pictogram/marker  is displayed in the top left hand corner.

To return to weighing with accuracy of the **I weighing range**:

- Take the load off the weighing pan.
- As the indication returns to zero and when symbols  and  are displayed, press  button.
- II weighing range pictogram/marker gets blank, the scale returns to weighings with the accuracy of the I weighing range.


## 11.6. Units

<P9.Unit> parameter group enables change of start unit and temporary unit. Unit change can be performed in the course of weighing or during operation of other modes. 'Parts counting' and 'Percent weighing' modes are exceptions.

### 11.6.1. Start Unit

Parameter for setting unit that is displayed and used after device start-up.

### Procedure:

- Enter <P9.Unit / 9.1.UnSt> submenu.
- Press  key, available units are displayed successively one by one.

### Options in case when the main unit is [kg]:



- kg (kilogram),
- g (gram),
- lb (pound)\*,
- N (Newton).

\*) – unit disabled for verified weighing devices.

### Options in case when the main unit is [g]:

- g (gram),
- kg (kilogram),
- ct (carat),
- lb (pound)\*.


\*) – unit disabled for verified weighing devices.

- Select start unit and press  key, next go back to the home screen, to do it press  key.
- Upon next start-up the scale runs with set start unit.

## 11.6.2. Temporary Unit

Temporary unit runs from the moment it is set to the scale shut-down and restart.

### Procedure:

- Enter <P9.Unit / 9.2.Unin> submenu.
- Press  key, available units are displayed successively one by one.

### Options in case when the main unit is [kg]:

- kg (kilogram),
- g (gram),
- lb (pound)\*,
- N (Newton).

\*) – unit disabled for verified weighing devices.

## Options in case when the main unit is [g]:

- g (gram),
- kg (kilogram),
- ct (carat),
- lb (pound)\*.

\*) – unit disabled for verified weighing devices.

- Select temporary unit and press  key, next go back to the home screen.

## 12. ADJUSTMENT

*option available for non-verified weighing devices exclusively*

In order to ensure the highest weighing accuracy, it is recommended to periodically introduce corrective factor of indications to scale memory, the said factor must be referred to a reference weight. This is so called adjustment.

### Adjustment has to be carried out:

- prior weighing,
- if long breaks between successive measuring series occur,
- if the ambient temperature has changed dynamically,
- if the scale has been relocated.


### Adjustment types:

- external adjustment, **<1.1.CA-E>**, performed using an external weight of declared mass, i.e. mass that cannot be modified,
- user adjustment, **<1.2.CA-u>**, performed using an external weight of mass of any value comprised within the weighing range, however not lower than 30% of the maximum capacity value.

### 12.1. External Adjustment

External adjustment must be carried out using an external adjustment weight of class F<sub>1</sub>.

#### Procedure:

- Enter **<P1.CAL / 1.1.CA-E>** submenu, text **<UnLoAd>** (remove weight) is displayed .
- Remove the load from the weighing pan and press  key.

- Mass of an empty weighing pan is determined, this is signalled with display of 'dash', < - >. Next, text <LoAd> (load weight) and mass value that is to be loaded, e.g. **200g** (conditioned by scale type), are displayed.



- Load the weighing pan with weight of specified mass value and press key.
- Weight mass is determined, this is signalled with display of 'dash', < - >. Next, text <UnLoAd> (remove weight) is displayed.
- Remove the load from the weighing pan, <1.1.CA-E> submenu is displayed.

## 12.2. User Adjustment

User adjustment must be carried out using an external adjustment weight of class F<sub>1</sub>.

### Procedure:

- Enter <P1.CAL / 1.2.CA-u> submenu, edit box for declaring weight mass is displayed (the mass value must be  $\geq 30\%$  of the maximum capacity value).



- Enter weight mass value and press key to confirm, text <UnLoAd> (remove weight) is displayed.



- Remove the load from the weighing pan and press key.
- Mass of an empty weighing pan is determined, this is signalled with display of 'dash', < - >. Next, text <LoAd> (load weight) and mass value that is to be loaded, e.g. **100g**, are displayed.



- Load the weighing pan with weight of specified mass value and press key.
- Weight mass is determined, this is signalled with display of 'dash', < - >. Next, text <UnLoAd> (remove weight) is displayed.
- Remove the load from the weighing pan, <1.2.CA-u> submenu is displayed.

## 12.3. Adjustment Report

Adjustment report is automatically printed (using scale-connected printer) at the end of each adjustment process. To declare report content go to <P6.1.CrEP> submenu.

For detailed information concerning report content read later sections of this manual.


### 13. SCALE PARAMETERS

Scale parameters are set to adjust the weighing device to ambient conditions (filters) or individual needs (autozero on/off, tare values memory). These parameters are to be found in **<P2.rEAd>** submenu.

#### 13.1. Filter

- Enter **<P2.rEAd / 2.1.FiL>** submenu.



- Press  key, filter values are displayed successively one by one: **1** - Fast, **2** - Average, **3** – Slow.



- Set respective value and press  key to confirm, next go to the home screen.



***The higher filter value, the longer the weighing takes.***


#### 13.2. Value Release

Enter this parameter to adjust rate of stabilisation of the measurement result. Depending on the selected option, weighing time is either shorter or longer.


##### Procedure:

- Enter **<P2.rEAd / 2.2.APPr>** submenu.



- Press  key, available values are displayed successively one by one: **F\_P** - fast and reliable, **PrEc** – reliable, **FASt** – fast.




- Press  key to confirm, next go to the home screen.


#### 13.3. Ambient Conditions

Parameter relating to ambient and environmental conditions of the workstation. Enter this parameter and set 'nStAb' value if the ambient conditions are unfavourable (air drafts, vibrations).

## Procedure:

- Enter **<P2.rEAd / 2.3.Enut>** submenu.

- Press  key, parameter values are displayed successively one by one: **nStAb** – unstable, **StAb** – stable.

- Press  key to confirm, next go to the home screen.


## 13.4. Autozero Function


'Autozero' function has been designed to enable automatic control and correction of zero indication. This guarantees precise weighing results.

There are, however, some cases when this function can be a disturbing factor for the measuring process, e.g. very slow placing of a load on the weighing pan (load adding, e.g. pouring, filling). In such case, it is recommended to disable the function.

## Procedure:

- Enter **<P2.rEAd / 2.4.Aut>** submenu.

- Press  key, parameter values are displayed successively one by one: **YES** – autozero function enabled, **no** – autozero function disabled.


- Press  key to confirm, next go to the home screen.

## 13.5. Tare Function

'Tare' function has been designed to enable setup of appropriate parameters for tare operation.

## Procedure:


- Enter **<P2.rEAd / 2.5.tArE>** submenu.

- Press  key, available values are displayed successively one by one:

<b>no</b>	Regular tare mode. Select this parameter to make the scale overwrite the set (selected) tare value with the most recently entered one.
<b>tArF</b>	Select this parameter to make the scale store the latest tare value in memory. The latest tare value is displayed after scale restart.
<b>AtAr</b>	Automatic tare mode.



<b>EAcH</b>	Select this parameter to make the scale automatically tare each accepted measurement.
-------------	---




- Press  key to confirm, next go to the home screen.





### 13.6. Tare: Enter Mode




The tare is entered using  +  keys combination from the home screen level. There are two enter modes.

#### Procedure:

- Enter **<P2.rEAd / 2.6.ttr>** submenu.
- Press  key, parameter values are displayed successively one by one:

<b>tArEH</b>	Select to enter tare value manually by means of  +  keys combination.
<b>tArnn</b>	Select to enter tare value that is stored in scale memory, use  +  keys combination.







- Press  key to confirm, next go to the home screen.



### 13.7. Tare: Values Memory



It is possible to store 10 tare values in scale memory.

#### 13.7.1. Entering Tare Value to the Weighing Device Memory



- Enter **<P2.rEAd / 2.7.tArn>** submenu, name of tare no. 1 from tares database is displayed (**<tArE 0>**), to select a different record press  key.
- Select respective entry and press  key, tare value edit box is displayed.
- Enter tare value, to do it press  and  keys:




	Press to select digit that is to be edited.
	Press to set digit value, 0 - 9 .

- Press  key to confirm, **<tArE 0>** window is displayed.
- Now press  key to go to the home screen.

### 13.7.2. Selecting Tare Value From Weighing Device Memory


- Enter **<P2.rEAd / 2.7.tArn>** submenu, name of tare no. 1 from tares database is displayed (**<tArE 0>**), to select a different record press  key.
- To set the selected tare press  key.
- The set tare value is displayed with minus sign, **Net** symbol is shown in the upper-left corner of the screen:

	<b><i>The tare value acquired from the weighing device memory is not remembered upon the weighing device restart.</i></b>
---	---


### 13.8. Last Digit

Function designed to disable display of the last weighing indication digit, this results with less accurate measurement.

#### Procedure:

- Enter **<P2.rEAd / 2.8.LdiG>** submenu.
- Press  key, available values are displayed successively one by one:

<b>ALAS</b>	Select to make the last digit always on.
<b>nEur</b>	Select to make the last digit always off.
<b>uuSt</b>	Select to make the last digit on only when the weighing indication is stable.

- Press  key to confirm, next go to the home screen.

## 14. COMMUNICATION

Communication between the scale and the peripheral devices is established via the following ports: RS232 (1), RS232 (2)\*, Wireless communication \*. To set the ports go to <P4.Conn> submenu.

\*) – option.

### 14.1. RS232 (1) Port

- Enter <P4.Conn / 4.1.rS1> submenu and set respective transmission parameters:

4.1.1.bAd	Baud rate: 2400, 4800, 9600, 19200, 38400, 57600, 115200 bit/s.
4.1.2.PAr	Parity: <b>nonE</b> – none; <b>EuEn</b> – even; <b>Odd</b> – odd.



- Press the navigation key to confirm, next go to the home screen.

### 14.2. RS232 (2) Port

*Optional design*

- Enter <P4.Conn / 4.2.rS2> submenu and set respective transmission parameters:

4.2.1.bAd	Baud rate: 2400, 4800, 9600, 19200, 38400, 57600, 115200 bit/s.
4.2.2.PAr	Parity: <b>nonE</b> – none; <b>EuEn</b> – even; <b>Odd</b> – odd.




- Press the navigation key to confirm, next go to the home screen.




### 14.3. Wireless communication module

- Enter <P4.Conn / 4.3.UUF> submenu and set respective transmission parameter values:

4.3.1.Act	Wireless communication module activation: <b>YES</b> – module enabled, <b>no</b> – module disabled.
4.3.2.StS	Network connection status: <b>UUAlt</b> – connecting in progress, <b>Connec</b> - connected, <b>OFF</b> – not connected.
4.3.3.tnn	Time delay. Time interval upon passage of which inactive connection with wireless communication module gets deactivated. The parameter value is declared within <b>0[s]</b> - <b>[60]s</b> range. <b>0[s]</b> is set by default (time delay inactive).

- Press  key to confirm, next go to the home screen.

In order to establish wireless communication with the scale, use „**RADWAG Connect**” PC software intended for computers and mobile devices. „**RADWAG Connect**” allows connection with RADWAG devices via local network, it provides access to the basic device functions: taring, zeroing, weighing record, measurement export. The software can be installed on any mobile device: desktop computer, laptop, tablet or smart-phone.

	<b><i>In order to provide correct communication with „RADWAG Connect” software via the wireless communication option you must set computer port parameter in your scale to &lt;UUF&gt; value.</i></b>
	<b><i>Set the transmission parameters of the wireless communication in accordance with your local network.</i></b>
	<b><i>For detailed information on establishing connection between „RADWAG Connect” software and RADWAG devices read „RADWAG Connect” software manual.</i></b>

## 15. PERIPHERAL DEVICES

<P5.ducE> menu contains list of devices cooperating with scale.


### 15.1. Computer


<5.1.PC> submenu allows you to:

- select port to which the computer is connected,
- enable/disable continuous transmission,
- set frequency of printouts for continuous transmission.

#### 15.1.1. Computer Port

- Enter <5.1.PC / 5.1.1.Prt> submenu.

- Press  key, parameter values are displayed successively one by one: **nonE** – none; **rS1** – RS232 (1); **rS2** – RS232 (2)\*; **UUF** – Wireless communication \*.

- Press  key to confirm, next go to the home screen.

\*) – option.

### 15.1.2. Continuous Transmission

- Enter **<5.1.PC / 5.1.2.Cnt>** submenu.



- Press key, parameter values are displayed successively one by one:

<b>nonE</b>	Continuous transmission disabled.
<b>CntA</b>	Continuous transmission in basic unit.
<b>Cntb</b>	Continuous transmission in current/temporary unit.



- Press key to confirm, next go to the home screen.

### 15.1.3. Printout Interval for Continuous Transmission

Parameter enabling you to set frequency of printout for continuous transmission. Printout interval is set in seconds with 0.1 [s] accuracy within 0.1 [s] - 3600 [s] range.

#### Procedure:

- Enter **<5.1.PC / 5.1.3.Int>** submenu, window for entering interval value is displayed.



- Press key to confirm, next go to the home screen.

## 15.2. Printer

### 15.2.1. Printer Port

Parameter enabling you to select port to which data is to be sent upon pressing



key.

#### Procedure:

- Enter **<5.2.Prtr / 5.2.1.Prt>** submenu.



- Press key, parameter values are displayed successively one by one:  
**nonE** – none port selected; **rS1** – RS232 (1); **rS2** – RS232 (2)\*; **UUF** – Wireless communication \*.



- Press key to confirm, next go to the home screen.

\*) – option.

### 15.3. Additional Display

The weighing instrument can cooperate with additional WD displays.

#### 15.3.1. Additional Display Port

- Enter **<5.3.AdSP / 5.3.1.Prt>** submenu.



- Press key, parameter values are displayed successively one by one:  
**nonE** – none; **rS1** – RS232 (1); **rS2** – RS232 (2) \*.



- Press key to confirm, next go to the home screen.

\*) – option.

## 16. PRINTOUTS

It is possible to define adjustment report printout template and GLP printout template. To set the printouts go to **< P6.Prt >** submenu.

### 16.1. Adjustment Report

**<P6.1.CrEP>** is a group of parameters allowing you to declare variables that are to be printed on an adjustment report printout. Each variable features accessibility attribute: **YES** – print, **no** – do not print. Adjustment report is automatically generated at the end of each adjustment process.

**Variables list:**

No.	Name	Description
6.1.1.	CtP	Performed adjustment type.
6.1.2.	dAt	Adjustment date.
6.1.3.	tin	Adjustment time.
6.1.4.	ldb	Serial number of the scale.
6.1.5.	CdF	Difference between mass of adjustment weight that was measured during last adjustment and mass of currently measured adjustment weight.
6.1.6.	dSh	Dashed line separating printout data and signature fields.
6.1.7.	SiG	An area for the signature of an operator carrying out the adjustment.



***Printouts are generated exclusively in English.***

## Report example:

```
-----Calibration Report-----  
Calibration type           External  
Date                      2016.10.15  
Time                      12:39:23  
Balance ID                123456  
Difference                 -0.02g  
-----  
Signature  
.....
```

## 16.2. GLP Printout

<P6.2.GLP> is a group of parameters allowing you to declare variables that are to be printed on a weighing printout. Each variable features accessibility attribute: **YES** – print, **no** – do not print.

### Variables list:

No.	Name	Description
6.2.1.	dAt	Performed weighing date.
6.2.2.	tin	Performed weighing time.
6.2.3.	ldb	Serial number of the scale.
6.2.4.	n	Net weight value of performed weighing in basic measuring unit.
6.2.5.	t	Tare weight value in the current unit.
6.2.6.	b	Gross weight value in the current unit.
6.2.7.	CrS	Current weighing result (net weight) in a current unit.
6.2.8.	CrP	The last adjustment report generated in accordance with settings declared for the adjustment report printout.



***Printouts are generated exclusively in English.***

## Report example:

Date	2016.10.15
Time	12:04:17
Net	49.98g
Tare	17.20g
Gross	67.18g

## 17. MISCELLANEOUS PARAMETERS


<P7.Othr> is a group of parameters enabling you to adapt the scale to individual needs.

### 17.1. Backlight


Parameter allowing you to change display brightness, the brightness can be changed within **0% - 100%** range.

#### Procedure:

- Enter <P7.Othr / 7.1.bLbt> submenu.

- Press  key, parameter values are displayed successively one by one, where:

<b>nonE</b>	Backlight off.
<b>10</b>	Display brightness low limit value in [%].
<b>100</b>	Display brightness high limit value in [%].


- Press  key to confirm, next go to the home screen.


### 17.2. 'Beep' Sound

Parameter allowing you to enable/disable sound signal informing the operator about pressing panel key(s).

#### Procedure:

- Enter <P7.Othr / 7.2.bEEP> submenu.



- Press  key, parameter values are displayed successively one by one: **no** – sound signal disabled, **YES** - sound signal enabled.

- Press  key to confirm, next go to the home screen.

### 17.3. Automatic Shutdown

Parameter allowing you to set time interval, in [min], after which the weighing device shuts down automatically. If the indication is stable during the declared time interval, the device is shut down automatically. Shutdown function is inactive and the device cannot be turned off if any process is started or if you operate the menu.

#### Procedure:

- Enter **<P7.Othr / 7.3.t1>** submenu.
- Press  key, parameter values are displayed successively one by one: **nonE** – function disabled, **1, 2, 3, 5, 10**.
- Press  key to confirm, next go to the home screen.

### 17.4. Date and Time

Parameter allowing you to set current date and time and to specify date and time format.

#### Procedure:

- Enter **<P7.Othr>** submenu and change the settings. Refer to the below table:

Parameter	Description
<b>&lt;7.4.SdAt&gt;</b>	Enter this parameter to set current date, where the date format is <b>YYYY.MM.DD*</b> .
<b>&lt;7.5.Stnn&gt;</b>	Enter this parameter to set current time, where the time format is <b>24H**</b> .
<b>&lt;7.6.FdAt&gt;</b>	Enter this parameter to select date format. Available values: <b>1</b> - DD.MM.YYYY, <b>2</b> - MM.DD.YYYY, <b>3</b> - YYYY.MM.DD* (set by default), <b>4</b> - YYYY.DD.MM.
<b>&lt;7.7.Ftin&gt;</b>	Enter this parameter to select time format. Available values: <b>24H**</b> (set by default), <b>12H**</b> .

\*) - Date format: Y – year, M – month, D – day.



\*\*) - Time format: 12H – 12-hour format, 24H - 24-hour format.

### 17.5. Default Operator Settings

Parameter allowing you to restore default operator settings.



## Procedure:

- Enter **<P7.Othr / 7.8.dFLu>** submenu, text **<Cont?>** is displayed (Continue?).  

- Press  key to confirm. The process of restoring default settings starts, this is signalled with display of 'dash', **< - >**.
- Upon process completion **<7.8.dFLu>** submenu is displayed. Go to home screen.

## 18. SCALE DATA

Scale data menu, **<P8.InFo>**, provides information on the weighing device and its program. The parameters serve informative purposes:




Parameter	Description
<b>&lt;8.1.ldb&gt;</b>	Serial number of the scale.
<b>&lt;8.2.PurS&gt;</b>	Program version.
<b>&lt;8.3.PStP&gt;</b>	Settings printout. Enter the parameter to send scale settings to printer port (all parameters).

## 19. WORKING MODES – General Information

The weighing device features the following working modes:

- Weighing,
- Parts counting,
- +/- control,
- Percent weighing %,
- Peak Hold,
- Totalizing,
- Animal weighing.

### 19.1. Running Working Mode

- Go to home screen, press  key, name of the first available working mode is displayed.
- Press  key, names of available working modes are displayed successively one by one.
- Enter selected working mode, to do it press  key.



***The weighing device program has been designed to make the scale run, upon restart, with the latest operated working mode on.***


## 19.2. Working Modes Local Settings

Each working mode features specific (local) functions which enable adapting device operation to individual needs. The functions are to be found in local settings. To go to local settings of each working mode enter **<P3.Func>** submenu. Some special functions are available for all working modes, refer to the table below:



	Accessibility	Save mode	Time interval	Lo threshold
Weighing	3.1.1.Acc	3.1.2.Snn	3.1.3.Int	3.1.4.Lo
Parts counting	3.2.1.Acc	3.2.3.Snn	3.2.4.Int	3.2.5.Lo
+/- control	3.3.1.Acc	3.3.2.Snn	3.3.3.Int	3.3.4.Lo
Percent weighing %	3.4.1.Acc	3.4.3.Snn	3.4.4.Int	3.4.5.Lo
Peak Hold	3.5.1.Acc	-	-	3.5.2.Lo
Totalizing	3.6.1.Acc	3.6.2.Snn	3.6.3.Int	3.6.4.Lo
Animal weighing	3.7.1.Acc	-	-	3.7.3.Lo

The table presents special function number and name for each of the working modes. Remaining specific functions referring directly to a given working mode are described further down this user manual.

### 19.2.1. Working Mode Accessibility

To enable/disable given working mode, press  key.


#### Procedure:


 
- Enter **<P3.Func>** menu and select given working mode.
- Go to **<Acc>** function.
- Press  key, parameter values are displayed successively one by one:  
**YES** – working mode enabled, **no** – working mode disabled.
- Press  key to confirm, next go to the home screen.


### 19.2.2. Save Mode

Parameter allowing you to set mode of sending data from the weighing device to a peripheral device.

#### Procedure:

- Enter **<P3.Func>** menu and select given working mode.
- Go to **<Snn>** function.
- Press  key, parameter values are displayed successively one by one:


<b>StAb</b>	Manual printout of stable weighing result. Upon pressing  key at the moment when the result is unstable (no  pictogram displayed), the program first waits for the stability condition to be met, only then printout is carried out.
<b>nStAb</b>	Manual printout of each weighing result. In case of unstable indication, <b>&lt;?&gt;</b> sign is displayed in front of the 'mass frame'. <b>Function available for non-verified scales exclusively.</b>
<b>rEPL</b>	Automatic printout of the first stable weighing result above <b>&lt;Lo&gt;</b> threshold (to set <b>&lt;Lo&gt;</b> threshold go to <b>&lt;Lo&gt;</b> parameter).
<b>rEPLi</b>	Automatic printout with time interval set in <b>[min]</b> (to set the interval go to <b>&lt;Int&gt;</b> parameter).

- Press  key to confirm, next go to the home screen.

### 19.2.3. Automatic Printout Time Interval

Parameter enabling you to set frequency of automatic printout. Printout interval is set in minutes with 1 [min] accuracy within 1 [min] 1440 [min] range.


#### Procedure:

- Enter **<P3.Func>** menu and select given working mode.
- Enter **<Int>** function, window for entering **time interval** value is displayed.
- Press  key to confirm, next go to the home screen.

### 19.2.4. Lo Threshold

**<Lo>** parameter allows you to configure the function of automatic operation. In order to save the next measurement, before carrying it out the mass indication must get below the set net value of Lo threshold.

## Procedure:

- Enter **<P3.Func>** menu and select given working mode.
- Enter **<Lo>** function, window for entering **Lo threshold** value is displayed.
- Enter respective value and press  key to confirm, then continue weighing.

## 20. WORKING MODE – WEIGHING

**<UUGG>** is a standard working mode enabling you to carry out the weighing operation along with record of the result to the database.

### 20.1. Local Settings

To go to local settings enter **<3.1.UUGG>** submenu.

<b>3.1.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.1.2.Snn</b>	Save mode	For detailed description read section 19.2.2.
<b>3.1.3.Int</b>	Time interval	For detailed description read section 19.2.3.
<b>3.1.4.Lo</b>	Lo threshold	For detailed description read section 19.2.4.

## 21. WORKING MODE – PARTS COUNTING

Parts Counting is a working mode enabling you to determine quantity of small pieces of the same mass, which determination is done on the basis of mass of sample piece (single part), and where the sample piece mass (single part mass) is determined using the weighing device.

### 21.1. Local Settings

To go to local settings enter **<3.2.PcS>** submenu.


<b>3.2.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.2.2.UUt</b>	Operation mode	For detailed description read section 21.1.1.
<b>3.2.3.Snn</b>	Save mode	For detailed description read section 19.2.2.
<b>3.2.4.Int</b>	Time interval	For detailed description read section 19.2.3.
<b>3.2.5.Lo</b>	Lo threshold	For detailed description read section 19.2.4.

### 21.1.1. Selecting Operation Mode

Parameter allowing you to select method of determination of sample piece mass.

#### Procedure:


- Enter **<3.2.PcS / 3.2.2.UUt>** submenu.


- Press  key, parameter values are displayed successively one by one:

<b>S_S</b>	Select to set sample mass by determining mass of a single part.
<b>Suu</b>	Setting set sample mass by entering mass of a single part.


- Enter respective value and press  key to confirm, then continue weighing.

### 21.2. Setting Sample Mass by Entering Mass of a Single Part




- Enter **<3.2.PcS / 3.2.2.UUt>** submenu, set **<Suu>** value.
- Enter **<PcS>** working mode (parts counting), first, text **<SEt\_Ut>** is displayed for 1 s, next, window for entering mass value of a single part.
- Enter respective value and press  key to confirm, home screen is displayed automatically along with quantity of parts loaded onto the weighing pan (pcs).





	<b><i>If the value of entered single part mass is greater than max capacity value, then message &lt;Err Hi&gt; is displayed.</i></b>
---	--

### 21.3. Setting Sample Mass by Determining Mass of a Single Part

- Enter **<3.2.PcS / 3.2.2.UUt>** submenu, set **<S\_S>** value.
- Enter **<PcS>** working mode (parts counting), blinking value of sample quantity is displayed.
- Press  key to select one of the following options:

<b>10</b>	Reference sample quantity: 10 pcs.
<b>20</b>	Reference sample quantity: 20 pcs.
<b>50</b>	Reference sample quantity: 50 pcs.
<b>100</b>	Reference sample quantity: 100 pcs.
<b>0000</b>	Custom reference sample quantity - enter the required value yourself.

- Select respective option and press  key to confirm, first, text **<LoAd>** is displayed for 1 second, then the weighing window.
- If the parts are to be weighed in a container, first put the container on a weighing pan and tare it.
- Load the weighing pan with declared amount of parts. When the indication is stable ( pictogram is displayed), press  key to confirm the mass.
- Single part mass is calculated automatically, next quantity of parts (pcs) is displayed.

	<b><i>Total weight value of all parts loaded onto the weighing pan cannot be greater than the max capacity value.</i></b>
	<b><i>Single part mass value must be equal or greater than 0.1 of the reading unit. Unless this condition is met, the weighing device displays a message &lt;Err Lo&gt;.</i></b>
	<b><i>In the course of parts quantity determination before confirming the declared quantity value it is necessary to wait for a stable measurement, .</i></b>

## 22. WORKING MODE – +/- CONTROL

+/- control is a working mode enabling you to enter checkweighing thresholds values (**Min**, **Max**).



### 22.1. Local Settings

To go to local settings enter **<3.3.HiLo>** submenu.



<b>3.3.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.3.2.Snn</b>	Save mode	For detailed description read section 19.2.2.
<b>3.3.3.Int</b>	Time interval	For detailed description read section 19.2.3.
<b>3.3.4.Lo</b>	Lo threshold	For detailed description read section 19.2.4.

### 22.2. Declaring Checkweighing Thresholds

- Enter **<HiLo>** working mode (+/- control), first, text **<SEt Lo>** is displayed for 1 s, next, window for declaring low weighing threshold (Min).

- Enter respective value and press  key to confirm, first, text **<SEt Hi>** is displayed for 1 second, next, window for declaring high weighing threshold (Max).
- Enter respective value and press  key for confirmation, working mode's home screen is displayed along with declared threshold value, where:

<b>Min</b>	Load mass lower than low weighing threshold.
<b>Ok</b>	Load mass within weighing thresholds.
<b>Max</b>	Load mass greater than high weighing threshold.

	<b><i>If the entered low threshold value (Min) is greater than high threshold value (Max), &lt;Err Lo&gt; error is displayed.</i></b>
	<b><i>If the entered high threshold value (Max) is greater than the maximum capacity value, &lt;Err Hi&gt; error is displayed.</i></b>

## 23. WORKING MODE – PERCENT WEIGHING

Percent weighing is a working mode enabling you to compare measured load mass with the reference sample mass. The result is expressed in [%]. Reference sample mass can be either determined by weighing or entered to weighing device memory by an operator.

### 23.1. Local Settings

To go to local settings enter **<3.4.dEu>** submenu.

<b>3.4.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.4.2.UUt</b>	Operation mode	For detailed description read section 23.1.1.
<b>3.4.3.Snn</b>	Save mode	For detailed description read section 19.2.2.
<b>3.4.4.Int</b>	Time interval	For detailed description read section 19.2.3.
<b>3.4.5.Lo</b>	Lo threshold	For detailed description read section 19.2.4.


#### 23.1.1. Selecting Operation Mode

Parameter allowing you to select method of determination of reference weight mass.

## Procedure:

- Enter **<3.4.dEu / 3.4.2.UUt>** submenu.



- Press  key, parameter values are displayed successively one by one:

<b>S_S</b>	Select to set reference sample mass by determining the mass value.
<b>Suu</b>	Select to set reference sample mass by entering the mass value.





- Set respective value and press  key to confirm, next go to the home screen.

## 23.2. Reference Sample Mass Determined by Weighing

- Enter **<3.4.dEu / 3.4.2.UUt>** submenu, set **<S\_S>** value.
- Enter **<dEu>** working mode (Percent weighing), first, text **<LoAd>** is displayed for 1 second, then the weighing window.
- Load the weighing pan with the reference sample. When the indication




is stable ( pictogram is displayed), press  key to confirm the mass.

- Mass of the weighed load is automatically set as reference sample mass, the home screen is displayed along with **100.000%** value.

## 23.3. Reference Sample Mass Determined by Entering the Mass Value

- Enter **<3.4.dEu / 3.4.2.UUt>** submenu, set **<Suu>** value.
- Enter **<dEu>** working mode (Percent weighing).
- Text **<SEt\_Ut>** is displayed for 1 s, next, window for declaring mass value of reference sample.



- Enter respective value and press  key to confirm. The home screen is displayed automatically with **0.000%** value.



***If the value of entered reference sample mass is greater than max capacity value, then message <Err Hi> is displayed.***

## 24. WORKING MODE – PEAK HOLD

Peak Hold is a working mode allowing you to snap value of maximum force applied to the weighing pan during one weighing process.




## 24.1. Local Settings

To go to local settings enter **<3.5.toP>** submenu.

<b>3.5.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.5.2.Lo</b>	Lo threshold	For detailed description read section 19.2.4.

## 24.2. Peak Hold Operation

- Enter **<3.5.toP / 3.5.2.Lo>** submenu, set **<Lo>** parameter value (Lo threshold) after exceeding of which maximum force is to be registered.
- Enter **<toP>** working mode (Peak Hold). From now on the scale registers and holds every single weighting which is above the **Lo threshold**, and which is higher than the result of the previous peak hold. Snapped peak hold value is signalled by **<Max>** pictogram displayed at the top of the screen.
- The start of the next process of peak hold measurement is possible only after removing the load from the weighing pan and pressing  key.
- This causes returning to the home screen of **<toP>** mode. Pictogram **<Max>** is automatically deleted.

## 25. WORKING MODE – TOTALISING

Totalising is a working mode enabling you to sum mass of all weighed ingredients, and to print (via scale-connected printer) the total mass value. The program allows you to sum up to 30 weighings (ingredients) maximum within one process.






### 25.1. Local Settings

To go to local settings enter **<3.6.Add>** submenu.

<b>3.6.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.6.2.Snn</b>	Save mode	For detailed description read section 19.2.2.
<b>3.6.3.Int</b>	Time interval	For detailed description read section 19.2.3.
<b>3.6.4.Lo</b>	Lo threshold	For detailed description read section 19.2.4.



### 25.2. Totalising Operation

- Enter **<Add>** working mode (Totalising), blinking „▲” pictogram is displayed.

- If the ingredients are to be weighed in a container, first put the container on a weighing pan and tare it.
- Load the weighing pan with the ingredient no.1. When the indication is stable ( pictogram is displayed), press  key to confirm the mass.
- Total mass value is displayed, now the „▲” pictogram is displayed continuously.
- Unload the weighing pan, **ZERO** is displayed, „▲” marker starts blinking again.
- Load the weighing pan with the ingredient no.2, wait for a stable weighing result and press  key.
- Total mass value of ingredient no. 1 and 2 is displayed, now the „▲” pictogram is displayed continuously.
- In order to finish the process, press  key, text <Prnt?> (Print?) is displayed.
- Press  key, total mass value of all recorded weighings is printed on a scale-connected printer.

### Report example:

(1)	13.500 g
(2)	14.400 g
(3)	9.700 g
(4)	100.500 g
(5)	4.000 g
(6)	8.200 g
(7)	20.800 g
(8)	5.800 g
-----	
Total:	176.900 g

- In order to print the report once again press  key.
- To exit "report printout mode" press  key. As a result home screen of <Add> working mode is displayed and all the data get zeroed automatically.



***If the display capacity is exceeded (i.e. there is not enough space for all the digits of the weighing result) <Hi> error is displayed. In such a case either remove the ingredient from a weighing pan and finish the totalising process or place load of a lower weight value on the weighing pan.***

## 26. WORKING MODE – ANIMAL WEIGHING





Animal Weighing is a working mode enabling you to weigh products that disrupt efficient establishing of stability. It is mostly intended to measure weight of animals.

### 26.1. Local Settings


To go to local settings enter **<3.7.AnLS>** submenu.

<b>3.7.1.Acc</b>	Working mode accessibility	For detailed description read section 19.2.1.
<b>3.7.2.Aut</b>	Averaging time	Enter this parameter to declare duration of the process in seconds (5s, 10s, 20s, 30s, 40s, 50s, 60s) - on the basis of indications recorded within the set time interval the scale calculates the weighing result, i.e. an average weight value.
<b>3.7.3.Lo</b>	Lo threshold	For detailed description read section 19.2.4.


### 26.2. Animal Weighing Operation

- Enter **<AnLS>** working mode (Animal Weighing).
- First text **<tinnE>** is displayed for 1 s, next, window for setting duration (in seconds) of animal weighing.
- Press  key, parameter values are displayed successively one by one: 5[s], 10[s], 20[s], 30[s], 40[s], 50[s], 60[s].
- Set the respective value, press  key to confirm, weighing window with **A** letter is displayed.
- Load the weighing pan with an animal.
- On exceeding the set mass value of **<Lo> threshold** parameter, animal weighing starts, this is signalled with display of 'dash', **< - >**.
- Upon process completion mass value of an animal is snapped and displayed together with **OK** pictogram in the upper part of the display. The snapped mass value is sent to a scale-connected printer.
- Press  key to restart animal weighing.
- Press  key to reprint the snapped mass value.
- Upon unloading of the weighing platform, the weighing window with letter **A** is displayed. The scale can be loaded with an animal again.

## 27. DIAGRAMS OF CONNECTION CABLES

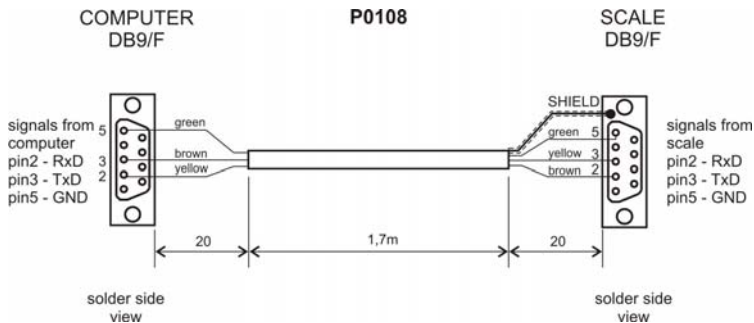

*scale – computer cable*

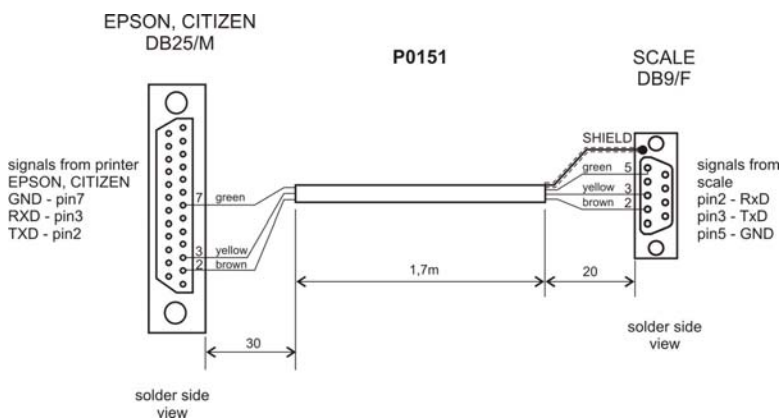

*scale - printer cable (EPSON)*

## 28. TROUBLESHOOTING

Problem	Cause	Solution
The scale does not switch on.	Battery discharged.	Connect the scale to the mains, charge the battery (batteries).
	No batteries (batteries not installed or installed incorrectly).	Check if batteries are installed correctly (polarization).
The scale switches off automatically.	<7.3.t1> parameter set to value enforcing scale shut-down after particular time interval.	Go to 'Othr' menu, set <7.3.t1> parameter to 'nonE' value.
During switching on, message 'LH' is displayed.	Weighing pan loaded during switching on process.	Unload the weighing pan. Zero indication is displayed.

## 29. ERROR MESSAGES

<b>- Err 2 -</b>	- Value beyond zero range.
<b>- Err 3 -</b>	- Value beyond tare range.
<b>- Err 4 -</b>	- Adjustment weight or start mass out of range ( $\pm 1\%$ for adjustment weight, $\pm 10$ for start mass).
<b>- Err Lo -</b>	- Determined mass of single part in 'Parts counting' mode too small. - Value of 'Min' threshold is greater than value of 'Max' threshold in '+/- control' mode.
<b>- Err Hi -</b>	- Entered value of single part greater than maximum capacity in 'Parts counting' working mode. - Entered value of 'Max' threshold greater than maximum capacity in '+/- control' mode. - Entered reference mass greater than maximum capacity in 'Percent weighing' mode.
<b>- Err 8 -</b>	- Time of the following operations exceeded: taring, zeroing, start mass determining, adjustment process.
<b>- null -</b>	- Zero value from converter.
<b>- FULL -</b>	- Weighing range exceeded.
<b>- LH -</b>	- Start mass error, indication out of range ( $-5\% - +15\%$ of start mass).
<b>- Hi -</b>	- Display range of total mass on scale display exceeded in 'Totalizing' mode.



**RADWAG BALANCES AND SCALES**  
ADVANCED WEIGHING TECHNOLOGIES

