PUE HY10

WEIGHING INDICATOR

USER MANUAL

ITKU-88-03-08-17-EN



Table OF CONTENTS

1. INTENDED USE	9
2. PRECAUTIONARY MEASURES	
2.1. Precautions	9
2.2. Operation in a strong electrostatic field	
2.3. Scale washing	10
3. WARRANTY CONDITIONS	11
4. UNPACKING AND MOUNTING	12
5. WEIGHING INDICATOR STRUCTURE	13
5.1. External view	
5.2. Main dimensions	
5.3. Description of connectors	14
5.4. Connectors' pins layout	
5.5. Inputs/Outputs	
5.5.1. Inputs/Outputs: technical specifications	16
5.5.2. Inputs/Outputs schematic diagram	17
6. GETTING STARTED	17
7. KEYPAD OVERLAY	17
8. FUNCTIONS OF KEYS	
9. PROGRAM STRUCTURE	19
10. INDICATING WINDOW	
10.1. Top bar	20
10.2. Workspace	21
11. LOGGINGG IN	
11.1. Logging in - procedure	
11.2. Logging out procedure	
11.3. Authorization access levels	22
12. NAVIGATING WITHIN THE MENU	23
12.1. Keys	
12.2. Return to weighing	
13. WEIGHING	25
13.1. Conditions of operational use	
13.2. Zeroing	26
13.3. Tarring	27
13.4. Weighing for dual range scales	27
13.5. Toggling between weighing units	28
14. SCALE PARAMETERS	29
14.1. Median filter	
14.2. Filter	30
14.3. Autozero	
14.4. Minimum weight for different functions (LO)	
14.5. Last digit	
15. COMMUNICATION	32
15.1. RS 232 settings	
15.2. ETHERNET setting	33
15.3. TCP protocol setting	33
15.4. Wi-Fi	
15.4.1. Wi-Fi network status	
15.4.2. Available networks	
15.4.3. Transmission parameters	
16. DEVICES	
16.1. Computer	
16.1.1. Computer port	
16.1.2. Computer address	
16.1.3. Continuous transmission	
16.1.4. Weighing printout template	
16.1.5. Cooperation with "E2R System"	
16.2. Printer	
16.2.1. Printer port	
16.2.2. Printer code page	40
16.2.3. Templates for printouts	
16.3. Printouts activation	42

		Barcode scanner	
		16.4.1. Port for barcode scanner	43
		16.4.2. Prefix / Suffix	
		16.4.3. Field selection	
		16.4.4. Test	
	16.5.	Transponder card reader	47
		16.5.1. Com port for transponder card readers	
		16.5.2. Procedure of attributing the card number to an operator	
	16.6.	Additional display	48
		16.6.1. Additional display port	
		16.6.2. Communication protocol frame	
	16.7.	Modbus RTU	49
		16.7.1. Communication port	50
		16.7.2. Address	
		Advanced settings	
17	. DIS	PLAY	51
		Display components	
		Mass	
	17.3.	Text strings	55
		17.3.1. Display templates	55
		Function keys	
	17.4.	I unului reys	51
	17.5.	Bargraph	57
		17.5.1. Bargraph type	58
		17.5.2. Bargraph "Fast weighing"	
		17.5.3. Bargraph "Signalling of checkweighing ranges"	E0
		17.5.3. Bargraph Signalling of checkweighing ranges	59
		17.5.4. Bargraph type: "Linear"	60
		17.5.5. "Control" bargraph	61
1Ω		UTS / OUTPUTS	
	40.4		00
		Configuration of inputs	
	18.2.	Configuration of outputs	64
19	ΔΙΙ	THORÏZATION	65
		Anonymous Operator	
	19.2.	Date and time	66
	193	Printouts	66
		Databases edition	
		Delete older data	
	19.6.	Set element from the database	68
	19.7	PGC	69
20		TS	
20			
	20.1.	Units accessibility	69
	20.2	Start unit	70
		User defined units	
		Acceleration of gravity	
21	. OTI	HER PARAMETERS	72
		Languages	
		Setting date and time	
	21.3.	Sound signal	73
		Screen brightness	
	21 5	Energy saving mode	71
	Z1.5.	Lifetyy saving mode	14
		Screen timeout	
	21.7.	Log out automatically when time elapses	75
		Permissible quantity of unsuccessful logging	
		Logging in required	
). Start logo	
	21.11	I.Error information preview time	77
		2. Export / import of settings	
22		ER ADJUSTMENT	
	22.1.	Adjusting procedure	79
		Start mass adjustment	
	22.2.	Orac mass adjustment	00
	// 3	Report from adjustment process	
		A discretion and the also as a seal	
	22.4.	Adjustment track record	
23	22.4.		
23	22.4. . SO I	FTWARE UPDATE	82
23	22.4. . SOI 23.1.	FTWARE UPDATEON-LINE updating	82 83
23	22.4. . SOI 23.1. 23.2.	FTWARE UPDATE	82 83 84

24. SPECIAL FUNCTIONS OF WORKING MODES	
24.1. Working modes accessibility	
24.2. Save mode	
24.3. Down-weighing	88
24.4. Checkweighing	
24.5. Tare mode	
24.6. Labelling mode	
24.6.1. Setting of the number of labels to print	91
24.6.2. Setting of the number of cumulative labels to print	91
24.6.3. Setting of the number of CC labels to print	91
24.6.4. Automatic triggering of cumulative labels	
24.6.5. Automatic triggering cumulative labels of cumulative labels	93
24.7. Statistics	
24.8. Differential weighing	
24.8.1. Local settings	96
24.8.2. Reporting completed processes of differential weighing	
24.9. Peak hold	
24.10.Information about saved measurement	
24.11.Packaging quantity query	98
25. WORKING MODE - WEIGHING	
25.1. Starting the working mode	
25.2. Local setting of a working mode	99
26. WORKING MODES - PARTS COUNTING	
26.1. Starting the working mode	
26.2. Local settings of the working mode	100
26.2.1. Automatic correction of reference mass	
26.2.2. Minimum reference mass	
26.3. Setting a reference unit by entering known piece mass	
26.4. Setting a reference unit by weighing a sample	103
26.5. Setting the reference mass by entering single piece mass directly to the database	104
26.6. Entering the unit mass to the database	
27. WORKING MODES – PERCENT SETUP (DEVIATIONS)	
27.1. Starting the operating mode	
27.2. Local settings of the working mode	
27.4. Entering reference unit mass into the memory	
28. WORKING MODES - DOSING	
28. 1. Starting the working mode	
28.2. Dosing process structure	
28.3. Local setting of a working mode	
28.4. Description of functions and setting dosing process	
28.5. Creating a new dosing process	111
28.6. Instances of dosing processes	
28.6.1. Instance 1 – Manual dosing process of 4 ingredients on 2 weighing platforms	111
28.6.2. Instance 2 – Automatic dosing of 2 ingredients on 2 weighing platforms	
28.6.3. Instance 3 – Mixed dosing process	
28.7. Reporting of completed dosing processes	120
29. WORKING MODES – FORMULATION	
29.1. Starting the working mode	
29.2. Local setting of a working mode	122
29.3. Creating a new formulation	
29.4. Formula making process.	
29.5. Reporting from completed formula making processes	128
29.5. Reporting from completed formula making processes 30. WORKING MODE – PGC (CONTROL OF PREPACKED GOODS)	129
30.1. Starting the working mode	130
30.2. Control settings mode window	
30.3. Local setting of a working mode	
30.4. Editing a product to be controlled	133
30.5. Control start procedure	135
30.6. Control aborting procedure	136
30.7. Logging out from a control process in progress	137
30.8. Non-destructive average tare control mode	138
30.9. Performing non-distructive testing in mode Empty-Full	144
30.10.Performing destructive testing in modes Empty-Full and Full-Empty	
30.11.Control in accordance with internal criteria	146

30.11.1. Abort of control - procedure1	148
30.11.2. Procedure of control completion	149
30.12. Simultaneous carrying out two control processes	150
30.13.Report from estimating average tare1	
30.14 Report from product testing1	153
31. WORKING MODES - DENSITY	155
31.1. Starting the working mode	
31.2. Local setting of a working mode	155
31.3. Carrying out density determination procedure	156
31.3.1. Determining density of liquids	156
31.3.2. Determining density of solids	
31.3.3. Determining density of pycnometer	159
31.3.4. Determining density of a porous body	
31.4. Reporting from completed density determination processes	163
31.5. Table of density parameter for water	164
31.6. Table of density parameter for ethyl alcohol	
32. WORKING MODES – ANIMAL WEIGHING	
32.1. Starting the operating mode	
32.2. Local setting of a working mode	
32.3. Carrying out animals weighing procedure	
33. WORKING MODE – VEHICLE SCALE	166
33.1. Working mode activating procedure	166
33.2. Working mode local settings.	
33.3. Vehicle transaction course	
33.3.1. Entrance / Exit transaction	
33.3.2. Control weighment transaction	
33.4. Open transactions table	
33.5. Printout templates for an ongoing transaction	176
33.6. Executed transactions – reporting	
34. DATABASES	
34.1. Database configuration	
34.1.1 Database configuration	
34.1.2. Categories	
34.1.3. Database variables operation	
34.1.4. Change name of an extra variables database	
34.1.6. Databases export / import	
34.2. Searching databases	
34.2.2. Quick code search	
34.3. Adding new items in databases	
34.4. Deleting items in databases	
34.5. Printing items from databases	
34.6. Context menu	
34.7. Database edit window	
34.7.1. Operators' database	
34.7.2. Database of products	185
34.7.3. Database of clients	
34.7.4. Database of dosing processes	
34.7.5. Database of formulations	
34.7.6. PGC time schedules database	
34.7.7. Database of vehicles	
34.7.8. Identification processes database	
34.7.9. Database of packages	
34.7.10. Database of warehouses	
34.7.11. Database of labels	
34.7.12. Database of universal variables	
34.7.13. Extra variables database	193
34.7.14. Images database	194
35. REPORTS1	
35.1. Reports configuration	
35.1.1. Reports accessibility	
35.1.2. Configuration of a lot number	
35.1.3. Configuration of a batch number	
35.1.4. Query for number of weighings to be deleted	197

35.3. Weighment date search 35.4. Reports from weighment records. 35.4. Filtering. 35.4. Report printout. 25.5.4.3. Weighments chart. 26.35.4.3. Weighments chart. 27.35.4.3. Export a database to a file. 28.35.4.5. Counter of weighments records. 29.35.5. Reports preview. 20.35.5. Reports preview. 20.35.5. Reports from dosing. 20.35.5. Reports from recipes. 20.35.5. Reports from recipes. 20.35.5. Reports from recipes. 20.35.5. Controls reports. 20.35.5. Controls reports. 20.35.5. Controls reports. 21.35.5. Density reports. 22.35.5. Density reports. 23.35.5. Report from vehicle scale. 23.35.5. Differential weighments reports. 21.35.5. Differential weighments reports. 22.35.5. Differential weighments reports. 23.36. Identification process unctions. 23.36. Identification process runctions. 23.36. Identification process - reativation procedure. 23.36. Activation by programmable button. 23.36. Activation by programmable button. 23.36. Activation by programmable button. 23.37. Gommands. 23.37. Georgian information. 23.37. Gommands. 23.37. Georgian information. 23.37. Activation by programmable button. 23.37. Georgian information. 24. Sartivation by concurrent unit. 25. Georgian information. 26. Georgian information. 27. Georgian information. 28. Georgian information. 29. Georgian information. 29. Georgian information. 29. Georgian information. 20. Georgian inf		2. Deleting older data	
35.4.2. Reports from weighment records. 15 35.4.2. Report printout. 22 35.4.3. Weighments chart. 22 35.4.4. Export a database to a file. 22 35.4. Export a database to a file. 22 35.5. Reports preview. 22 35.5.1. Weighments / Alibi. 22 35.5.2. Reports from dosing. 25 35.5.3. Reports from recipse. 26 35.5.5. Controls reports. 22 35.5. Controls reports. 22 35.5. Paper from vehicle scale. 21 35.5. Differential weighments reports. 22 35.5. Differential weighments reports. 23 36. IDENTIFICATION PROCESSES. 21 36. List of identification process tunctions. 21 36. List of identification process tunctions. 21 36. J. Activation by operator logging. 22 36. Activation by operator logging. 22 36. Activation by operator logging. 23 37. COMMUNICATION PROTOCO. 22 37. Commands description. 22 37. 4. Commands description. 22 37. 4. Evening. 22 37.	35.3	B. Weighment date search	198
35.4.1. Filtering. 11 35.4.2. Report printout 22 35.4.3. Weighments chart 22 35.4.5. Counter of weighments records 22 35.5. Reports preview 22 35.5.1. Weighments / Alibi 22 35.5.1. Weighments / Alibi 22 35.5.1. Density repords. 26 35.5.3. Reports from dosing. 26 35.5. Density repords. 26 35.5. Controls reports. 27 35.5. A Verage tare reports. 27 35.5. Report from vehicle scale. 21 35.5. Report from vehicle scale. 22 35.5. Differential weighments reports. 22 36. Identification process functions. 22 36. Identification process e- readinon. 22 36. Identification process functions. 22 37. Learning. 22 38. Identification process e- readin			
35.4.2 Report printout			
35.4.3. Weighments chart. 35.4.4. Export a database to a file 35.4.5. Counter of weighments records 35.5. Reports preview 22. 35.5.1. Weighments / Alibi 35.5. Reports from dosing. 25. 35.5.2. Reports from recipes. 26. 35.5.2. Reports from recipes. 27. 35.5.3. Reports from recipes. 28. 35.5.4. Density reports. 28. 35.5.6. Outriols reports. 29. 35.5.6. Average later reports. 30.5.6. Average later reports. 30.5.6. Average later reports. 30.5.6. Average later reports. 30.5.6. Average later reports. 30.5.8. Differential weighments reports. 31. 35.7. Report from vehicle scale. 32. 35.5. Bufferential weighments reports. 33. Identification process – creation. 36. List of identification process functions. 36. List of identification process functions. 37. Activation by programmable button. 38. Activation by programmable button. 39. 30.3. Activation by programmable button. 31. 36.3. Activation by product selection. 32. 37. Activation of the product selection. 31. ComMUNICATION PROTOCOL. 31. General information. 31. List of RS commands. 31. Respond message format. 31. List of RS commands. 31. Respond message format. 31. Zeroing. 31. A. Seroin description. 31. A. Seroin descri			
35.4.4 Export a database to a file			
35.4 S. Counter of weighments records. 35.5 Reports preview. 35.5.2 Reports from dosing. 35.5.2 Reports from dosing. 35.5.3 Reports from recipes. 22.35.5.4 Density reports. 35.5.5 Controls reports. 35.5.5 Controls reports. 35.5.5 Controls reports. 35.5.6 A vertage tare reports. 35.5.7 Report from vehicle scale. 35.5.8 Differential weighments reports. 36.1 Identification process — creation. 37.6 List of identification process functions. 22.36.1 Identification process — creation. 36.2 List of identification process functions. 23.3 Identification process — creation. 36.3.1 Identification process — creation. 36.3.2 List of identification process functions. 27.36.3.1 Activation by programmable button. 28.3.3.3 Activation by programmable button. 29.36.3.3 Activation by programmable button. 20.37.3 Activation by product selection. 21.37.4 ComMUNICATION PROTOCOL. 22.37.1 General information. 23.37.2 List of RS commands. 23.37.4 Commands. 23.37.4 Commands. 23.37.4 Commands. 23.37.4 Commands. 23.37.4 Commands. 23.37.4 Set tare value. 23.37.4 Send the stable result in basic unit. 23.37.4 Send the stable result in basic unit. 23.37.4 Send the stable result in current unit. 23.37.4 Send the stable result in basic unit. 23.37.4 Send the stable result in current unit. 23.37.4 Send the stable result in current unit. 23.37.4 Send the stable result in mediately in current unit. 23.37.4 Send the stable result in mediately in current unit. 23.37.4 Send the stable result in mediately in current unit. 23.37.4 Send the stable result in current unit. 23.37.4 Send the stable result in current unit. 24.37.4 Set of the stable result in current unit. 25.37.4 Send the stable result in current unit. 26.37.4 Send the stable result in current unit. 27.4 Send the stable result in current unit. 28.37.4 Send the stable result in current unit. 29.37.4			
35.5. Reports preview 35.5.1. Weighments / Alibi 25.5.2. Reports from dosing. 35.5.2. Reports from recipes. 26.35.5.3. Reports from recipes. 27.35.5.4. Density reports. 28.35.5.5. Controls reports. 29.35.5.5. Controls reports. 20.35.5.6. A verage tare reports. 21.35.5.5. Differential weighments reports. 22.35.5. Differential weighments reports. 23.35.5. Differential weighments reports. 23.35. Differential weighments reports. 23.36. Identification process oreation. 23.1. Identification process oreation. 23.36. Identification process functions. 23.36. Identification process oreation. 23.36. Identification process functions. 23.36. Identification process functions. 23.36. Identification process functions. 23.36. Identification process functions. 23.37. Activation by operator logging. 23.38. Identification process forming and its realization. 23.37. Identification process forming and its realization. 23.37. Identification process forming and its realization. 23.37. Communication process forming and its realization. 23.37. Communication process format. 24.37. Identification process format. 25.37. Identification process format. 27. Command's description. 28. Identification process format. 29. Identification process format. 29. Identification process format. 20. Identification process format. 21. Identification process format. 22. Identification process format. 23. Identification process format. 24. Identification process format. 25. Identification process format. 26. Identification process format. 27. Identification process format. 28. Identification process format. 29. Identification process format. 29. Identification process format. 20.		35.4.4. Export a database to a file	202
35.5.1. Weighments / Alibi 35.5.2. Reponts from dosing			
35.5.2 Reports from recipes. 22 35.5.3 Reports from recipes. 26 35.5.5 Controls reports. 26 35.5.5 Controls reports. 27 35.5.7 Report from vehicle scale 21 35.5.7 Report from vehicle scale 21 35.5.D Infferential weighments reports 22 36. IDENTIFICATION PROCESSES 23 36.1 Lentification process - creation 21 36.2 List of identification process functions. 21 36.3 Lentification process functions. 22 36.3 Lentification process functions. 22 36.3 Lexivation by programmable button 22 36.3.2 Activation by programmable button 21 36.3.2 Activation by programmable button 21 36.3.2 Activation by product selection 21 36.3.4 Example of process forming and its realization 21 37. Communification 22 37.1 General information 22 37.2 List of R S commands 22 37.2 List of R S commands 22 37.2 List of R S commands 22 37.4 Long and a security a	35.5		
35.5.3. Reports from recipes 35.5.4. Density reports. 35.5.5. Controls reports. 35.5.6. Controls reports. 35.5.7. Report from vehicle scale. 35.5.7. Report from vehicle scale. 35.5.7. Report from vehicle scale. 36.1. Identification process – creation. 36.1. Identification process – creation. 36.2. List of identification process functions. 36.3. Identification process – creation. 36.3. Identification process – activation procedure. 36.3. Identification process – activation procedure. 36.3. Identification process – activation procedure. 36.3. Activation by programmable button. 37. COMMUNICATION PROTOCOL. 37. Communication. 37. Communication. 37. Communication. 37. Communication. 37. Activation by activation of process forming and its realization. 37. Sepsond message format. 37. Activation of process forming and its realization. 37. Activate of Recommands. 37. Activate of Re			
35.5.4. Density reports			
35.5.6. Controls reports. 35.5.6. Average tare reports. 35.5.7. Report from vehicle scale. 35.5.8. Differential weighments reports. 36.1 Identification process – creation. 36.1 Identification process – creation. 36.2. List of identification process functions. 21. 36.3.1 Activation by programmable button. 22. 36.3.1 Activation by programmable button. 23. 36.3.2. Activation by programmable button. 24. 36.3.4. Example of process forming and its realization. 25. 36.3.4. Example of process forming and its realization. 27. 36.3.4. Example of process forming and its realization. 27. 1. General information. 27. 27.1. General information. 27. 27.1. General information. 27. 27.3. Respond message format. 27.3. Respond message format. 27.3. Respond message format. 27. 37.4. 2 Forming. 27. 37.4. 2 Forming. 27. 37.4. 2 Forming. 27. 37.4. Set tare value. 27. 37.4. Set tare value. 27. 37.4. Set tare value. 27. 37.4. Set bethe esult in basic unit. 27. 37. 4. Send the estable result in basic unit. 27. 37. 4. Send immediate results from all platforms in basic units. 27. 37. 4. Send immediate results from all platforms in basic unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send the stable result in current unit. 27. 37. 4. Send the result immediately in current unit. 27. 37. 4. Send the result immediately in current unit. 28. 37. 4. Send the result immediately in current unit. 29. 37. 4. Send the result immediately in current unit. 20. 37. 4. Send the result immediately in current unit. 21. 37. 4. Send the result immediately in current unit. 22. 37. 4. Send the result immediately in current unit. 23. 37. 4. Send the result immediately in current unit. 24. 37. 4. Send the result immediately in current unit. 25. 37. 4. Send the result immediately in current unit. 26. 37. 4. Send the result immediately in current unit. 27. 4. Send the result immediately in current unit		35.5.3. Reports from recipes	207
35.5.6. Controls reports. 35.5.6. Average tare reports. 35.5.7. Report from vehicle scale. 35.5.8. Differential weighments reports. 36.1 Identification process – creation. 36.1 Identification process – creation. 36.2. List of identification process functions. 21. 36.3.1 Activation by programmable button. 22. 36.3.1 Activation by programmable button. 23. 36.3.2. Activation by programmable button. 24. 36.3.4. Example of process forming and its realization. 25. 36.3.4. Example of process forming and its realization. 27. 36.3.4. Example of process forming and its realization. 27. 1. General information. 27. 27.1. General information. 27. 27.1. General information. 27. 27.3. Respond message format. 27.3. Respond message format. 27.3. Respond message format. 27. 37.4. 2 Forming. 27. 37.4. 2 Forming. 27. 37.4. 2 Forming. 27. 37.4. Set tare value. 27. 37.4. Set tare value. 27. 37.4. Set tare value. 27. 37.4. Set bethe esult in basic unit. 27. 37. 4. Send the estable result in basic unit. 27. 37. 4. Send immediate results from all platforms in basic units. 27. 37. 4. Send immediate results from all platforms in basic unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send immediate results in current unit. 27. 37. 4. Send the stable result in current unit. 27. 37. 4. Send the result immediately in current unit. 27. 37. 4. Send the result immediately in current unit. 28. 37. 4. Send the result immediately in current unit. 29. 37. 4. Send the result immediately in current unit. 20. 37. 4. Send the result immediately in current unit. 21. 37. 4. Send the result immediately in current unit. 22. 37. 4. Send the result immediately in current unit. 23. 37. 4. Send the result immediately in current unit. 24. 37. 4. Send the result immediately in current unit. 25. 37. 4. Send the result immediately in current unit. 26. 37. 4. Send the result immediately in current unit. 27. 4. Send the result immediately in current unit		35.5.4. Density reports	208
35.5.6. Average taire reports 35.5.7. Report from vehicle scale 35.5.7. Report from vehicle scale 35.5.7. Report from vehicle scale 36. IDENTIFICATION PROCESSES 36. IDENTIFICATION PROCESSES 36. Identification process function 36.2. List of identification process function 36.3. Identification process – activation procedure 21. 36.3. Identification by programmable button 22. 36.3. Activation by programmable button 23. 36.3. Activation by product selection 24. 36.3.3. Activation by product selection 25. 36.3.4. Example of process forming and its realization 27. COMMUNICATION PROTOCOL 27. List of RS commands 27. 2. List of RS commands 27. 37. 4. Command's description 27. 37. 4. 1. Zeroing 28. 37. 4. Seription 29. 37. 4. Seription 20. 37. 4. Seription 20. 37. 4. Seription 20. 37. 4. Seription 21. 37. 4. Seription 22. 37. 4. Send the stable result in basic unit 23. 37. 4. Send the result immediately in basic unit 27. 37. 4. Send the result immediately in basic unit 28. 37. 4. Send the result immediately in basic unit 29. 37. 4. Send the result immediately in current unit 20. 37. 4. Send the result immediately in current unit 20. 37. 4. Send the result immediately in current unit 21. 37. 4. Send the result immediately in current unit 22. 37. 4. Send the result immediately in current unit 23. 37. 4. Send the result immediately in current unit 24. 37. 4. Send the result immediately in current unit 25. 37. 4. Send the result immediately in current unit 26. 37. 4. Send the result immediately in current unit 27. 37. 4. Send the result immediately in current unit 28. 37. 4. Send the result immediately in current unit 29. 37. 4. Send the result immediately in current unit 20. 37. 4. Send the result immediately in current unit 21. 37. 4. Send the result immediately in current unit 22. 37. 4. Send the result immediately in current unit 23. 37. 4. Send the result immediately in current unit 24.			
35.5.7. Report from vehicle scale 35.5.8. Differential weighments reports 21. 36.1 Identification process — creation 36.1. Identification process — creation 36.2. List of identification process functions 36.2. List of identification process functions 36.3.1. Activation process — activation procedure 21. 36.3.1. Activation by programmable button 22. 36.3.1. Activation by programmable button 23. 36.3.2. Activation by programmable button 23. 36.3.2. Activation by programmable button 23. 36.3.3. Activation by prodruct selection 23. 36.3.4. Example of process forming and its realization 23. COMMUNICATION PROTOCOL 23. 37.1. General information 23. 37.1. General information 23. 37.3. Respond message format 23. 37.3. Respond message format 23. 37.4. Command's description 23. 37.4.1. Zeroing 23. 37.4.2. Tarring 23. 37.4.2. Tarring 23. 37.4.3. Set tare value 23. 37.4.4. Set tare value 23. 37.4.5. Send the stable result in basic unit 22. 37.4.5. Send the stable result in current unit 23. 37.4.9. Send immediate results from all platforms in basic unit 23. 37.4.9. Send immediate results from all platforms in basic unit 23. 37.4.1. Switch off continuous transmission in basic unit 23. 37.4.1. Switch off continuous transmission in basic unit 23. 37.4.1. Switch off continuous transmission in basic unit 23. 37.4.1. Switch off continuous transmission in ourrent unit 23. 37.4.1. Switch off continuous transmission in ourrent unit 23. 37.4.1. Switch off continuous transmission in ourrent unit 23. 37.4.1. Switch off continuous transmission in ourrent unit 24. 37.4.1. Switch off continuous transmission in ourrent unit 25. 37.4.1. Switch off continuous transmission in ourrent unit 26. 37.4.1. Switch off continuous transmission in ourrent unit 27. 37.4.1. Switch off continuous transmission in ourrent unit 28. 37.4.1. Switch off continuous transmission in ourrent unit 29. 37.4.1. Switch on continuous transmission in ourrent unit 29. 37.4.1. Switch on continuous transmission in ourrent unit 29. 37.4.2. Switch on continuous transmission in			
35.5.8. Differential weighments reports 21 36. IDENTIFICATION PROCESSES 22 36.1. Identification process - creation 21 36.2. List of identification process - unctions 21 36.3. Identification process - activation procedure 22 36.3.1. Activation by programmable button 21 36.3.2. Activation by product selection 21 36.3.3. Activation by product selection 22 36.3.4. Example of process forming and its realization 22 37. Logeneral information 22 37.1. General information 22 37.2. List of RS commands 22 37.4. Zeroing 22 37.4. I. Zeroing 22 37.4. Zeroing 22 37.4. Zeroing 22 37.4. Send the stable result in basic unit 22 37.4. Send the result immediately in basic unit. 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 <td></td> <td></td> <td></td>			
36. IDENTIFICATION PROCESSES 21 36.1. Identification process – creation. 21 36.2. List of identification process sunctions. 21 36.3. Identification process – activation procedure. 21 36.3.1. Activation by programable button. 21 36.3.2. Activation by product selection. 21 36.3.3. Example of process forming and its realization. 21 37. COMMUNICATION PROTOCOL. 22 37.1. General information. 22 37.2. List of RS commands. 22 37.3. Respond message format. 22 37.4. Command's description. 22 37.4. Zeroing. 22 37.4.1. Zeroing. 22 37.4.2. Tarring. 22 37.4.3. Get tare value. 22 37.4.5. Send the stable result in basic unit. 22 37.4.5. Send the result immediately in basic unit. 22 37.4.9. Send the result immediately in current unit. 22 37.4.9. Send the result immediately in current unit. 22 37.4.1. Switch on continuous transmission in basic unit. 22 37.4.1. Switch on continuous transmission in basic unit. 22 37.4.11. Switch on continuous			
36.1. Identification process – creation 21 36.2. List of identification process functions 21 36.3. Identification process – activation procedure 21 36.3.1. Activation by operator logging 21 36.3.2. Activation by poretor logging 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 21 37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Zormand's description 22 37.4. Zormand's description 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.9. Send the result immediately in current unit 22 37.4.1. Switch on continuous transmission in basic unit 22 37.4.1. Switch on continuous transmission in basic unit 22 37.4.1. Switch on continuous transmission in current uni			
36.2. List of identification process functions 21 36.3. I Identification process – activation procedure 21 36.3.2. Activation by programmable button 21 36.3.3. Activation by product selection 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 21 37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4. T Zeroing 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.9. Send the result immediately in uncert unit 22 37.4.10. Switch of continuous transmission in basic unit 22 37.4.1. Switch of continuous transmission in basic unit 22 37.4.1. Switch of continuous transmission in current unit 22 37.4.1. Switch of continuous transmission in current unit <td< td=""><td></td><td></td><td></td></td<>			
36.3. Identification process – activation procedure 21 36.3.1. Activation by programmable button 21 36.3.2. Activation by operator logging 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 21 37. CoMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4.1. Zeroing 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.4. Set tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.5. Send immediate results from all platforms in basic units 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.1. Switch on continuous transmission in basic unit 22 37.4.1. Switch of foortinuous transmission in basic unit 22 37.4.1. Switch of foortinuous transmission in ourrent unit 22 37.4.1. Switch of foortinuous transmission in ourrent unit 22			
36.3.1. Activation by programmable button 21 36.3.2. Activation by operator logging 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 22 37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4. 2. Tarring 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 23 37.4.13. Switch off continuous transmission in current unit 22 37.4.15. Set upper threshold 23			
36.3.2. Activation by operator logging 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 27 37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4. Tarring 22 37.4.1. Zeroing 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.8. Send the result immediately in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in current unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.15. Set upper threshold 23 37.4.16. Read low	36.3	3. Identification process – activation procedure	217
36.3.2. Activation by operator logging 21 36.3.3. Activation by product selection 21 36.3.4. Example of process forming and its realization 27 37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4. Tarring 22 37.4.1. Zeroing 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.8. Send the result immediately in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in current unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.15. Set upper threshold 23 37.4.16. Read low		36.3.1. Activation by programmable button	217
36.3.3 Activation by product selection			
36.3.4 Example of process forming and its realization. 27. COMMUNICATION PROTOCOL. 27. General information. 27. List of RS commands. 28. 37.3. Respond message format. 37.4. Command's description. 29. 37.4.1. Zeroing. 20. 37.4.2. Tarring. 21. 37.4.3. Get tare value. 21. 37.4.5. Send the stable result in basic unit. 22. 37.4.5. Send the result immediately in basic unit. 23. 37.4.6. Send the result immediately in basic unit. 23. 37.4.9. Send immediate results from all platforms in basic units. 23. 37.4.9. Send the result immediately in current unit. 23. 37.4.9. Send the result immediately in current unit. 23. 37.4.10. Switch on continuous transmission in basic unit. 23. 37. 4.11. Switch of continuous transmission in basic unit. 23. 37. 4.12. Switch on continuous transmission in current unit. 23. 37. 4.13. Switch of continuous transmission in current unit. 23. 37. 4.14. Set lower threshold. 23. 37. 4.15. Set upper threshold. 23. 37. 4.16. Read lower threshold. 23. 37. 4.18. Simulation of pressing ENTER/PRINT key. 23. 37. 4.18. Simulation of pressing ENTER/PRINT key. 23. 37. 4.20. Give balance serial number. 23. 37. 4.21. Set mass value of a single item. 23. 37. 4.22. Set reference mass value. 23. 37. 4.25. Set working mode. 23. 37. 4.26. Give current working modes. 23. 37. 4.26. Give current working mode. 23. 37. 4.27. Send all implemented commands. 23. 37. 4.26. Give current working mode. 23. 37. 4.27. Send all implemented commands. 23. 38. 1. Memory map. 23. 38. 1. Noutyut address. 23. 38. 1. Doutyut address. 23. 38. 2. Description of variables.			
37. COMMUNICATION PROTOCOL 22 37.1. General information 22 37.2. List of RS commands 22 37.3. Respond message format 22 37.4. Command's description 22 37.4.1. Zeroing 22 37.4.2. Tarring 22 37.4.5. Send the stable result in Command 22 37.4.5. Send the stable result in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.9. Send the stable result in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch of continuous transmission in basic unit 22 37.4.12. Switch of continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.20. Give balance serial number 25 37.4.21. Set			
37.1. General information. 22 37.2. List of RS commands. 22 37.3. Respond message format. 22 37.4. Command's description. 22 37.4.2. Tarring. 22 37.4.3. Get tare value. 22 37.4.5. Send the stable result in basic unit. 22 37.4.6. Send the stable result is mediately in basic unit. 22 37.4.7. Send immediate results from all platforms in basic units. 22 37.4.9. Send the stable result in current unit. 22 37.4.10. Switch on continuous transmission in basic unit. 22 37.4.11. Switch off continuous transmission in basic unit. 22 37.4.12. Switch on continuous transmission in current unit. 22 37.4.13. Switch off continuous transmission in current unit. 22 37.4.14. Set lower threshold. 23 37.4.15. Set upper threshold. 23 37.4.16. Read lower threshold. 23 37.4.17. Read upper threshold. 23 37.4.18. Simulation of pressing ENTER/PRINT key. 22 37.4.20. Give balance serial number. 23 37.4.21. Set mass value of a single item. 23 37.4.22. Set reference mass value. 23	27 00		
37.2. List of RS commands 22 37.3. Respond message format. 22 37.4. Command's description 22 37.4.1. Zeroing 22 37.4.2. Tarring. 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit. 22 37.4.6. Send the result immediately in basic unit. 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.9. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.1. Send immediately in current unit 22 37.4.1. Switch on continuous transmission in basic unit 22 37.4.1. Switch off continuous transmission in basic unit 22 37.4.1. Switch off continuous transmission in current unit 22 37.4.1. Switch off continuous transmission in current unit 23 37.4.1. Set lower threshold 22 37.4.1. Set upper threshold 23 37.4.1. Read lower threshold 23 37.4.1. Set mass value of a single item 23 37.4.2. Set mass value of a single item 23 37.4.2. Set mass value of a single item 23			
37.3. Respond message format 22 37.4. Command's description 22 37.4.1. Zeroing 22 37.4.3. Get tare value 22 37.4.4. Set tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Switch or continuous transmission in basic unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 22			
37.4. Command's description 22 37.4. Zeroing 22 37.4. Set tare value 22 37.4. Set tare value 22 37.4. Send the stable result in basic unit 22 37.4. Send the stable result in basic unit 22 37.4. Send immediate results from all platforms in basic units 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the result immediately in current unit 22 37.4. Send the result immediately in current unit 22 37.4. Send the result immediately in current unit 22 37.4. Send the result immediately in current unit 22 37.4. Send the result immediately in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 22 37.4. Send the stable result in current unit 23 37.4. Set lower threshold 23 37.4. Set lower threshold 23 37.4. Set upper threshold 23 37.4. Set upper threshold 23 37.4. Set uppe			
37.4.1. Zeroing 22 37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.4. Set tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.6. Send the stable results from all platforms in basic units 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.9. Send the stable result in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.15. Switch off continuous transmission in current unit 22 37.4.16. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 22 37.4.25. Set working mode 23 37.4.26. Give current working mode 23	37.3	3. Respond message format	224
37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.15. Set lower threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.25. Set working mode 22 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23	37.4	Command's description	224
37.4.2. Tarring 22 37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.15. Set lower threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.25. Set working mode 22 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23		37.4.1. Zeroing	224
37.4.3. Get tare value 22 37.4.5. Send the stable result in basic unit 22 37.4.5. Send the result immediately in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.8. Send immediate results from all platforms in basic units 22 37.4.9. Send the result in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 22 37.4.19. Change platform 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.25. Set working mode 22 37.4.26. Give available working mode 22 37.4.27. Send all implemented commands 23			
37.4.5 Send the stable result in basic unit 22 37.4.5 Send the stable result immediately in basic unit 22 37.4.7 Send immediate results from all platforms in basic units 22 37.4.8 Send the stable result in current unit 22 37.4.9 Send the result immediately in current unit 22 37.4.10 Switch on continuous transmission in basic unit 22 37.4.11 Switch off continuous transmission in basic unit 22 37.4.12 Switch of continuous transmission in current unit 23 37.4.13 Switch off continuous transmission in current unit 23 37.4.14 Set lower threshold 23 37.4.15 Set upper threshold 23 37.4.16 Read lower threshold 23 37.4.17 Read upper threshold 23 37.4.18 Simulation of pressing ENTER/PRINT key 23 37.4.20 Give balance serial number 23 37.4.21 Set mass value of a single item 23 37.4.22 Set reference mass value 23 37.4.25 Set working mode 23 37.4.26 Give available working modes 23 37.4.27 Send all implemented commands 23 37.5 Manual printouts / automatic printouts 23 38. MODBUS RTU COMM		37.4.3 Get tare value	225
37.4.5. Send the stable result immediately in basic unit 22 37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in basic unit 22 37.4.13. Switch off continuous transmission in current unit 22 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.26. Give available working mode 23 37.5. Manual printouts / automatic printouts 23 38. M			
37.4.6. Send the result immediately in basic unit 22 37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Dutput address 23 <td></td> <td></td> <td></td>			
37.4.7. Send immediate results from all platforms in basic units 22 37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.15. Set lower threshold 25 37.4.16. Read lower threshold 25 37.4.17. Read upper threshold 25 37.4.18. Simulation of pressing ENTER/PRINT key 25 37.4.19. Change platform 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.25. Set working mode 25 37.4.26. Give available working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. I. Output address 25 38.2.1. Output dadress 25			
37.4.8. Send the stable result in current unit 22 37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.26. Give available working modes 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38.1. Noutput address 23 38.1. I. Output address 23 38.1. I. Output address 23 38.2. Description of variables 23 38.2.1. Out			
37.4.9. Send the result immediately in current unit 22 37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch off continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.15. Set lower threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Loutput address 23 38.2. I poput variables 23 38.2. 1. Output variables 23			
37.4.10. Switch on continuous transmission in basic unit 22 37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 37.4.28. Give current working mode 23 37.4.29. Send all implemented commands 23 37.4.29. Input address 23 38.1. Nemory map 23 38.1. Input address 23 38.1. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23		37.4.8. Send the stable result in current unit	227
37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 25 37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 25 37.4.15. Set upper threshold 25 37.4.16. Read lower threshold 25 37.4.17. Read upper threshold 25 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38.1. Modbus RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.2. I plout put drieses 23 38.2. 1. Output variables 23		37.4.9. Send the result immediately in current unit	228
37.4.11. Switch off continuous transmission in basic unit 22 37.4.12. Switch on continuous transmission in current unit 25 37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 25 37.4.15. Set upper threshold 25 37.4.16. Read lower threshold 25 37.4.17. Read upper threshold 25 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38.1. Modbus RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.2. I plout put drieses 23 38.2. 1. Output variables 23		37.4.10. Switch on continuous transmission in basic unit	229
37.4.12. Switch on continuous transmission in current unit 22 37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.19. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 25 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Nemory map 23 38.1. Input address 23 38.2. I proti prior of variables 23 38.2. 1. Output variables 23			
37.4.13. Switch off continuous transmission in current unit 23 37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 25 37.4.25. Set working mode 25 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.2. I pot taddress 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.14. Set lower threshold 23 37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 25 37.4.18. Simulation of pressing ENTER/PRINT key 25 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 23 37.4.28. Modulal printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.2. I. piut address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.15. Set upper threshold 23 37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 23 37.4.21. Set mass value of a single item 23 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 23 37.4.25. Set working mode 25 37.4.27. Send all implemented commands 23 37.4.28. Monual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Nemory map 25 38.1. I put address 23 38.1. I prut address 23 38. Description of variables 23 38.2. 1. Output variables 23			
37.4.16. Read lower threshold 23 37.4.17. Read upper threshold 23 37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 25 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.17. Read upper threshold 25 37.4.18. Simulation of pressing ENTER/PRINT key 25 37.4.19. Change platform 25 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 25 37.4.25. Set working mode 25 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Nemory map 25 38.1.1. Output address 23 38.2. I pout address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 25 37.4.25. Set working mode 25 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Nemory map 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23 38.2.1. Output variables 23		37.4.16. Read lower threshold	230
37.4.18. Simulation of pressing ENTER/PRINT key 23 37.4.19. Change platform 23 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 25 37.4.25. Set working mode 25 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Nemory map 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23 38.2.1. Output variables 23		37.4.17. Read upper threshold	231
37.4.19. Change platform 23 37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 25 37.4.25. Set working mode 23 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 25 38.1.2. Input address 25 38.2. Description of variables 25 38.2.1. Output variables 23		37.4.18. Simulation of pressing ENTER/PRINT key	231
37.4.20. Give balance serial number 25 37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 25 37.4.25. Set working mode 25 37.4.27. Send all implemented commands 25 37.4.27. Send all implemented commands 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 25 38.1.1. Output address 25 38.1.2. Input address 25 38.2. Description of variables 23 38.2.1. Output variables 23		37.4.19. Change platform	231
37.4.21. Set mass value of a single item 25 37.4.22. Set reference mass value 25 37.4.23. Activate sound signal 25 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 25 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Doutput address 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.22. Set reference mass value 23 37.4.23. Activate sound signal 23 37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.23. Activate sound signal 23 37.4.24. Give available working modes 23 37.4.25. Set working mode 25 37.4.26. Give current working mode 25 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.24. Give available working modes 23 37.4.25. Set working mode 23 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Description of variables 25 38.1.2. Input address 25 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.25. Set working mode 23 37.4.26. Give current working mode 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 25 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 25 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.26. Give current working mode. 23 37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts. 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 23 38.1.1. Output address. 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23			
37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 25 38.1.1. Output address 25 38.1.2. Input address 25 38.2. Description of variables 25 38.2.1. Output variables 25			
37.4.27. Send all implemented commands 23 37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 25 38.1.1. Output address 25 38.1.2. Input address 25 38.2. Description of variables 25 38.2.1. Output variables 25			
37.5. Manual printouts / automatic printouts 23 38. MODBUS RTU COMMUNICATION PROTOCOL 23 38.1. Memory map 25 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23		37.4.27. Send all implemented commands	235
38.1. Memory map 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23	37 5	Manual printouts / automatic printouts	236
38.1. Memory map 23 38.1.1. Output address 23 38.1.2. Input address 23 38.2. Description of variables 23 38.2.1. Output variables 23	38 M	DOBLIS RTIJ COMMUNICATION PROTOCOJ	236
38.1.1. Output address	20. 1410	Mamory man	220
38.1.2. Input address	30.	29.1.1 Output address	200
38.2. Description of variables 23 38.2.1. Output variables 23			
38.2.1. Output variables			
	38.2		
38.2.2. Input variables			
		38.2.2 Input variables	243

39. COOPERATION WITH PERIPHERAL DEVICES	
40. OPTIONAL EXTENSIONS MODULES	247
40.1. Additional I/O module	
40.1.1. 12IN/12OUT module: technical specifications	247
40.1.2. 12IN/OUT schematic diagrams	248
40.1.3. Inputs/Outputs signals overview	249
40.2. 4IN/4OUT – 4IN	
40.2.1. 4IN/4OUT module: technical specifications	
40.2.2. 4IN/4OUT schematic diagram	250
40.2.3. Inputs/Outputs signals overview	250
40.3. Analog outputs module	
40.3.1. AN module setup	
40.3.2. AN module: technical specifications	252
40.3.3. Wiring diagrams for the AN module	
40.4. Module for an additional platform – DP4	
40.4.1. DP4 module: technical specifications	253
40.4.2. Colours of weighing platform signal wires	253
40.5. RS485 module (309Rxxxx)	
40.6. PROFIBUS board	
40.7. Additional modules positioning	256
40.7.1. Exclusions for additional modules installation	256
41. PROFIBUS COMMUNICATION MODULE	257
41.1. Socket topology	
41.2. Memory map	
41.2.1. Output address	
41.2.2. Input address	
41.3. Description of variables.	
41.3.1. Output variables	
41.4. Input variables	
42. DIAGRAMS OF CONNECTION CABLES	
43. ADDITIONAL EQUIPMENT	
44. TECHNICAL PARAMETERS	
45. ERROR MESSAGES	
46. APPENDIX 01 – Variables for printouts	
46.1. Inventory of variables	
46.2. Formatting variables	
46.3. Mathematical function	
47. APPENDIX 02 – Functions of programmable buttons	
48. APPENDIX 03 – Label template	
48.1. Designing a label from the indicator level	
48.2. Designing a label on a computer	
48.3. Saving label templates in the scale	
48.4. Attributing a label to a product	
48.5. Attributing a label to a product	
48.6. Printing labels	
49. APPENDIX 04 - CITIZEN printer setting	290
50. APPENDIX 05 - ZEBRA printer setting	290
51. APPENDIX 05 - ZEBRA printer setting	297
51. APPENDIX 06 - Communication with parcode scanners	297
52. APPENDIX 07 – Computer Program "ViewerKTP"	298
53. APPENDIX 08 – Cooperation with HRP Weighing Platform	300
53.1. External ambient conditions	
53.2. LO Threshold for automatic functions	
53.3. Automatic adjustment	
53.4. Internal adjustment	
53.5. Automatic adjustment time-triggered	304

1. INTENDED USE

PUE HY10 weighing indicator is designed to be a component of industrial scales operation of which is based on load cells. It features stainless steel housing with IP 68/69, with thus high IP rate it can be operated within wide temperature range: $-10^{\circ}\text{C} - 40^{\circ}\text{C}$ and wherever high humidity prevails. Colour capacitive 10,1" display with touchscreen allows intuitive operation, no keyboard is needed.

Weighing indicator of standard line is equipped with 2 x USB, 1 x RS232, 1 x Ethernet and 1 x 4IN/4OUT connectors. The device allows three additional weighing modules coupling. It can cooperate with barcode scanners, receipt printers, labellers, RFID readers and PC equipment (mouse, keyboard USB flash memory).

2. PRECAUTIONARY MEASURES

2.1. Precautions

- A. Please, read carefully this user manual before and use the device according to its intended use;
- B. Weighed loads should be placed in possibly central part of scale pan;
- C. Do not clean the device with agents causing corrosion;
- D. Weighing pan should be loaded with goods having gross mass lower than maximal capacity of the scale;
- E. Do not leave loads on the pan for longer period of time;
- F. In case of failure, immediately disconnect scale power supply;
- G. Devices that are to be withdrawn from usage should be utilized according to the law.

2.2. Operation in a strong electrostatic field

If the device is about to operate in a strong electrostatic field (e.g. printing houses etc.) it should be connected to the earthing. Connect it to the clamp terminal signed $\frac{1}{2}$.

2.3. Scale washing

Weighing platforms are made of stainless steel (according to standards PN–0H18N9, EN-1.4301, AISI–304) and silicon elements.

There is an exception, zinc coated overhead scales and painted livestock scales made of mild constructional steel with aluminium cover plate on the platform, polyester overlays and stainless steel or polyamide glands.


Caution:

Washing and disinfection agents should be matched to the scale.


Platforms of ramp and livestock scales as well as load-bearing structures and weighing tracks of overhead scales can be washed with jet of water (temp. up to +80°C) with an appropriate washing agent. Washing measuring indicators / weighing indicators with the jet of hot water is not allowed.

Caution:

It is advisable to cover measuring indicators/weighing indicators while washing their surrounding with the jet of water.

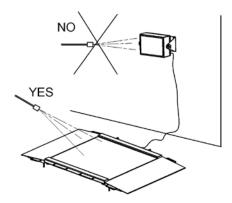

To wash waterproof platform scales and indicators neither jet of water nor hot water shall be used, in order not to damage the silicon gaiter that covers the load cell inside the platform and the overlay or glands in the indicator. To wash pans of platform scales they should be taken off first. Then they can be washed ether with the jet of water or by immersion.

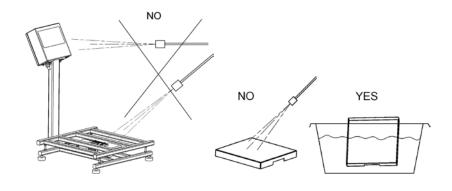

Туре:		Water with detergent	Jet of water	Hot water -max 80°C
Pomp cooles	Platforms with tracks	yes	yes	yes
Ramp scales	Indicator	yes	no	no
Livestock	Platform with railing	yes	yes	yes
scales	Indicator	yes	no	no
Overhead	Load bearing structure with the load cell	yes	yes	yes
scales	Indicator	yes	no	no
Platform	Platform	yes	no	no
waterproof scales	Indicator	yes	no	no
Scales	Taken off pan	yes	yes	yes

3. WARRANTY CONDITIONS

- A. RADWAG is obliged to repair or change those elements that appears to be faulty because of production and construction reason,
- B. Defining defects of unclear origin and outlining methods of elimination can be settled only in participation of a user and the manufacturer representatives,

- C. RADWAG does not take any responsibility connected with destructions or losses derives from non-authorized or inappropriate (not adequate to manuals) production or service procedures,
- D. Warranty does not cover:
 - Mechanical failures caused by inappropriate maintenance of the device or failures of thermal or chemical origin or caused by atmospheric discharge, overvoltage in mains or other random event,
 - Inappropriate cleaning.
- E. Forfeiture of warranty appears after:
 - Access by an unauthorized service,
 - Intrusion into mechanical or electronic construction of unauthorized people,
 - Installing another operating system,
 - Removing or destroying protection stickers.
- F. The detailed warranty conditions one can find in warranty certificate.
- G. Contact with the central authorized service: +48 48 384 88 00 ext. 106 or 107.

4. UNPACKING AND MOUNTING

- A. Take out the device from the original package,
- B. After a weighing platform has been connected the device should be placed on the operation stand on an even and stable ground far away from heat sources.
- C. Scale should be levelled by turning regulation feet. Levelling is correct if air bubble is in central position:






12

5. WEIGHING INDICATOR STRUCTURE

5.1. External view




5.2. Main dimensions

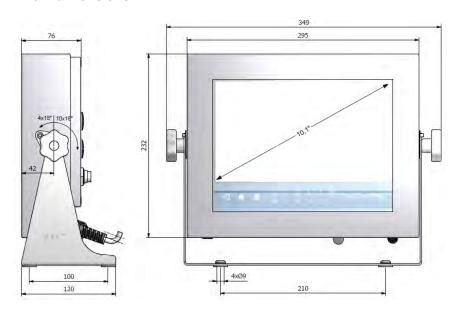

PUE HY 10 indicator dimensions

5.3. Description of connectors

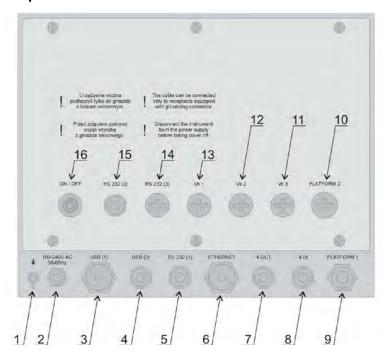

Sockets in PUE HY10

- 1. Ground connector.
- 2. Power cord gland.
- 3. USB A connector.
- 4. USB M12 4P connector.
- RS232(1) M12 8P connector.
- 6. Ethernet RJ45 connector.
- 7. 4WY M12 8P connector.
- 8. 4WE M12 8P connector.
- 9. Gland for platform 1.
- 10. Gland for platform 2.
- Socket for optional cable gland/additional equipment connector (Vk3, 12IN, PROFIBUS IN) – indicator type dependent mounting, plugged by default.
- Socket for optional cable gland/additional equipment connector (Vk2, 12OUT, PROFIBUS OUT) – indicator type dependent mounting, plugged by default.
- 13. Socket for optional cable gland/additional equipment connector (Vk1, RS485, Analog OUT) indicator type dependent mounting, plugged by default.
- 14. RS232(3) M12 8P optional connector.
- 15. RS232 (2) connector.
- 16. ON/OFF switch.

5.4. Connectors' pins layout

RS232	40 0 6 30 0 0 7 20 0 1	Pin1 – NC Pin2 – RxD Pin3 – TxD Pin4 – NC Pin5 – GND Pin6 - +5VDC Pin7 – GNDZ Pin8 – 24VDC
PROFIBUS IN (male)	3. 1. 2.	Pin1 – NC Pin2 – A Pin3 – NC Pin4 – B Pin5 – NC
PROFIBUS OUT (female)	3 4 0 2 0 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Pin1 - +5V Pin2 – A Pin3 – GND Pin4 – B Pin5 – NC
4OUTPUTS	40 0 6 6 9 7 20 0 1	Pin1 – OUT1 Pin2 – OUT2 Pin3 – OUT3 Pin4 – OUT4 Pin5 – COMM Pin6 – 24VDC Pin7 – GND Pin8 – NC
4INPUTS	40 ⁵ 0 06 30 08 07 20 01	Pin1 – IN1 Pin2 – IN2 Pin3 – IN3 Pin4 – IN4 Pin5 – COMM Pin6 – 24VDC Pin7 – GND Pin8 – NC
USB	3 4 2 1	Pin1 – Vcc Pin2 – D- Pin3 – D+ Pin4 – GND

5.5. Inputs/Outputs

Standard version of the indicator features 4 optoisolated inputs and 4 solidstate relay outputs. Signals are fed through M12 8P connectors.


4OUTPUTS	40 0 6 0 7 20 0 1	Pin1 – OUT1 Pin2 – OUT2 Pin3 – OUT3 Pin4 – OUT4 Pin5 – COMM Pin6 – 24VDC Pin7 – GND Pin8 – NC
4OUTPUTS	40 0 6 0 7 20 0 1	Pin1 – IN1 Pin2 – IN2 Pin3 – IN3 Pin4 – IN4 Pin5 – COMM Pin6 – 24VDC Pin7 – GND Pin8 – NC

5.5.1. Inputs/Outputs: technical specifications

Output parameters	
Outputs number	4
Outputs type	Solid-state relay
Wire cross-section	0,14 - 0,5mm ²
Maximum switching current	0,5A DC
Maximum forward voltage	30VDC, AC

If the device is switched on in a factory setup mode all factory parameters can be changed	
Inputs number	4
Inputs type	Optoisolated
Wire cross-section	0,14 - 0,5mm ²
Control voltage	5 -24VDC


5.5.2. Inputs/Outputs schematic diagram

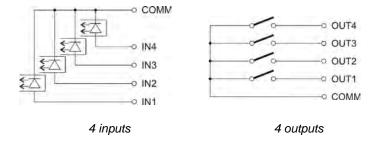

6. GETTING STARTED

- At the back of the indicator housing find an ON-OFF switch, press it, Windows system starts loading,
- When the loading procedure is completed the main software window appears.

7. KEYPAD OVERLAY

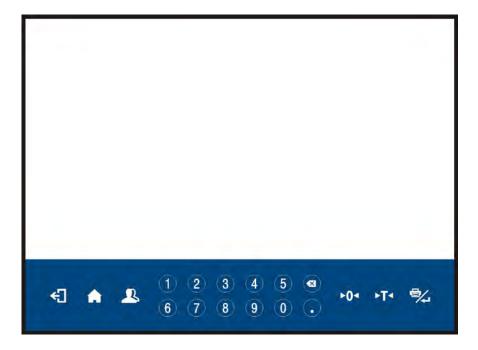

8. FUNCTIONS OF KEYS

Key **Description** Press to move one level up Press to enter balance menu or to get back to the home screen Press to log in Press to zero the balance Press to tare the balance Press to send the indication to a printer or to a computer 0 Numeric keys Press to delete the last sign Dot


9. PROGRAM STRUCTURE

The main menu has been divided into twelve functional groups. In every group there are parameters of similar use.

Pictogram	Description
3	Scale
	Databases
	Reports
	Working Modes
	Communication
S	Devices
	Display
99	Inputs / Outputs
	Authorization
© [ct] □ [lb] □ [g]	Units
R S S S	Other
	User Adjustment
(i)	Info
	Update
	Remote desktop

10. INDICATING WINDOW

Main view:

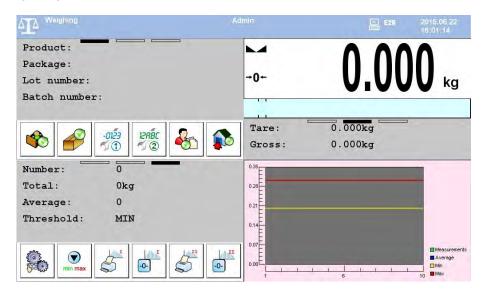

In the main application window one can see two separate parts:

- Top bar,
- Workspace.

10.1. Top bar



The top bar on the display contains the following data:

△T∆ Weighing	Pictogram and name of an active working mode	
Log In	Logged user	
PC	Pictogram of an active connection with a computer	
E2R	Symbol for active connection with E2R SYSTEM	

PUE HY 10	Device name	
2012,06.06 06:06:06	Date and time	

10.2. Workspace

Under the top bar, there is a workspace comprising four programmable screens for each working mode. For detailed information on screen components read section 17.1 of this user manual.

11. LOGGINGG IN

In order to get full access to users parameters and to be able to edit database the user must log as an **<Administrator>**.

Caution:


For each brand new scale there is a default < Admin> operator with <Administrator> authorization and no password. After the scales start the user automatically logs in as a default operator. If default operator data have been changed or if new operators have been added manual logging procedure is required.

11.1. Logging in - procedure

- Go to the main screen and press button, operators database window opens,
- Select a proper position and wait to see a screen keyboard with an edit field for an operator password,
- Enter the password and confirm it with _____ button,
- Program returns to the main window, the logged in operator name is displayed instead of <Log in> sign at the top bar of the main window.

11.2. Logging out procedure

- Go to the main screen and press button, operators database window opens,
- Press Logging out button situated in the top bar of the operators' database window:

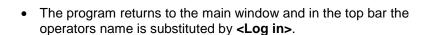

11.3. Authorization access levels

There are four levels of authorization: Administrator, Advanced Operator, Operator, None.

Access to user parameters, databases and working modes depending on the authorization access level attributed:

Operator type	Access level description
None	No access to user parameters. No weighing can be confirmed. Cannot start procedures: entering reference mass weight and determining reference mass quantity for "Parts Counting" mode, entering reference mass weight and determining reference mass for "Percent Weighing" mode, processes such as density determination, dosing, formulation, PGC control, SQC control, vehicle transaction.
Operator	Access to parameters in submenu: <weighing>, <display>¹⁾ (excluding the group <actions>), <others>¹⁾. Can start and perform all weighing procedures. Access to <export a="" database="" file="" the="" to="" weighing=""> in menu <reports>²⁾.</reports></export></others></actions></display></weighing>
Advanced Operator	Access to parameters in submenus: <weighing>, <working modes="">, <communication>, <devices>¹¹, <display>¹¹, <others>¹¹. Can start and perform all weighing procedures. Access to <export a="" database="" file="" the="" to="" weighing=""> in menu <reports>²¹.</reports></export></others></display></devices></communication></working></weighing>
Administrator	Access to all user parameters, functions and databases ²⁾ . Can start and perform all weighing procedures.

1. Authorization level for editing functions:

- Printouts> in submenu " Devices / Printer",
- < Sample> in submenu " Devices / Additional display",
- Displaying template> in submenu " Display /
 Text information".
- < Date and Time> in submenu Coc Others>,

The functions are declared in submenu < Authorizations>, which is accessible only for users with the < Administrator> authorization level (see ch. 19 of this manual).

2. A user logged in as <Administrator> in submenu


Authorizations> (see ch. 19 of this manual) can change authorization levels for accessing different databases and functions:


Delete older data>, < Weighing counter>. The exception are database < Weighings / Alibi>, that have the status "Read only".

12. NAVIGATING WITHIN THE MENU

Owing to the colour display with the touch panel navigating within the menu is simple and intuitive.

12.1. Keys

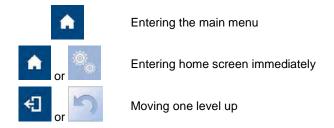

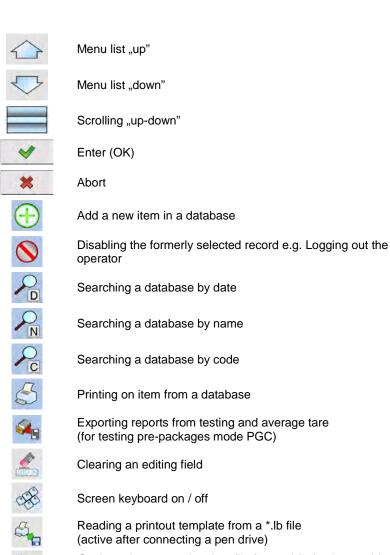

Saving printout template in a file format *.lb (option enabled on plugging a portable data storage device to scale port)

Variables for a printout template

One level up

Immediate exit to the main window

12.2. Return to weighing

Changes made to the scale's settings are automatically saved in the memory on returning to the main software window. The scale provides two ways of returning to the main window:

- By pressing key for a few times until returning to the main window,
- By pressing button or field located at the top bar.

13. WEIGHING

Put a load on the weight pan. When pictogram ▶ is displayed the indication is ready to read.


Caution:

A weighing can be saved after stabilising a measurement (pictogram).


13.1. Conditions of operational use

In order to assure a long term operating period with appropriate measurements following principles should be adhered to:


Avoid applying mechanical shocks to the weight pan:

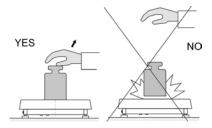


 Loads should be placed in the centre of the pan (eccentric errors are outlined in PN-EN 45501 chapter 3.5 and 3.6.2):

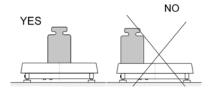

• Do not apply concentrated forces (all load in one point):

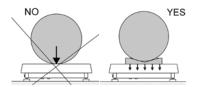

· Avoid side loads, particularly side strokes:

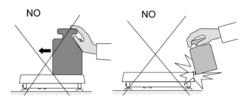

13.2. Zeroing

Zeroing is possible only when the indication is stable.

Caution:

Zeroing is possible only within ±2% of full range around zero. If zeroing value is not within ±2% of maximal capacity the following message will be displayed:



13.3. Tarring

In order to tare the scale choose a platform on the touch panel if necessary, put

After placing a load on the weight pan net mass will be shown. Tarring is possible within the whole range of the scale. After unloading the pan the display shows the tarred value with minus sign.

You can also enter tare values to the product database. Every product has a field "Tare". In that case tare is automatically set to this value after selecting the product.

Caution:

Tarring cannot be executed when a negative or zero value is being displayed. In such case the following message will be displayed:



13.4. Weighing for dual range scales

Switching between the **I range** and the **II range** happens automatically (exceeding Max of the **I range**).

Weighment in the second range is signalled by a pictogram in the top left corner of the display |2| . Then weighment is done with the accuracy of the **II range** to the moment of returning to zero (autozero range |-0|) where the scale switches back to the **I range**.



Switching between the **II range** and **I range** is automatic both in the switching point the autozero zone.

While in AUTOZERO – pictogram $^+0^-$ appears. Then pictogram $^+2$ is off and a scale returns to weighing in the **I range**.

13.5. Toggling between weighing units

Operators can change the weight unit in two ways:

- Pressing the unit symbol on the screen,
- Pressing formerly defined button < Ib Change unit>.

Possible selection:

- gram [g]
- kilogram [kg]
- carat [ct]
- pound [lb]
- ounce [oz] *
- Newton [N] *


Caution:

- 1. The user can also declare the start unit and determine two custom weighing units (user defined) see point 20 of this user manual:
- 2. The procedure of attributing functions to buttons is described in ch. 17.2 of this manual.

^{*) -} weighing unit inaccessible in a verified scale

14. SCALE PARAMETERS

Users can set the scale according to the ambient conditions (filtering level) or own needs (autozero) and set the LO threshold for minimum load that enables operation of some functions. This parameters are placed in

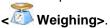

In order to enter submenu < Weighing>, press and then:



Caution:

Weighing parameters are directly related to a specific weighing platform, so at the beginning the weighing platform should be selected for which we want to set parameters.

Inventory of scale parameters:

Median Filter

Filter

◆ Autozero

LO Threshold

Last digit

14.1. Median filter

The median filter is intended for eliminating short-lasting mechanical shocks.

Procedure:

• Enter < Weighing> according to ch. 14 of the manual, select < Median Filter> and then set an appropriate value.

Accessible settings:

None - median filter is off 0.5, 1, 1.5, 2, 2.5 - filtering level to choose

14.2. Filter

This filter is intended to suppress continuous mechanical vibrations at the cost of stabilization time.

Procedure:

Enter < Weighing> according to ch. 14 of the manual, select Filter> and then set an appropriate value.

Accessible settings:

None, V.Fast, Fast, Average, Slow.

Caution:

The higher filtering level the longer stabilization time.

14.3. Autozero

The autozero function has been implemented in order to assure precise indications. This function controls and corrects "0" indication.

While the function is active it compares the results continuously with constant frequency. If two sequential results differ less than the declared value of autozero range, so the scale will be automatically zeroed and the pictograms and 0 will be displayed.

If AUTOZERO is disabled zero is not corrected automatically. However, in particular cases, this function can disrupt the measurement process e.g. slow pouring of liquid or powder on the weighing pan. In this case, it is advisable to disable the autozero function.

Procedure:

• Enter < Weighing> according to ch. 14 of the manual, select < Autozero> and then set an appropriate value.

Accessible settings:



- Autozero offAutozero on

14.4. Minimum weight for different functions (LO)

Parameter **<LO THRESHOLD>** is associated with automatic weighing. Next weighing will not be saved until the indication goes under the **THRESHOLD LO** (net).

Procedure:

- After entering < Threshold Lo> according to ch. 14 of this manual a keyboard is displayed,
- Enter LO and confirm by pressing

14.5. Last digit

The last digit option **Last digit>** is to switch off the last digit of measured mass indication – the measurement is carried out with decreased accuracy.

Procedure:

Enter group of parameters < Weighing> in accordance with ch.
 14 of this user manual, select parameter < Last digit> and set its desired value.

Accessible settings:

Always - Last digit always visible

Never - Last digit always switched off

When stable - Last digit visible only on stable indication of mass

15. COMMUNICATION

The scale can communicate with external devices via different ports:

- RS232 (1),
- RS232 (2),
- Ethernet,
- RTCP.
 - 👼 Wi-Fi *.
- *) Option

The communication can be configured in parameters' group Communication.

In order to enter **Communication**, press and then:

"O Communication".

15.1. RS 232 settings

Procedure:

Enter < Communication> according to ch.15 of the manual, select
 RS232 (1)> or < RS232 (1)>, and then set an appropriate value.

For RS 232 following parameters are accessible:

- Baud Rate 4800, 9600, 19200, 38400, 57600, 115200 bit/s
- Data bits
 Stop Bit
 5, 6, 7, 8
 No, 1, 1.5, 2
- Parity No Odd Even Mark Space

15.2. ETHERNET setting

Procedure:

Enter < Communication> according to ch.15 of the manual,
 select < Ethernet> and then set an appropriate value.

Following settings are accessible for Ethernet:

• DHCP - ✓ Yes - ✓ No

IP Address - 192.168.0.2
 Subnet Mask - 255.255.255.0
 Default gateway - 192.168.0.1
 DNS - 192.168.0.1

• MAC Address - ---

Caution:

- The above settings are presented for information purpose only.
 Transmission parameters have to be selected in accordance with client's local network settings.
- 2. Parameter <MAC Address> is automatically assigned to a device and it is has <Read only> Attribute.
- 3. In case of declaring the **<DHCP>** parameter to value and on device restart, the other transmission parameters have **<Read only>** attribute.
- After making changes press key, then a new message is displayed:
 <Restart to apply the changes>,
- Go back to weighing and restart the device.

15.3. TCP protocol setting

TCP (*Transmission Control Protocol*) is a protocol for communication between two computers. It operates in mode client-server. Server awaits on connection initiation on a specified port while client initiates connection to the server. Scale software allows setting the port for the "**Tcp**" protocol.

Procedure:

- Enter < Communication> parameter group as described in chapter 16 of the manual,
- Select: " Tcp / Port" then you will see window <Port> with the screen keyboard,
- Enter the required number and press

Caution:

The number of TCP port in RADWAG instruments is set to default value: 4001.

15.4. Wi-Fi

15.4.1. Wi-Fi network status

In order to view selected network parameters click **<Network Status>** field. Displayed window provides the following parameters:

Name	Value	Description
Network	-	Network name
Network status	Connected	Network status with values: connected, disconnected
RSSI	- dbm - %	Signal strength
Forget the network	-	Disconnection from a selected network

Selected network and parameters set for connection are stored within the scale program, each time the scale is turned on it connects to the selected network in accordance with pre-set parameters.

15.4.2. Available networks

The user can view < Available networks> detected by the scale.

Procedure:

- Enter < Communications> parameter group as described in chapter 15 of this manual,
- Go to < Wi-Fi / Available networks> submenu and select determined network out of the list.
- In order to search for available networks again, select < Refresh > option.

Caution:

Pictogram located next to the network name, informs whether the network requires password or not (pictogram with a padlock).

15.4.3. Transmission parameters

Procedure:

• Enter < Communications> parameter group as described in chapter 15 of this manual, select < Wi-Fi> and set particular values.

For **Wi-Fi** the scale software provides the following transmission parameters:

DHCP	❤Yes, ❤No
IP Address	192.168.0.2
Subnet mask	255.255.255.0
Default gateway	192.168.0.1
DNS	192.168.0.1
Mac address	

Caution:

- The above settings serve only for information purposes. Transmission parameters must be set in order to comply with customer's local network settings.
- 2. **<MAC address>** parameter is assigned to a particular device automatically and it is characterised with **<Read only>** attribute.

- 3. When setting **<DHCP>** parameter to **\vert value** and restarting the device, the remaining parameters are characterized with **<Read only>** attribute.
- With modifications carried out press button, the following message is displayed <Restart to apply the changes>,
- Enter weighing mode and restart the device.

16. DEVICES

16.1. Computer

The scale can cooperate with a computer. Active connection **scale-computer** is signalled by icon in the top bar of the main window. In submenu **Computer>** some settings needs to be configured for cooperation with computers.

Enter submenu < Computer>, press and then: " Devices / Computer".

16.1.1. Computer port

Procedure:

- Enter parameters' group < Devices> according to ch. 16 of this manual,
- Select " Computer / Port" and then set the appropriate option.

The scale can communicate with a computer via following ports:

- RS232 (1),
- RS232 (2),
- Tcp.

16.1.2. Computer address

Procedure:

- Enter < Devices> parameter group as described in chapter 16 of the manual.
- Choose " Computer / Address" then the window Address> with the screen keyboard appears,
- Enter the required address and confirm it by pressing

16.1.3. Continuous transmission

Users can enable continuous transmission from the scale to a computer.

Setting parameter < Continuous transmission> starts subsequent sending data from < Weighing Printout Template> set in submenu:

"Setup / ඁ Devices / 🖺 Computer / ┹ Weighing Printout Template".

Procedure:

- Enter parameters' group < Devices> according to ch. 16 of this manual,
- Choose " Computer / Continuous transmission" and then set an appropriate value.

Accessible settings:



- Continuous transmission off
- Continuous transmission on

16.1.4. Weighing printout template

Users in parameter **Weighing Printout Template>** can define variables included in the printout from the scale to a computer.

Procedure:

- Enter < Devices> parameter group as described in chapter 16 of the manual,
- Choose " Computer / Weighing Printout Template" then the editing field < Weighing Printout Template> with the screen keyboard appears,
- Modify the template if necessary and confirm the changes by pressing

Caution:

There are additional buttons in the bottom line of the screen keyboard. They can be used while modifying a printout template.:



Screen keyboard on/off



Reading a printout template from a *.lb file (button active while connecting a USB pen drive)



Saving printout template in a file format *.lb (option enabled on plugging a portable data storage device to scale port)



List of variables for printout templates (see the list in APPENDIX 01 of this manual)



Clear the editing field

16.1.5. Cooperation with "E2R System"

Scales can cooperate with computer software "E2R System" that is a modular system for complex production supervising by monitoring of weighings processes. In order to allow the cooperation with

"E2R System" enable parameter < E2R System>.

Caution:

The parameter **E2R System>** can be activated by an authorized service or the manufacturer.

Procedure:

- Enter < Devices> parameter group as described in chapter 16 of the manual.
- Choose " Computer / E2R System / System is active" and then set an appropriate value.

Accessible settings:



- System is not active
- System is active
- If during cooperation with < E2R System> product selection lock is required for operators, go to parameter < Lock selecting products> and set its value to .
- pictogram is displayed at the home screen top bar to inform you that System is active> parameter has been activated.

16.2. Printer

In < Printer> submenu users can:

- · Set communication with a printer,
- Set code page of a printer,
- Set templates of printouts,
- Activate/deactivate printout of demanded standards.

To enter < Printer>, press and then: " Printer".

16.2.1. Printer port

Procedure:

Enter < Devices> parameter group as described in chapter 16
 of the manual, choose " Printer / Port" and then select an
 appropriate option.

Printers can be attached to:

- RS232 (1),
- RS232 (2),
- USB,
- TCP.

16.2.2. Printer code page

Procedure:

- Enter parameters < Devices> as described in chapter 16 of the manual.
- Choose " Printer / Code Page" then the screen keyboard will be displayed,
- Write the required code page and confirm by pressing

Caution:

The default value is 1250 - code page for Middle-East Europe.

16.2.3. Templates for printouts

Enter < Printouts> to define printout templates.

Procedure:

- Enter parameter group < Devices> as described in chapter
 16 of the manual, then choose "Printer / Printouts",
- After editing a template a memo box with the default content and the screen keyboard,

 Modify the template according to your requirements and confirm it by pressing

Caution:

There are additional buttons in the bottom line of the screen keyboard. They can be used while modifying a printout template.:



Screen keyboard on/off



Reading a printout template from a *.lb file (button active while connecting a USB pendrive)



Saving printout template in a file format *.lb (option enabled on plugging a portable data storage device to scale port)



List of variables for printout templates (see the list in APPENDIX 01 of this manual)



Clear the editing field

Default printouts' settings:

A.	Weighing Printout Template	{0}
d'	Weighments Report Printout Template	See ch. 35.4.2
d'	Cumulative Printout Template	N={15} SUM={16}
d'y	Cumulative of Cumulative Printout Template	N2={20} SUM2={21}
d'	Dosing Report Printout Template	See ch. 28.7
AN TO	Formulation Report Printout Template	See ch. 29.5
A.	Printout Template of an Ingredient in a Formulation	-
	PGC Report Printout Template (Control of Packaed Goods)	See ch. 30.14
	Average Tare Report Printout Template (Control of Packaed Goods)	See ch. 30.13
A.	Density Printout Template	See ch. 31.4
A.	Enter Ticket Printout Template	See ch. 33.5

	Exit Ticket Printout Template	See ch. 33.5
	Control Weighing Ticket Printout Template	See ch. 33.5
	Vehicle Scales Report Printout Template	See ch. 33.5
J.	Product Printout Template	{50} {51}
J.	Operator Printout Template	{75} {76}
J.	Client Printout Template	{85} {86}
EP	Warehouse Printout Template	{130} {131}
J.	Package Printout Template	{80} {81} {82}
	Vehicle Printout Template	{210} {211}
A STATE OF THE STA	Adjustment report printout template	See ch. 22.3
	Report on SQC – printout template	See ch. 24.8.2

16.3. Printouts activation

Printouts activation> submenu enables activation/deactivation of demanded standards printout.

Procedure:

- Enter < Devices> parameters group, following point 16 of this manual select " Printer / Printouts activation",
- Activate/deactivate demanded standard intended for printout.

Where:



- Inactive standard



- Active standard

16.4. Barcode scanner

The balance allows for cooperation with a barcode scanner. The scanner can be used for quick search of:

- Products.
- Operators,
- Clients,
- Packages,
- Warehouses,
- · Dosing process,
- Formulation,
- Universal variables,
- Lot number.
- Batch number.

Configuration of communication can be configured in:





" Devices / Barcode reader".

Caution:

In submenu < Communication> set the baud rate (default 9600b/sec). The detailed description of cooperation scale - barcode scanner can be found in APPENDIX 06 in this manual.

16.4.1. Port for barcode scanner

Procedure:

"Sarcode reader / Port" and then set the appropriate value.

Barcode scanners can be connected to:

- RS232 (1),
- RS232 (2),
- USB.

16.4.2. Prefix / Suffix

Users can edit a prefix < Prefix> or / and suffix < Suffix> in order to adjust the program to accept transmission frames from the scanner.

Caution:

A special protocol is required in order the code be received by RADWAG equipment. It is required to program an appropriate prefix and suffix. Prefix – one byte 01 hexadecimal form, suffix one byte 0D hexadecimal form. The detailed description of cooperation scale – barcode scanner can be found in **APPENDIX 06** in this manual.

Procedure:

- Enter < TBarcode Scanner> according to ch.16.3 of the manual,
- Chose parameter < Prefix> and then enter, using the screen keyboard, a required value (hexadecimal) and confirm it by pressing
- Chose parameter
 Suffix> and then enter, using the screen keyboard, a required value (hexadecimal) and confirm it by pressing

16.4.3. Field selection

This option is connected with selecting data which the program will search after reading a barcode.

Procedure:

- Enter < Devices> according to ch.16 of the manual,
- Chose " Barcode Scanner / Field selection" and then the following list will be displayed:





Select an item and then you can edit following parameters:

code	Filtering	Declaring an item, according to which searching is supposed to be performed
	Offset	Setting the first significant character in code from which the comparison with items is performed during searching. All preceding characters are skipped
	Code length	Setting the number of characters to be taken for the search procedure counting form Offset
88	Start marker	Start marker declaration
99	End marker	End marker declaration

Caution:

An exception from the above is **Formulation**, which features an additional submenu **Ingredient** containing the following parameters:

code	Filtering	Declaring an item, according to which searching is supposed to be performed (options: None , Code)
	Offset	Setting the first significant character in code from which the comparison with items is performed during searching. All preceding characters are skipped
	Code length	Setting the number of characters to be taken for the search procedure counting form Offset

88	Start marker	Start marker declaration
93	End marker	End marker declaration

Inventory of items to be selected for filtering:

Record	Item for filtering
Product	None, Name, Code, EAN Code
Operator	None, Name, Code
Client	None, Name, Code
Package	None, Name, Code
Source warehouse	None, Name, Code
Target warehouse	None, Name, Code
Dosing process	None, Name, Code
Formulation	None, Name, Code
Universal variable 1	None, Code
Universal variable 2	None, Code
Universal variable 3	None, Code
Lot number	No, Yes
Batch number	No, Yes

16.4.4. Test

Operators, using parameter < Test, can verify if a barcode connected to the scale works properly.

Procedure:

- Enter submenu < Table Barcode Scanner > according to ch. 16.3 of this manual,
- After entering parameter < TEST Test> window <Test> is opened with an ASCII text box and HEX (hexadecimal) field,

 After scanning the code is entered to the ASCII field and HEX filed and at the bottom of the window a test result is displayed.

When:

- <Prefix> and <Suffix> declared in settings are the same as
 <Prefix> and <Suffix> in the read code then the test result is <Positive>,
- <Prefix> and <Suffix> declared in settings are not the same as
 <Prefix> and <Suffix> in the read code then the test result is <Negative>.

16.5. Transponder card reader

Each time after turning on the device, it is possible to select (log in) the operator using a transponder card reader and a transponder card.

Caution:

In case of problems with reading transponder cards check the submenu **Communication>** and set appropriate baud rate (default 9600b/s).

16.5.1. Com port for transponder card readers

Procedure:

Enter group of parameters < Devices> according to ch. 16 of this manual, select , Transponder cards reader / Port" and set appropriate option.

The scale can communicate with the reader via following ports:

- RS232 (1),
- RS232 (2).

16.5.2. Procedure of attributing the card number to an operator

To use a transponder card to log on an operator the card needs to be ascribed to the operator in the database of operators.

Procedure:

- Connect the transponder card reader to the required communication port (RS 232 (1) or RS 232 (2)),
- Choose a communication port for the reader (see ch. 16.4.1 in this manual),
- In submenu < Communication> set the baud rate to the same as in the reader (default 9600b/s),
- After entering the field <RFID Card Number> you will see the editing field <Card Number> with the screen keyboard,
- Having approached the card to the reader the program automatically displays its number in editing field <Card Number>,
- Confirm the number by pressing and return to weighing.

16.6. Additional display

16.6.1. Additional display port

Procedure:

Enter parameters group < Devices> according to ch. 16
 of this manual, select " Additional display / Port"
 and then choose an appropriate option from the list.

Communication with additional displays can be performed via following ports:

- RS232 (1),
- RS232 (2),
- TCP.

16.6.2. Communication protocol frame

Weighing indicator with following displays:

- WD display,
- WWG display.

To start cooperation of scales with displays go to parameter < Sample> and define an appropriate communication protocol.

Procedure:

- Enter parameters' group < Devices> according to ch. 16 of this manual,
- Choose " Additional display / Sample" then the editing field
 Sample with the screen keyboard appears,
- Enter the required frame template using the screen keyboard or choose the it from the list after pressing

Specified templates for displays:

- **{141}** Protocol template for WD displays.
- {142} Protocol template for WWG display.
- Confirm the changes by pressing

Caution:

In default settings parameter < Sample> has ascribed {141} (display WD series).

16.7. Modbus RTU

Modbus RTU is a standard communication protocol determining means for exchange of information between two or more devices. **ModBus RTU** provides as fast data transfer as possible, wherein the data is monitored in order to provide that it is reliable.

Caution:

For detailed overview of memory map and of variables of Modbus RTU communication protocol go to chapter 38 of this manual.

16.7.1. Communication port

Procedure:

• Enter < Devices> parameter group as described in chapter 16 of this manual, select " Modbus RTU / Port" and set respective value.

Available values:

- None.
- RS232 (1),
- RS232 (2),
- TCP.

16.7.2. Address

Procedure:

- Enter < Devices> parameter group as described in chapter 16 of this manual.
- select " Modbus RTU / Address" and wait to see <Address> window featuring an on screen keyboard.
- enter determined address and press button to confirm.

16.8. Advanced settings

Advanced settings> submenu enables declaration of printers cooperation with scales, cooperation of 1-3 printers may be declared.

Procedure:

- Enter parameters' group < Devices> according to ch. 16 of this manual.
- Select " Advanced settings / Number of printers", next set demanded number of printers (1, 2 or 3).
- Zoevices parameters group will automatically be extended with new positions.

17. DISPLAY

Users can adapt the main display and visible information to their needs. All parameters of the display can be found in the parameters' group

Display>. Entering **Display>** can be made in two ways:

- Pressing and then: "Display",
- Pressing "Text information" field.


Inventory of parameters of the main display:



- *) For PGC and SQC modes, functions of buttons are defined individually for:
 - Home screen,
 - Settings screen,
 - Process screen.

17.1. Display components

Workspace of the display comprises four programmable screens for each working mode:

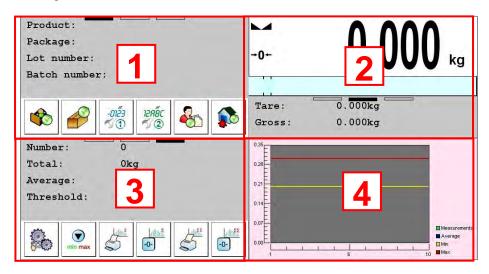

Notice:

"PGC", "SQC", "Vehicle scale" modes are exception to the rule, for these modes it is possible to program screens 2 and 4 exclusively.



Display components 1
Display components 1
Display components 1
Display components 1
Set default

Each programmable screen comprises the following components:

- mass,
- bargraph,
- · workspace,
- buttons,
- chart,
- databases *.
- *) component intended for screen 1 and 2 exclusively:
 - Component declared for screen 1 is automatically displayed within area of screen 1 and 3,
 - Component declared for screen 2 is automatically displayed within area of screen 2 and 4.

For < Set default> function, default values for screen components of particular working mode are set.

Each of the above listed components features declared area, the program automatically reduces possibility of selection of particular components for a given programmable screen. See the table below:

	Mass	Bargraph	Workspace	Buttons	Chart	Databases
1	✓	✓	*	-	-	-
2	✓	✓	-	✓	-	-
3	✓	-	*	✓	-	-
4	-		✓		-	-
5	-	-	-	-	*	-
6	-	-	-	-	-	*

Screen components can be combined (scaling) within programmable screens, where:

- "Mass"
 - Combining programmable screen 1 and 2
 - Combining programmable screen 3 and 4
- "Bargraph"
 - Combining programmable screen 1 and 2
 - Combining programmable screen 3 and 4

- "Chart"
 - Combining programmable screen 1 and 2
 - Combining programmable screen 3 and 4
- "Workspace"
 - Combining programmable screen 1 and 2
 - Combining programmable screen 3 and 4
 - Combining programmable screen 1 and 3
 - Combining programmable screen 2 and 4
- "Databases"
 - Combining programmable screen 1 and 3
 - Combining programmable screen 2 and 4

Notice:

Combining programmable screens is conditioned by the following:

- For "Mass" component it is necessary to declare the same platform number:
- For "Bargraph" component it is necessary to declare the same platform number:
- For "Workspace" component it is necessary to declare the same display layout;

17.2. Mass



Mass> component is a window containing information on weighing:



Procedure:

- While operating a particular working mode, enter < Display> submenu following instruction provided by section 17.
- Enter < Display components> submenu and select particular screen component,
- Run < Mass> component.

17.3. Text strings



		Display template	
		Left displaying template	Data displayed in the workspace. Detailed description in point 17.3.1.
		Right displaying template	
3		Font	Submenu on font settings.
	aa	Туре	Changing font type for text data displayed in the workspace. Available fonts: Arial, Courier.
	13	Font size	Declaring font size of text data displayed in the workspace. Available font size: Small, Medium, Large.
	á	Bold font	Bolded font for text data displayed in the workspace.
	áa	Tilt	Text data in the workspace in italics.
	ð	Colour	Font colour for text data in the workspace. Available in 18 colours palette.
O		Background colour	Colour of the workspace background. Available in 18 colours palette.
		Set Default	Default settings for "Text data" submenu.

17.3.1. Display templates

The main window contains a workspace which displays optionally configured data specified for each working mode.

The workspace comprises three displaying templates:

- Displaying template,
- Left displaying template,
- Right displaying template.

The upper section of the workspace comprises a graphic information on which of the three templates is enabled. Changing of the template is carried out by dragging the workspace to the right or left.

Change of the displaying template is carried out in submenu:



Procedure:

- While in an optional weighing mode enter submenu < Display>
 in accordance with point 17 of this user manual,
- Select option < 1 Text information> and then a desired displaying template, which is followed by displaying an editing field with is default content and an on-screen keyboard
- Edit the content of the selected displaying template and accept it by pressing key.

Caution:

There are additional buttons in the bottom line of the screen keyboard. They can be used while modifying a display template. :



Screen keyboard on/off



Reading a template from a file with format *.lb (option enabled on plugging a portable data storage device to scale port)



Saving printout template in a file format *.lb (option enabled on plugging a portable data storage device to scale port)



Selecting variables for a template from a list (list of variables is provided in the APPENDIX 01 of this user manual)



Clear the editing field

17.4. Function keys

Button functions> submenu is designed to enable screen buttons programming. The buttons are programmed individually for each of the working modes. Particular button gets activated when a specified function is assigned to it. The button stays inactive when no function is assigned to it.

Procedure:

- While in optional working mode go to submenu < Display>
 in accordance with point 17 of this user manual
- Select < Button functions > and enter particular screen submenu (1, 2, 3 or 4)
- Set particular option for the given screen button.

Set default> function is designed to enable setting of default values for programmable buttons for a particular working mode.

Caution:

The list of functions that can be attributed to keys or buttons is listed in **APPENDIX 02** of this manual.

17.5. Bargraph

A bargraph is a typical visualization procedure. It helps in quick weighing. It requires less concentration to read if a weighing is between minimum and maximum thresholds. To access bargraph settings go to

" Display / Bargraph" submenu.

Notice:

Set default> function is designed to enable setting of default parameters for bargraph for a particular working mode.

17.5.1. Bargraph type

To declare bargraph type go to: "Display / Bargraph" / Pargraph Type" submenu.

Accessible bargraphs:

- · None (Bargraph is not displayed),
- · Fast weighing,
- · Signalling checkweighing ranges,
- Linear,
- Control *.

*) – intended for "PGC" and "SQC" working modes exclusively, remaining bargraph types for these mode are inaccessible.

17.5.2. Bargraph "Fast weighing"

Setting of bargraph type "Quick weighing" are accessible in submenu "Display / Bargraph / Quick weighing":

MAX	MIN, MAX thresholds working mode	Stable – signalling of MIN, MAX thresholds is previewed on exceeding LO threshold and reaching stable measurement result; Unstable – signalling of MIN, MAX thresholds is previewed on exceeding LO threshold
Оок	OK threshold working mode	Stable – signalling of OK thresholds is previewed on exceeding LO threshold and reaching stable measurement result; Unstable – signalling of OK thresholds is previewed on exceeding LO threshold
2	Min threshold signalling colour	Colour selection for signalling MIN threshold. 18 colours palette available.
8	OK threshold signalling colour	Colour selection for signalling OK threshold. 18 colours palette available.
A MAX	Max threshold signalling colour	Colour selection for signalling MAX threshold. 18 colours palette available.
	Gradient	Enabling / Disabling filling effect "Gradient" type.
O	Background colour	Colour selection of a bargraph background. 18 colours palette available.
	Frame colour	Colour selection of bargraph frame. 18 colours palette available.

The bargraph consists of 8 red fields and three green fields.



 The green fields signal weighings between MIN and MAX threshold, where:

MIN = the minimum threshold of acceptable weighing - LO **MAX** = the maximum threshold of acceptable weighing - HI

- If a measurement is over the MIN (to the value of 1/3 of MIN-MAX) the
 green field with a triangle on the left is visible. If the measurement is
 between 1/3 and 2/3 of MIN-MAX the rectangular green field is visible.
 If the measurement is between 2/3 of MIN-MAX and MAX a green field
 with a triangle on the right is visible.
- If the mass value is below the MIN threshold red fields with red arrows on the left are visible. The lower mass value the more red arrows are visible.
- If the mass value is over the MAX threshold red fields with red arrows on the right are visible. The higher mass value the more red arrows are visible.

Thresholds MIN and MAX are on the borders between red and green fields.

17.5.3. Bargraph "Signalling of checkweighing ranges"

Settings of "Signalling checkweighing ranges" bargraph are accessible in submenu "Display / Bargraph / "Signalling checkweighing ranges":



MIN, MAX thresholds working mode

Stable – signalling of MIN, MAX thresholds is previewed on exceeding LO threshold and reaching stable measurement result; **Unstable** – signalling of MIN, MAX thresholds is previewed on exceeding LO threshold

ООК	OK threshold working mode	Stable – signalling of OK thresholds is previewed on exceeding LO threshold and reaching stable measurement result; Unstable – signalling of OK thresholds is previewed on exceeding LO threshold
	Min threshold signalling colour	Colour selection for signalling MIN threshold. 18 colours palette available.
	OK threshold signalling colour	Colour selection for signalling OK threshold. 18 colours palette available.
MAX	Max threshold signalling colour	Colour selection for signalling MAX threshold. 18 colours palette available.
	Gradient	Enabling / Disabling filling effect "Gradient" type.
O	Background colour	Colour selection of a bargraph background. 18 colours palette available.
P	Frame colour	Colour selection of bargraph frame. 18 colours palette available.

• This type of bargraph comprises one green and 2 red fields.



- The left red field signals that the load on the pan is lower than the minimum weighing threshold (Min threshold);
- The central green field signals that the load on the pan is within the set required interval for the weighed product (OK value between Min and Max thresholds);
- The right red field signals that the load on the pan is greater than the maximum weighing threshold (Max threshold).

17.5.4. Bargraph type: "Linear"

Settings of "Linear" bargraph are accessible in submenu

" Display / Bargraph / Linear":


R	Min threshold signalling colour	Colour selection for signalling MIN threshold. 18 colours palette available.
8	OK threshold signalling colour	Colour selection for signalling OK threshold. 18 colours palette available.
A K	Max threshold signalling colour	Colour selection for signalling MAX threshold. 18 colours palette available.
00	Min Max range background colour	Background colour selection for MIN, MAX range of the bargraph. 17 colours palette available.
	OK range signalling colour	Background colour selection for OK range of the bargraph. 18 colours palette available.
	Gradient	Enabling / Disabling filling effect "Gradient" type.

The bar graph represents in a linear way the measuring range of a scale.



In addition, the bar graph can indicate weighing thresholds MIN, MAX, if they have been determined:

• Signalization of mass below the value set in MIN threshold:

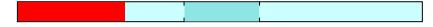

• Signalization of mass within MIN and MAX values of thresholds:



• Signalization of mass exceeding the value set in MAX threshold:



17.5.5. "Control" bargraph

The "Control" bargraph is operated only in the working mode < PGC>.

The bargraph features signalization points of:

- Nominal mass Qn declated for a product,
- MIN, MAX thresholds if such are declared,
- Mass value for Qn-T,
- Mass value for Qn-2T,
- Mass value for Qn+T,
- Mass value for Qn+2T.


Where:

Qn – nominal mass

T – T error

2T - double T error

Signaling mass below set value of Qn-2T:

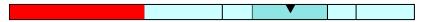

Signaling mass between the values of Qn-2T and Qn-T:



Signaling mass between the value of Qn-T and Qn+T:



The bargraph field between the above values gets automatically rescaled and it is additionally marked by a "**magnifier**" pictogram visible in graph's left corner.

Signaling mass between the value of Qn+T and Qn-2T:



Signaling mass above the set value of Qn+2T:



Caution:

In case of additional declaring the values for **MIN**, **MAX** limits, the "**control**" bargraph refers to the **MIN**, **MAX** limits and the nominal mass, but without displaying the errors for **T** and **2T**.



18. INPUTS / OUTPUTS

Weighing indicator are equipped with 4 inputs / 4 outputs. To adjust software to the users needs configure inputs outputs in the submenu

in the submenu < Inputs / Outputs>:

- indicator inputs,
- indicator outputs.

In order to enter submenu < Inputs / Outputs>, press and then:

18.1. Configuration of inputs

Procedure:

- Enter < Inputs / Outputs> according to ch. 18 of this manual,
- Choose < Inputs> and enter the selected input you will see a list of functions to ascribe,
- Choose the required function from the list and return to weighing saving the changes according to ch. 12.2 of this manual.

Caution:

The list of functions to ascribe to inputs are described in **APPENDIX 02** of this manual. By default inputs have no ascribed functions **<None>**.

18.2. Configuration of outputs

Ascribing a function to the output enables the output at the same time. If an output has no ascribed function it is disabled.

Procedure:

- Enter < Inputs / Outputs> according to ch. 18 of this manual,
- Choose < Outputs> and enter the required output, then you will see the list of functions:

None	Output disabled
Stabile	Stable weighing result over LO threshold value
MIN stable	Stable weighing result below the MIN threshold
MIN non-stable	Non-stable weighing result below the MIN threshold
OK stable	Stable weighing result between MIN and MAX thresholds
OK non-stable	Non-stable weighing result between MIN and MAX thresholds
MAX stable	Stable weighing result over the MAX threshold
MAX non-stable	Non-stable weighing result over the MAX threshold
Zero	Stable weighing result zero net
Confirmation of cycle completion *	Signal that confirms that a cycle of dosing has been completed (the defined amount)
Zero	Zero weighing result ("zero" indication)
! OK unstable	Unstable weighing result ouside OK threshold
! OK stable	Stable weighing result ouside OK threshold
Measurement saved	Signal for measurement record confirmation - OUT programmed to be active for 500 [ms]
Tarring completed	Signal for tarring operation confirmation - OUT programmed to be active for 500 [ms]
Zeroing completed	Signal for zeroing operation confirmation - OUT programmed to be active for 500 [ms]
Error	Error message displayed
PGC – pending weighing process	Signal for awaiting for weighing performed within PGC control process

PGC – pending control	Signal for awaiting for PGC control
-----------------------	-------------------------------------

- *) Not applicable to "Standard" software.
- Choose the required function from the list and return to weighing saving the changes according to ch. 12.2 of this manual.

Caution:

By default all outputs have no function attributed - setting < None>.

19. AUTHORIZATION

The submenu **Authorization** is accessible only while being logged in as the **Administrator**. In this group of parameters access levels can be outlined.

To enter submenu < Authorization>, press and then:



19.1. Anonymous Operator

The program allows to attribute the authorization access level to an operator who does not perform the log-in procedure (anonymous operator).

Procedure:


• Enter < Authorization> according to ch. 19 of this manual, choose < Anonymous Operator>, and then set the authorization access level.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

19.2. Date and time

Default settings allow a logged-in **Administrator** to change settings of date and time. Software however allows to change the access level to this option:

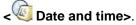

Procedure:

Enter parameters' group < Authorization> according to ch.
 19 of the manual, choose < Date and time>, and then set the parameter.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

Caution:

Setting **<None>** allows free access to settings of date and time (without the need of Loggingg in).

19.3. Printouts

Default settings of the scale allows a logged on **Administrator** to edit printout templates. Software allows to change the access level to option **Printouts>**.

Procedure:

Enter parameter group < Authorization > according to ch. 19 of this manual, choose < Printouts >, and set approprietely.

Access levels to printouts that can be set:

None, Operator, Advanced Operator, Administrator.

Caution:

When you choose setting **<None>** printout templates can be changed even without Loggingg on.

19.4. Databases edition

It is possible to set the access levels to the following databases:

- Database of Products,
- Database of Clients.
- Database of Formulations,
- Database of Dosing processes,
- Database of Packages,
- Database of Warehouses.
- Database of Vehicles.
- Database of Labels,
- Database of Images,
- Database of Identification processes,
- · Weighing counter,
- Delete older data.

Procedure:

Enter parameters' group < Authorization> according to ch. 19
of the manual, choose < Databases edition>, and then set the
parameter.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

Caution:

Setting **<None>** allows free access to settings of date and time (without the need of Loggingg in).

19.5. Delete older data

Scales default settings allow for cancellation of older data kept in Reports> submenu. To do it the user must log in as an Advanced Operator (NOTE: the software allows for changing the access level to Delete older data> option).

Procedure:

Enter parameters' group < Authorization> according to ch. 19
 of the manual, choose: "Databases edition / Delete older data", and then set the parameter.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

19.6. Set element from the database

The user may set authorization levels for scales operator when it comes to selection of particular database positions by the operator:

- Products,
- Clients,
- Formulas.
- Dosing processes,
- Packaging,
- Warehouse,
- · Vehicles,
- Identification processes,
- Lot number,
- Batch number

Procedure:

Enter parameters' group < Access level> according to ch. 19 of this
manual, select < Set element From the database> and then set the
appropriate option.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

Caution:

Setting **<None>** allows free access to selection of a particular database position (without the need of logging in).

19.7. PGC

The user may set authorization levels when it comes to modification of the following local parameters values of **PGC>** operating mode:

- Batch number.
- Number of batches,
- Number of samples,
- Average tare estimation,
- Tare,
- Density.

Procedure:

Enter parameters group < Access level>, according to ch. 19 of this manual, select < PGC> and then set a right option.

Accessible authorization levels:

None, Operator, Advanced Operator, Administrator.

20. UNITS

Scale, in submenu < i Units> enables selecting:

- Declaring accessibility of the weighing untis,
- · Declaring the start unit,
- Determining two user defined units (custom units),
- Changing the value of g-cor (the value of gravitational acceleration force).

To enter submenu < isis Units>, press and then: "isis Units".

20.1. Units accessibility

Submenu < [10] Accessibility> enables declaring weighing units that should be accessible for selecting in the weighing window after pressing the weighing unit pictogram.

Procedure:

- Enter submenu < Units in accordance with ch. 20 of this user manual,

Where:



- Weighing unit enabled
- Weighing unit disabled
- Set required accessibility criterion for the weighing units and exit to weighing mode.

20.2. Start unit

Procedure:

- Enter submenu < Units> in accordance with ch. 20 of this user manual.
- Select option < [Start units > and choose a start unit from displayed list of available weighing units.

Possible selection:

- none
- gram [g]
- kilogram [kg]
- carat [ct]
- pound [lb]
- ounce [oz] *
- Newton [N] *
- *) weighing unit inaccessible in a verified scale
 - Exit to main menu with procedure of saving changes,
 - On restarting the scale, the instrument operates with enabled start unit.

20.3. User defined units

An option only for non-verified scale

Procedure:

- Enter submenu < Units> in accordance with ch. 20 of this user manual,
- Select option < In Defined unit 1> and determine the values of the following parameters:

00285	Multiplier	Multiplier of scale's adjustment unit
N	Name	Unit name (Max 3 characters)

- Exit to main menu with procedure of saving changes,
- Press symbol of the new weighing unit visible in the weighing window, which activates list of available weighing units with new custom unit added at the end of the list.

Caution:

The procedure of defining the second custom unit < [ct] Defined unit 2> is equal to the procedure described above.

20.4. Acceleration of gravity

Parameter < [10] Acceleration of gravity> eliminates the changes of gravitational acceleration force at different latitudes and altitudes in case of weighing process with application of "Newton" [N] weighing unit.

Procedure:

- Enter submenu < in units in accordance with ch. 20 of this user manual,
- Select option < [[]] Acceleration of gravity> which opens an editing window < Acceleration of gravity> with a numeric keyboard,
- Insert the new value of acceleration of gravity for the place of use and accept it by pressing key,
- Exit to main menu.

21. OTHER PARAMETERS

There is a group of parameters different from others which influence the operation of the scale. They are gathered in group < Others> e.g. language, beep etc. To enter < Others>, press and then:

Others".

21.1. Languages

Procedure:

• Enter submenu Cothers> according to ch. 21 of this manual, choose Canguage> and set the parameter.

Accessible languages:

• Polish, English, German, French, Russian, Spanish, Czech, Hungarian, Estonian, Latvian, Italian, Greek, Turkish, Thai, China, Roman.

21.2. Setting date and time

Users can set date and time that are visible in the main window of the display. Entering the edit window of date and time can be made in two ways:

- Pressing the field "date and time" in the top bar of the main screen,
- Enter: " Others / Date and Time / Set date and time" submenu.

After entering the setting of date and time the screen keyboard appears. Set year, month, day, hour, minutes and confirm by pressing _____.

" Others / Date and Time" submenu contains additional functions that serve for defining date and time format:

Icon	Name	Value	Description
15	Date format	yyyy.MM.dd *	Selection of date format. Possible values: d.M.yy, d.M.yyyy, d/M/yy, dd.MM.yy, dd.MM.yyy, dd.MM.yyy, dd.MM/yy, dd/MM/yyy, dd/MM/yyy, dd-MM-yy, dd-MM-yy, M/d/yy, M/d/yyyy, MM/dd/yy, MM/dd/yyyy, yy/MM/dd, yy-M-dd, yy-MM-dd, yyyy.MM.dd, yyyy-M-dd, yyyy-MM-dd.
	Time format	HH:mm:ss **	Selection of time format. Possible values: H.mm.ss, H:mm:ss, H-mm-ss, HH.mm.ss, HH:mm:ss, HH-mm-ss, H.mm.ss tt, H:mm:ss tt, H-mm-ss tt, HH.mm.ss tt, HH:mm:ss tt, HH-mm-ss tt, h.mm.ss tt, h:mm:ss tt, h-mm-ss tt, hh.mm.ss tt, hh:mm:ss tt, hh-mm-ss tt
Osa Par	2013.03.29	14:32:09	Date and time preview, declared formats taken into account.

^{*) -} For date format: y - year, M - month, d - day

Caution:

Parameter < Date and Time> is accessible in the scale menu depending on the authorization access level set in the related parameter.

21.3. Sound signal

Procedure:

• Enter < Others> according to ch. 21 of this manual, < Beep> and set accordingly.

Settings:

None - Sound for buttons and proximity sensors disabled

Buttons - Sound for buttons enabled

Sensors - Sound for proximity sensors enabled

All - Sound for buttons and proximity sensors enabled

^{**) -} For time format: H - hour, m - minute, s - second

21.4. Screen brightness

Scale user can change brightness of the screen in the range between **0%** and **100%**.

Caution:

The default screen brightness is set to 90%.

Procedure:

- Enter submenu **Other>** as described in chapter 21 of this manual.
- Select < Screen brightness> parameter, < Screen brightness> editing window with an on screen keyboard is displayed.
- Enter required screen brightness value in [%] and press button to confirm.

21.5. Energy saving mode

The user can activate energy saving mode.

Procedure:

• Enter submenu Others> according to ch. 21 of this manual, select Energy saving mode> parameter and set appropriate option.

Where:

None - Energy saving mode off
Screen dimming - Changing screen brightness
Screensaver - Activating screen blanking mode
Slideshow - Activating slideshow mode

Caution:

Active screen saving mode is conditioned by:

- Active < Screen timeout> parameter (read chapter 21.8 of this manual).
- Home screen of the scale displayed,
- Zero indication.

21.6. Screen timeout

The user can specify how much time it shall take before sleep mode activates. By default the value is set to **0[s]** (parameter inactive).

Procedure:

- Enter submenu Others> according to ch. 21 of this manual.
- Select < Screen timeout> submenu, < Screen timeout> editing window with an on screen keyboard is displayed.
- Enter required time value in [s] and press button to confirm.

21.7. Log out automatically when time elapses

At a user disposal there is an option of automatically performed log out operation, carried out upon specified time interval given in [min]. By default the value is **0 [min]** (inactive parameter).

Procedure:

- Enter < Others> submenu according to ch. 21 of this manual.
- Select < Log out automatically when time elapses> parameter, respective window opens, an on-screen keyboard is displayed.
- Enter specified value, use [min] unit, and press ______ to confirm.

Caution:

Function activates upon specified time interval provided that:

- Home screen is operated.
- The indication is zero.

With the above conditions met, the logged in user gets logged out automatically, the following message is displayed:



Operator logged out automatically>.

21.8. Permissible quantity of unsuccessful logging

The program features option for locking particular operator logging, the operator is locked after specified number of logging operations has been performed by him/her.

Procedure:

- Enter submenu **Others** according to ch. 21 of this manual,
- Select < Permissible quantity of unsuccessful logging> parameter, respective window opens, an on-screen keyboard is displayed,
- Enter specified value and press to confirm.

When the operator has logged in for specified number of times the following message is displayed:



21.9. Logging in required

Logging in required> parameter must be active if a logging operation is to be carried out by an operator after the device have been turned on.

Procedure:

Enter submenu Cothers> according to ch. 21 of this manual, select
 Logging in required> parameter and then set the appropriate option.

Where:



- Inactive logging required
- Active logging required

21.10. Start logo

Submenu < Start logo > allows to substitute a "start" graphic file of a scale with another one located on a memory stick.

Procedure:

- · Put a memory stick into USB port of a scale,
- Enter submenu: "Cocothers / Start logo" according to ch. 21 of this manual,
- Enter < L060 Start logo > to open content of a memory stick main folder,
- Chose the desirable graphic file and wait until scales program
 automatically returns to the < Start logo> submenu. Chosen graphic
 will be displayed.

Set Default> option enables the user to get back to the default "Start logo".

Caution:

Maintained file formats are *.jpg, *.png, with optimal (max.) resolution of 640x480 pixels.

21.11. Error information preview time

Submenu < Error information preview time> enables user to declare for how long information about errors is to be displayed.

Procedure:

Enter submenu Cothers> according to ch. 21 of this manual, select parameter Cothers> according to ch. 21 of this manual, select parameter cother information preview time> and set the appropriate option.

Where:

- 1 [s] Displaying an information about errors for 1 [s]
- 3 [s] Displaying an information about errors for 3 [s]
- 5 [s] Displaying an information about errors for 5 [s]
- 10 [s] Displaying an information about errors for 10 [s]
- Max Displaying an information about errors until it has been confirmed with ♥ button.

21.12.Export / import of settings

The user can export/import scale settings (printout templates, user parameters) using flash memory stick.

Procedure for settings export:

- · Connect flash memory stick to USB port of your scale,
- Enter "Cothers / Export" submenu, settings are exported automatically to flash memory stick plugged to scale USB port.
- Upon completed procedure the following message is displayed: "Operation completed successfully".

Procedure for settings import:

- · Connect flash memory stick to USB port of your scale,
- Enter "Others / Comport" submenu, settings are imported automatically from flash memory stick plugged to scale USB port.
- Upon completed procedure the following message is displayed: "Operation completed successfully".

22. USER ADJUSTMENT

An option only for non-verified scale

Scales require to recalculate internal divisions to more suitable ones (e.g. g, kg etc.). In order to do this they require an adjustment factor. It is adjusted during the adjustment procedure using a mass standard. Adjustment should be carried out if weighing a standard mass shows a different mass value.




22.1. Adjusting procedure

- Enter submenu < User Adjustment > according to ch. 22
 and select: " Adjustment",
- After entering the parameter the following message box appears:



- Take the load off the pan of platform 1,
- Press button _____. The following message appears during adjusting start mass: "Evaluation of starting mass",
- After the procedure has been completed the following message box appears:

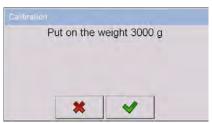

- Place determined mass on pan of platform 1 and then select
- After the procedure of adjustment factor determination following command appears:



 Accept the message box by pressing key and return to weighing mode.



< Setting of start mass> parameter allows to adjust start mass of platform 1.

Caution:

Adjustment process for remaining platforms is likewise.

22.2. Start mass adjustment

It is possible to adjust only a start mass, it helps to correct the start zero when the span does not change.

Procedure:

- Enter submenu < User Adjustment > according to ch. 22 and select: " Setting of start mass",
- After entering the parameter the following message box appears:



- Take the load off the pan of platform 1,
- Press button . The following message appears during adjusting start mass: "Evaluation of starting mass",

 After the procedure has been completed the following message box appears:



 Accept the message box by pressing key and return to weighing mode.

22.3. Report from adjustment process

Parameter < Report printout> enables activating the function of automatic printout of a report from adjustment process on a printer plugged to the scale.

Procedure:

Enter submenu < User Adjustment> in accordance with ch. 22 of this
user manual, select parameter < Report printout> and set its
appropriate value.

Where:



- Automatic report printout switched off
- Automatic report printout switched on

Caution:

Submenu: ' Devices / Printer / Printouts

/ Adjustment report Printout template" enables optional modification of report template (see ch. 16.2.3 of this user manual).

22.4. Adjustment track record

Each completed adjustment process is automatically saved in scale's database in submenu < Adjustment track record>.

In order to enter submenu < Adjustment track record >, press key, and: "User Adjustment / Adjustment track record". Files comprising reports have names with time and date when the process was performed.

List of data for a carried out adjustment process:

	Date	Data of carried out operation
8	Operator	Operator name
*	Nominal Mass	Mass of adjustment weight
3	Platform number	Platform number on which an operation was performed

The user can print data on a specific entry by pressing key, located in the top bar of software's window.

23. SOFTWARE UPDATE

A user of the scale can carry out ON-LINE updating of the software version using Ethernet network or an external data storage device connectable to the USB port of the indicator.

Enter the submenu < Update> by pressing key, and next press: "Update".

23.1. ON-LINE updating

Caution:

- 1. **ON-LINE** updating requires access to a global **INTRANET** network.
- 2. Before updating the software, go to scale's submenu:
 - " Communication > Ethernet" and set transmission parameters for compatible with the client's local network.

Procedure:

- Enter submenu < Update> in accordance with point 23 of this user manual.
- Select parameter < Software version on server> which reads software version and its availability date on RADWAG server.

Caution:


In case of no connection with the global network **Intranet** or incorrect settings of Ethernet parameters, the scale displays the following message:

"WNo connection".

 Go to parameter < Update From server> which displays the following message:



 Accept the message by pressing key which is followed by displaying the updating progress window:

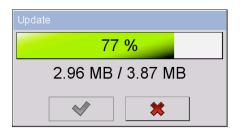

 After downloading the update press an active key which is followed by displaying a message:



 Accept the message by pressing key. The indicator shall restart with update installing procedure.

23.2. Update from pen drive

Procedure:

- Copy file "update.hy10" containing the current software version onto the external data storage device (to the main catalogue),
- · Connect the data storage device to indicator's USB port,
- Go to submenu < Update> in accordance with point 23 of this user manual,
- Go to parameter < Update From pen drive> which displays the following message: "Update?",

Caution:

In case the data storage device is not connected to the indicator's USB port and/or there is no "update.hy10" file in the main catalogue of the pen drive, the software displays the following message "Update error".

 Accept the message by pressing key which automatically starts the updating process. On its completion the indicator displays the following message:



 Accept the message by pressing key. The indicator shall restart with update installing procedure.


23.3. Changes in software

Parameter < Changes in software> enables acquiring data on changes present in the updated software version.

Procedure:

On completing the software updating procedure go to parameter

Changes in software> which opens an information windowChanges in software>:

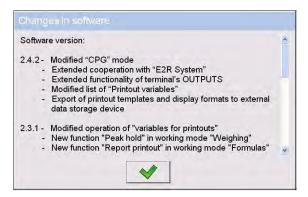

24. SPECIAL FUNCTIONS OF WORKING MODES

Scale can operate in following work modes:



Weighing



Counting pieces



Deviations



Dosing



Formulation



PGC



Density



Weighing animals



Vehicle scale

Work modes can be configured in < Working Modes>.

To enter submenu < Working Modes>, press and then:



"Working Modes".

The settings of specific working modes provide access to special functions adjusting operation of the instruments to client's individual needs.

Caution:

- 1. An on-screen button (local settings) of home screen of each working mode enables direct access to particular modes' settings
- 2. The change in on mode results in the same change for other working modes working modes.

Part of the special functions have global effect, i.e. they are applicable to most of accessible working modes (except for working modes: Formulation, Dosing, Vehicle scale), as presented on below table:

	Weighing	Parts counting	Percent setup	Weighing animals	Density	PGC
Save Mode	+	+	+	-	+	+
Down-weighing	+	+	+	-	-	-
Checkweighing	+	+	+	+	+	-
Tare mode	+	+	+	+	+	-
Labelling mode	+	+	+	+	-	-
Statistics	+	+	+	+	+	+
Differential weighing	+	-	-	-	-	1
Min 2, Max 2 thresholds active	+	-	-	-	-	-
Peak hold	+	-	-	-	-	-
Information about saved measurement	+	+	+	-	-	+
Ingredient weight entered manually	+	+	+	-	-	-

Other special functions are related directly to a specific working mode, and they are described in further part of this user manual.

24.1. Working modes accessibility

Submenu < Accessibility> enables declaring presence of scale's working modes in the user menu after pressing a pictogram with a working mode located in the left corner of the top bar in the main window.

Procedure:

- Enter group of parameters < Working modes> in accordance with point 24 of the user manual,
- Select option < Accessibility> which opens a list with available working modes and their accessibility attribute.

Where:



- Working mode enabled
- Working mode disabled

 Set accessibility attribute for each of the working modes and return to weighing mode.

24.2. Save mode

Depending on setting parameter **Save Mode** users can send data from the scale to an external device.

Procedure:

- Enter parameters group < Working modes> according to ch. 24 of this manual,
- Enter the required mode and choose < Save Mode> then choose the required mode.

Accessible options:

Manual every stable	-	Manual printout of each stable weighing result for mass measurement over -LO- threshold
Manual first stable	-	Manual printout of the first stable weighing result for mass measurement over -LO- threshold
Automatic first stable	-	Automatic printout of the first stable weighing result for mass measurement over -LO- threshold
Automatic last stable	-	Automatic printout of the last stable weighing result for mass measurement below -LO- threshold
Semi-automatic every stable	-	Manual printout of each weighing result for mass measurement over -LO- threshold – awaiting for a stable result
Semi-automatic first stable	-	Manual printout of the first weighing for mass measurement over -LO- threshold — awaiting for a stable result

24.3. Down-weighing

Software allows to weigh in the "down-weighing" mode. It consist in putting the load on the pan and taking off/removing portions of it with concurrent saving weighments equal to the portions taken off the pan.

Procedure:

- Enter parameters group < Working Modes> according to ch. 24 of this manual,
- Enter the required working mode and choose < Down-weighing> and then set the required option.

Accessible options:



- Traditional weighing
- Down-weighing mode

24.4. Checkweighing

In case of enabling the checkweighing mode, printouts are performed only when a weighing is between **MIN** and **MAX** thresholds that have been defined before.

Procedure:

- Enter parameters group < Working Modes> according to ch. 24 of this manual,
- Enter the required working mode and choose < Checkweighing> then set the required option.

Options:



- Every weighing is recorded
- Only weighments between MIN, MAX are recorded.

24.5. Tare mode

This function enables users to set parameters for tarring.

Procedure:

Enter parameters group < Working Modes> according to ch. 24 of this manual.

Enter the required working mode and choose < Tare mode> and then set the required option.

Options:

Single - Basic tare mode. The set (chosen) tare value is overwritten

after entering a new value

Current sum - Summing up tare values of product and package together

with manually entered tare. After next setting of product or package tare the entered tare value is disabled

Total sum - Summing up all subsequently entered tare values

Autotare - Automatic tare mode together with mode <Sum of all>

Each

measurement - Automatic tarring for each accepted measurement result.

24.6. Labelling mode

Labelling mode can be initiated together with every working mode. The labelling system is intended to print labels for marking weighed goods e.g. a packing process. The program can print standard labels for single products, cumulative labels for sticking to bulk containers and cumulative labels for cumulative labels for sticking to the large transport containers holding bulk containers.

In submenu < Labelling mode> there are accessible following special functions:

Number of labels

No. of cumulative labels

No. of CC labels

C label automatic triggering

CC label automatic triggering

24.6.1. Setting of the number of labels to print

In the parameter **< Number of labels>** user defines the amount of labels. They are printed on the printer connected to the weight.

Procedure:

- Enter parameters group < Working Modes> according to ch. 24 of this manual,
- Enter the required working mode and choose: " Labelling mode /
 Number of labels" then the editing field <Number of labels> with the screen keyboard is opened,
- Choose the required number of labels and confirm by pressing

24.6.2. Setting of the number of cumulative labels to print

In the parameter **No. of cumulative labels>** define the amount of sum labels. They are printed on connected printer.

Procedure:

- Enter parameters group < Working Modes> according to ch. 24 of this manual,
- Enter the required working mode and choose: "Labelling mode /
 No. of cumulative labels", then the editing field
 No. of cumulative labels> with the screen keyboard is opened,
- Enter the required number of cumulative labels and confirm by pressing

24.6.3. Setting of the number of CC labels to print

In the parameter **No. of CC labels>** define the amount of total sum labels to print. They are printed on connected printer.

Procedure:

- Enter parameters group < Working Modes> according to ch. 24 of this manual,
- Enter the required working mode and choose: " Labelling mode /
 No. of CC labels", then the editing field <No. of CC labels> with the screen keyboard is opened,
- Enter the required number of cumulative labels and confirm by pressing

24.6.4. Automatic triggering of cumulative labels

Users have access to the function of automatic triggering of printing cumulative labels after setting parameters < Mode> and < Threshold>.

Procedure:

- Enter < Working modes> parameter group as described in chapter 24 of the manual,
- Enter the required working mode and choose: " Labelling mode /

 C label automatic triggering / Mode" and then set the required option:
 - None Cumulative label printout is initiated by pressing or **
 - Cumulative label printout is initiated by exceeding the value set in parameter < Threshold>. The value is treated as the total from single weighment,
 - Number Cumulative label printout is initiated by exceeding the value set in parameter < Threshold>. The value is treated as the number of single weighment.
- *) Manual printing of cumulative labels can be done in two ways depending on the button used:




Printing followed by zeroing label counter or the total mass



Printing without zeroing label counter or the total mass

By default setting button is accessible in the bottom part of the display but activating the button can be done in submenu:

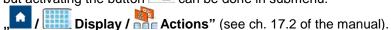


For automatic printout of cumulative labels counters and total mass variables are always zeroed.

- Confirm the changes by pressing and go to parameter
 Threshold> then <Threshold> window appears with the screen keyboard,
- Set the appropriate value for automatic triggering cumulative labels:
 - If parameter < Mode> is set to <Mass> then enter the required value of total mass to exceed in order to print the C label,
 - If parameter < Mode> is set to <Number> use the screen keyboard to enter the required counter value as a threshold to trigger off printing C labels.
- Confirm the changes introduced by pressing


24.6.5. Automatic triggering cumulative labels of cumulative labels

Users have access to the function of automatic triggering of printing cumulative labels of cumulative labels after setting parameters

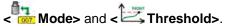

Procedure:

 Enter < Working modes> parameter group as described in chapter 24 of the manual,

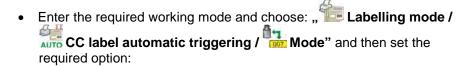


None - Cumulative label of cumulative labels printout is initiated by pressing or **

Cumulative label of cumulative labels printout is initiated by exceeding the value set in parameter < Threshold>.
 The value is treated as the total from single weighments,

Number - Cumulative label of cumulative labels printout is initiated by exceeding the value set in parameter < Threshold>. The value is treated as the number of single weighments,

*) Manual printing of cumulative labels can be done in two ways depending on the button used:

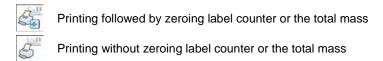

By default setting button is accessible in the bottom part of the display but activating the button can be done in submenu:

Display / Actions" (see ch. 17.2).

For automatic printout cumulative labels of cumulative (CC) labels counters and total mass variables are always zeroed.

- Confirm the changes by pressing and go to parameter
 Threshold> then <Threshold> window appears with the screen keyboard,
- Set the appropriate value for automatic triggering CC labels:
 - If parameter < Mode> is set to <Mass> then enter the required value of total mass to exceed in order to print the CC label,

- If parameter < Mode> is set to <Number> use the screen keyboard to enter the required counter value as a threshold to trigger off printing CC labels.
- Confirm the changes introduced by pressing

24.7. Statistics

All statistics are continuously updated after each measurement is saved in the scale memory. Statistics can be calculated globally (does not depend on the selected product) or separately for every product from the product database. It can be set in parameters **Statistics**.

Procedure:

- Enter < Working modes> parameter group as described in chapter 24 of the manual,
- Enter the required working mode and choose < Statistics> and then set the required option.

Options:

Global - global statistics,

Product - statistics for every product.

Caution:

In case of operation with **Statistics** set to **Product** bear in mind that after restarting only statistics of the last weighed product are recovered.

24.8. Differential weighing

Function < Differential weighing> enables analyzing mass changes of one or more samples. To do it start mass of a sample must be estimated, next the sample undergoes various processes during which some components of the sample are subtracted or added. Finally the sample is weighed again (differential weighing). The scales calculates the difference between two mass values (weighment I and weighment II).

24.8.1. Local settings

Local settings for < Differential weighing> function are to be accessed in submenu: Working modes / Weighing / Differential weighing:

A-B	Activation of differential weighing function (- function active, - function inactive)		
declared as measuring series batch value. Filter –		Value – differential weighing is realized according to declared as measuring series batch value. Filter – differential weighing is realized according to filter and	
code	Filtering Filtering		
	Charge	Measuring series value for differential weighing	

24.8.2. Reporting completed processes of differential weighing

Report is generated automatically upon completed differential weighing process.

Default value for differential weighing report template:

Caution:

The user can customize report template, to customize the template go to:



/ Differential weighments reports template" (read section 16.2.3 of this user manual).

Report on each completed differential weighing process is recorded in **Differential weighments>** database. File name features date and time of weighing operation performance. For list of data for differential weighing read section 35.5.8 of this user manual.

24.9. Peak hold

The scale enables measuring the maximum force influencing the weighing pan.

Procedure:

- Enter < Working modes> parameter group as described in chapter 24 of the manual,
- Enter the required working mode and choose < Peak hold> and then set the required option.

Where:



- Scale operates in standard weighing mode
- Scale operates with mode forcing lock of maximum indication on the display, i.e. peak hold.
- On loading the weighing pan with changeable force, the displays locks the indication of the maximum measured force. The locked value is signalled by red colour of the displayed value.
- Remove load from the weighing pan.
- Before carrying out the following measurement press button.

24.10. Information about saved measurement

The user can activate message informing on the fact that a particular weighing result has been recorded in a database, the message is displayed each time after performed measurement.

Procedure:

- Enter submenu < Working modes> according to ch. 24 of this manual,
- Enter "Weighing" mode and activate option: Information about saved measurement».
- Each time after completed measurement the message < Measurement saved> is displayed.

Caution:

The message is displayed as long as value of < Error information preview time> parameter specifies (read point 21.12 of this manual).

24.11. Packaging quantity query

The user can use packaging weight multiplier function. To do it parameter:

< 1 Ingredient weight entered manually must be activated.

Procedure:

- Enter submenu **Working modes>** according to ch. 24 of this manual
- Enter "Weighing" mode and activate option: < Ingredient weight entered manually»,
- Each time the user selects record of particular packaging stored within a database of packages, <Enter no. of packages> window with an on screen keyboard is displayed,
- Upon entering particular packaging quantity value, weight value equal
 to declared multiplied value of packaging is displayed along with *Net* and
 symbols.

25. WORKING MODE - WEIGHING

The **Weighing>** mode is the standard working mode allowing to perform weighments and saving them in the database **Weighings / Alibi>**.

25.1. Starting the working mode

The **Weighing>** mode is the standard working mode. If a user has changed the operating mode to another follow the actions below:

- While in the main window press the icon with mode name placed on the top bar on the left then submenu comprising all accessible working modes
 Working Modes> opens,
- Choose **Weighing>**, program automatically returns to the main window displaying icon in the top bar.

25.2. Local setting of a working mode

Local setting of a working mode < Weighing> are accessible on pressing a hot key < Local parameters>:

3	Save Mode	Detailed description in ch. 24.2 of the user manual
8	Down-weighing	Detailed description in ch. 24.3 of the user manual
8	Checkweighing	Detailed description in ch. 24.4 of the user manual
4 8 3	Tare mode	Detailed description in ch. 24.5 of the user manual
	Labelling mode	Detailed description in ch. 24.6 of the user manual
<u>ulllin</u>	Statistics	Detailed description in ch. 24.7 of the user manual
A-B	Differential weighing	Detailed description in ch. 24.8 of the user manual
MAX	Peak hold	Detailed description in ch. 24.9 of the user manual

	Information abort saved measurement	Detailed description in ch. 24.10 of the user manual
× ?	Ingredient weight entered manually	Detailed description in ch. 24.11 of the user manual

26. WORKING MODES - PARTS COUNTING

Parts counting is working mode allowing to count pieces on the basis of the standard unit mass of a single piece set on the scale or fetched from the database.

Caution:

If parts counting is performed in an additional container it should be tarred.

26.1. Starting the working mode

Procedure:

- While in the main window press in the top bar, then you will see a submenu <Working Modes> comprising a list of modes,
- Choose < Parts counting >, program automatically returns to the main window displaying icon in the top bar,
- Measuring unit is automatically changed to "pcs", special on-screen buttons are activated:

<u>**</u>	Counting pieces: Insert unit mass
<u>38</u>	Counting pieces: Estimate unit mass
<u>*0</u>	Counting pieces: Ascribe standard

26.2. Local settings of the working mode

Local settings of the working mode < Parts counting > are accessible on pressing a hot key < Local parameters >:

SMP	Automatic correction of reference mass	Detailed description in ch. 25.2.1 of the user manual
MIN	Minimum reference mass	Detailed description in ch. 25.2.2 of the user manual
3	Save Mode	Detailed description in ch. 24.2 of the user manual
8	Down-weighing	Detailed description in ch. 24.3 of the user manual
3	Checkweighing	Detailed description in ch. 24.4 of the user manual
4 8 3	Tare mode	Detailed description in ch. 24.5 of the user manual
	Labelling mode	Detailed description in ch. 24.6 of the user manual
<u>ulllin</u>	Statistics	Detailed description in ch. 24.7 of the user manual
	Information abort saved measurement	Detailed description in ch. 24.10 of the user manual
× ?	Ingredient weight entered manually	Detailed description in ch. 24.11 of the user manual

26.2.1. Automatic correction of reference mass

It concerns the < Parts counting> working mode

Working mode < Parts counting> comprises a special function < Automatic correction of reference mass>, that can be used for correcting the unit mass <SMP>. To enable the function in parameters you need to:

Enter parameter group < Working modes> according to ch.
 24 of this manual, choose: "Parts counting / Automatic correction of reference mass" and set appropriate option.

Options:



- Automatic correction of reference mass disabled
- Automatic correction of reference mass enabled

Function < Automatic correction of reference mass> in mode < Parts counting > is enabled at the moment of estimating the sample quantity and signalled by displaying <PCS> and <SMP> (single part/piece mass) on the top part of the display.

There are four criteria of working "Automatic correction of reference mass" function:

- 1. equilibrium should be reached,
- 2. quantity of parts/pieces should be increased,
- 3. added quantity of parts/pieces should not be greater than double number of parts/pieces on the pan,
- 4. the new sample can be different from the old sample by \pm 0.3 of pcs (absolute value),

If a user recognises that the sample quantity is adequate the unit mass (single piece mass) can be saved (see ch. 26.6 of this manual) and disable the function by pressing.

Caution:

While the parts counting function is active the functionality of button is changed. Pressing does not result in printing and saving weighments.

26.2.2. Minimum reference mass

It concerns the < Parts counting > working mode

Users before beginning the procedure of single piece mass evaluation can declare "minimum reference mass" i.e. minimum total weight of all pieces put on the scale pan expressed in reading divisions.

Procedure:

- Enter parameter group < Working modes> according to ch. 24 of this manual,
- Choose " Parts counting / Minimum reference mass" and then set an appropriate value.

Accessible settings: 1 d, 2 d, 5 d, 10 d.

Caution:

While the procedure of evaluation the mass of single piece the mass of all pieces put on the pan is lower than the value declared in parameter

" Minimum reference mass", the following warning message will be displayed: < Too low sample mass>.

26.3. Setting a reference unit by entering known piece mass

Procedure:

- Enter mode < Parts counting> according to ch. 26.1 of this manual,
- Press (enter piece mass), then an editing field is displayed **Reference Unit>** with the screen keyboard,
- Enter a value and confirm it by pressing _____, which causes starting < Parts counting > with automatic setting the reference unit.

Caution:

- In case of entering a reference unit higher than the maximum weighing range of the main scale the program will display a message box:
 Value too high>.
- 2. In case of entering the single piece mass lower than 0.1 d, the program will display a message box: **<Value to small>**.

26.4. Setting a reference unit by weighing a sample

Procedure:

- Enter mode < Parts counting > according to ch. 26.1 of this manual,
- If pieces are weighed in a container it needs to be put on the pan and tarred,
- Press (estimate piece mass), then the editing field is displayed
 Reference Quantity> together with the screen keyboard,

- Enter a value and confirm it by pressing _____, then the following message is displayed: <Put pieces: xx> (where xx the value entered before),
- Put the declared quantity of pieces on the pan and when the result is stable (symbol) confirm it by pressing.
- The program automatically calculates reference unit mass and causes starting < Parts counting >.

Caution:

- The total mass of all pieces put on the weight pan cannot be greater than the weighing range;
- The total mass of all pieces put on the weight pan cannot be less than the value declared in parameter "Minimum reference mass" (see section 26.2.2). If the condition above is not fulfilled the scale displays the message <Too low sample mass»;
- The mass of one unit may not be less than 0.1 of reading division
 of the scale. If this condition is not fulfilled the scale displays the message:
 <Too low piece mass>.

26.5. Setting the reference mass by entering single piece mass directly to the database

After selecting a product from the product database a mass of single piece from the field **<Mass>** is used.

Procedure:

Go to < Parts counting > mode and select particular product from < Products > list.

Caution:

The selected product has to have declared unit mass (single piece mass).

26.6. Entering the unit mass to the database

The unit mass can be described a unit mass the following way:

a) Estimate the unit mass (see 26.2 and 26.3),

- b) Hold your finger on a selected product from the **<Products>** list, context menu is displayed,
- c) Choose option **<Ascribe standard>**, then the standard unit mass is attributed to the product in the field **<Mass>**.

Caution:

Attributing a standard to a selected product is also possible by programmable button. Setting programmable buttons is described in ch. 17.2 of this manual The list of functions is described in **APPENDIX 02** of this manual.


27. WORKING MODES - PERCENT SETUP (DEVIATIONS)

The program allows to check weighments in deviations (in %) around an outlined standard mass. The standard mass can be outlined by weighing or entering it by a user.

27.1. Starting the operating mode

Procedure:

- While in the main window press in the top bar of the window then you will see a submenu **<Working Modes>** comprising a list of modes,
- Choose mode **Deviations**, the program will automatically returns to the main window displaying icon in the top bar.
- Measuring unit is automatically changed to ",%", special on-screen buttons are activated:

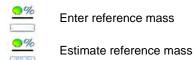

27.2. Local settings of the working mode

Local settings of the working mode < Deviations> are accessible on pressing a hot key < Local parameters>:

3	Save Mode	Detailed description in ch. 24.2 of the user manual
8	Down-weighing	Detailed description in ch. 24.3 of the user manual
8	Checkweighing	Detailed description in ch. 24.4 of the user manual
483	Tare mode	Detailed description in ch. 24.5 of the user manual
	Labelling mode	Detailed description in ch. 24.6 of the user manual
<u>alliin</u>	Statistics	Detailed description in ch. 24.7 of the user manual
	Information abort saved measurement	Detailed description in ch. 24.10 of the user manual
× ?	Ingredient weight entered manually	Detailed description in ch. 24.11 of the user manual

27.3. Reference unit mass estimated by weighment

Procedure:

- Enter < Deviations > according to ch. 27.1 of this manual,
- If the standard is to be weighed in a container, the container needs to be put on the pan and tarred,
- Press (Estimate standard mass), then a message is displayed:
 Put standard>.
- Put the load on the pan. After stabilization the result is taken as a standard (symbol \(\subseteq \). Confirm it by pressing
- At the same time the weight unit is changed to (w %).

27.4. Entering reference unit mass into the memory

Procedure:

- Enter < Deviations > according to ch. 27.1 of this manual,
- Press (Give piece mass), then an editing field is displayed
 Give piece mass> together with the screen keyboard,

- Enter a value and confirm by pressing
- At the same time the weight unit is changed to (w %).

28. WORKING MODES - DOSING

< Dosing> mode enables carrying out filling and dosing processes of goods on scales featuring an indicator PUE HY10 series. The working mode enables manual and automatic dosing on a single or simultaneously on many weighing platforms.

28.1. Starting the working mode

Procedure:

- While in main window of the software, press on-screen key, located in the top bar of the window, which opens submenu
 Working Modes> containing the list of available working modes,
- Select working mode < Dosing>, the software automatically returns to displaying the main window, and the top bar indicates the pictogram of a selected working mode ,
- Automatically the following on-screen key are enabled:



28.2. Dosing process structure

All activities related to the dosing process can be carried out from the level of scale. Each dosing process < 🍑 contains:

- Its name < ,
- code < 5,
- assigned weighing platforms < defined on an indicator.

Each of the weighing platforms can have its specific dosing process. The database of dosing processes has the same searching mechanisms for a specific record in a database as other indicator databases.

A dosing process can be searched in a database by:

- the name of a dosing process < N>
- the code of a dosing process <

Processes carried out on different weighing platforms operated by the same indicator, can also be dependent on each other, e.g.: dosing on weighing platform 2 can be initiated only on completing dosing on weighing platform 1, which is confirmed by a signal from appropriate sensor.

28.3. Local setting of a working mode

Local settings for the working mode < \(\bigsize \) Dosing> are accessible on pressing a hot key < \(\bigsize \) Local parameters>:

x.?	A	Ask for multiplier	Causes setting a question for dosing process multiplier, i.e. the number which is used to multiply the values of mass of all components.
♣ ?	A	Ask for number of cycles	Causes setting a question on number of dosing process cycles, i.e. number of repetitions of the same process.
\$ 1 <u>0</u>		Confirm batching ngredients manually	Causes enabling manual confirmation by pressing "Enter/Print" key on indicator's keyboard for each weighing process.
₹ →		No. of weighments for calculating the correction	Determines the number of recent measurements which are analyzed for calculating automatic correction in dosing

auto		Automatic cycle	Enables an already initiated process to be performed in a cyclic manner
	Global		Global settings of doisng process
	9	Batching outputs	Enables setting the outputs for dosing (fine dosing in case of two-step dosing process)
	•	Bulk batching output	Enables setting outputs for bulk dosing in case of two-step dosing process
	←≛ →	Correction	Enables determining global value of correction for all weighing platforms
	MAX	Maximum correctional value	Enables determining maximal value of correction, which can be automatically determined for all weighing platforms

< ** Global> settings are dedicated for the process of creating simple dosing processes, e.g.: dosing a single ingredient on all weighing platforms.

28.4. Description of functions and setting dosing process

While creating dosing process, the user has access to the following functions:

Icon	Short cut	Function	Description
DI	[DH]	Dose manually	Function recalling manual weighment of dosing process ingredient (manual dosing)
	₩)	Mass	Mass of an ingredient to be dosed
	min	Min	MIN threshold for dosing process ingredient
	max	Max	MAX threshold for dosing process ingredient
	*	Product	Dosing process ingredient uploaded from Products database
	**	Down-weighing	Enables switching on checkweiging mode (weighing on minus)
	[DA]	Automatic batching	Function enabling automatic weighment (automatic dosing). The function enables controlling outputs dedicated for dosing process.

	*	Mass	Mass of an ingredient to be dosed
	E-S	Mass for fast dosing	Mass of an ingredient for bulk dosing (in case of two-step dosing process)
	•	Product	Dosing process ingredient uploaded from Products database
	8	Down-weighing	Enables switching on checkweiging mode (weighing on minus)
•	Outputs		Function enabling setting the status of indicator's outputs for controlling peripheral devices plugged to those outputs. Accessible settings: None – output disabled; "0" – output with low status; "1" – output with high status.
0	[ודו]	Delay	Function determining interval between carrying out the following dosing process steps. The function determines pending time for the following step counted in seconds.
	0	Time	Determination of pending time counted in seconds
	~	Description	Text description of an interval displayed on indicator's touch panel
-0-	[Z]	Zero	Zeroing the weighing platform, equal to operation of the →0← function key on the indicator's front panel
-T-	[T]	Tare	Tarring the weighing platform, equal to operation of the →T← function key on the indicator's front panel
1	[ST]	Set Tare	Tare setting function, equal to operation of the <set tare=""> function key on the indicator's front panel</set>
	[CM]	Weight condition	Weight condition function determining time in which the following step of dosing process ona weighing platform should be carried out, e.g.: the following step is carried out if mass (net or gross) placed on the weighing platform is below the value set in threshold.
	PRINT	Threshold	Value of mass set in threshold for the condition
	*	Mass	Kind of determined mass for threshold (net or gross)
	8	Weight condition	Weight condition – ">=" or "<"

ó	[CI]	Input condition	Conditional function, determining when the followwing step should be carried out, depending on status of indicator's intput. Each input can take the following status: None — input disabled; "0" — input with low status; "1" — input with high status; "" — input with increasing tendency (status change from low to high, e.g.: the moment of pressing a key); "\" — input with decreasing tendency (status change from high to low, e.g.: the moment of releasing a key)
<u></u>	[EM]	Give mass	Function activating a so called: "mass in hand" – ingredient's mass of a dosing process supplied in ready packages with precisely determined mass. The given mass is added to weighed ingredient's mass, e.g.: ingredient to be weighed = 21,8 kg, weighed amount 1,8 kg placed on the scale, and 20 kg inserted manually.
-	[ET]	Give number of batching repetitions	Function determining quantity of batches of weighed ingredient, that is added to a dosing process. Mass of a single batch is determined in a product selected from the database (Products database – field Mass). Product's mass is multiplied by a specific value, and such determined mass is added to weighing process. The function is applicable for weighing products in batches.
1	[F]	Set flags	Function determining a condition (characteristic point) in dosing process. The function enables conditional carrying out another step in dosing process. Setting the characteristic point (signal flags) in connection with condition flags enables mutual conditioning of different processes on different weighing platforms.
2	[CF]	Flags condition	Conditional function determining criteria for events, which have to occur in order to carry out the following step in dosing process.
	[DG]	Gravitational dosing	Function activating operation of automatic weighment (automatic dosing), with option of dosed mass flow measurement.
	*	Mass	Mass of a component which is to be dosed-out
	\$ /o	Percent	Mass threshold, given as a percentage [%], automatic dosing is realized within this threshold
	•	Product	Dosing process component selected from product database
	3	Time correction	Time correction \pm of closing a valve during the dosing process, given as [ms]

Politi	Insensibility threshold	Permissible error ± of dosed-out mass, given as a percentage [%]
min/s	Minimal flow	Minimal flow value given as [g/s] or [kg/s] for an initiated algorithm of gravitational dosing
8	Weighing in minus	Allows for turning on weighing in minus mode

28.5. Creating a new dosing process

Creating a new dosing process is initiated by specifying its name and code, followed by determining processes on each of the weighing platforms.

Procedure:

- In order to create a dosing process, press < Add> key, and confirm creating a new record in dosing process database,
- Specify name < [□] > and code < [□] > by pressing corresponding hot keys, and inserting a name and a code using an on-screen keyboard,
- Select weighing platform on which the dosing process is created,
 e.g.: < Platform 1>.
- By pressing < Add> key design a sequence of the dosing process to be carried out on a weighing platform no. 1, and next select one of available process functions (see table in section 28.4).
- There is a possibility of modifying an already designed process –
 adding or deleting a single step in a process, e.g.: in order to add an
 element in a process, press and hold for 4 seconds an element before
 which a new step should be added. Drop-down menu with available
 options is displayed

Edit Add Delete Cancel

Press "Add" and define new element of the process.

28.6. Instances of dosing processes

28.6.1. Instance 1 – Manual dosing process of 4 ingredients on 2 weighing platforms

Description:

A dosing process contains 4 ingredients, which are weighed on two weighing platforms:

- · Weighing Platform 1: ingredients: Flour and Sugar
- Weighing Platform 2: ingredients: Seasoning and Water

Dosing process includes a condition, according to which before adding an ingredient "Water", all other ingredients have to be dosed. The condition is marked with signal flags, which determine dosing process between the weighing platforms, in a way which orders dosing Water ingredient as the last one. The whole process is described below in tables, separately for each weighing platform.

Dosing process name: Instance 1 **Dosing process code:** 1111

Dosing process from an indicator level:

Platform 1:

Icon	Step	Value	Description
0	1. [TI] Delay	[5s] Place empty container	Pending for loading an empty container for the first product
• ?	2. [CI] Input condition	Input 1 – "/"	Input 1 has to take increasing tendency – press function key confirming loading a container
-1-	3. [T] Tare	Tare	Tarring the weighing platform no. 1
SI	4. [DH] Dose manually	1 kg [Flour]	Manual weighing of product "Flour" to obtain 1 kg mass
0	5. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with weighed product from the weighing platform
• ?	6. [CI] Input condition	Input 4 – "/"	Input 4 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
-0-	7. [Z] Zero	Zero	Zeroing the weighing platform no. 1

0	8. [TI] Delay	[5s] Place empty container	Pending for loading an empty container for the second product
-0	9. [CI] Input condition	Input 1 – "/"	Input 1 has to take increasing tendency – press function key confirming loading a container
-1-	10. [T] Tare	Tare	Tarring the weighing platform no. 1
SI	11. [DH] Dose manually	0,2 kg [Sugar]	Manual weighing product "Sugar" to obtain 0,2 kg mass
0	12. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with weighed product from the weighing platform
-0	13. [CI] Input condition	Input 4 – "/"	Input 4 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
-0-	14. [Z] Zero	Zero	Zeroing the weighing platform no. 1
	15. [F] Set flags	Set signal flag 1	Setting the characteristic point of the process, which is a condition for carrying out part of the process on the second weighing platform
◆	16. [O] Outputs	Output 1 – "1"	Input 1 takes the high status ("1") – signal confirming carrying out the dosing process on the weighing platform no. 1 is lit up

Platform 2:

Icon	Step	Value	Description
0	1. [TI] Delay	[5s] Place empty container	Pending for loading an empty container for the third product (the first product on the 2 weighing platform)
-0 ?	2. [CI] Input condition	Input 9 – "/"	Input 9 has to take increasing tendency – press function key confirming loading a container
-1-	3. [T] Tare	Tare	Tarring the weighing platform no. 2
51	4. [DH] Dose manually	0,2 kg [Seasoning]	Manual weighing product "Seasoning" to obtain 0,2 kg mass
0	5. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with weighed product from the weighing platform
-0?	6. [CI] Input condition	Input 12 – "/"	Input 12 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
-0-	7. [Z] Zero	Zero	Zeroing the weighing platform no. 2

<u>i</u>	8. [CF] Flags condition	Signal flag 1 – "1"	Checking condition, whether signal flag 1 is set to value "1" – i.e. checking whether desired part of the process has been already realized on the weighing platform no. 1. If Yes, then dosing process on the second weighing platform shall continue.
•	9. [O] Outputs	Output 1 – "0", Output 12 – "1"	Output 1 is set to low status – the signal for completing dosing process on the weighing platform no. 1 is switched off; output 12 takes the high status – the main water valve is opened, for manual dosing of water ingredient.
DI	10. [DH] Dose manually	2 kg [Water]	Manual weighing product "Water" to obtain 2kg mass
*	11. [O] Outputs	Output 12 – "0"	Output 12 is set to low status – the main water valve is closed
0	12. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with weighed product from the weighing platform
-0?	13. [CI] Input condition	Input 12 – "/"	Input 12 can take increasing tendency – press function key confirming unloading a container from the weighing platform
•	14. [O] Outputs	Output 9 – "1"	Output 9 is set to high status ("1") – signal confirming carrying out the dosing process on the weighing platform no. 2 is lit up
0	15. [TI] Delay	[5s] Dosing process completed	Displaying a text message on the indicator confirming completion of dosing process.

Completing dosing process causes switching off all outputs of the indicator.

28.6.2. Instance 2 – Automatic dosing of 2 ingredients on 2 weighing platforms

Description:

The dosing process consists of 2 ingredients which will be weighed on 2 weighing platforms:

- Weighing Platform 1: ingredient Flour
- Weighing Platform 2: ingredient Water

The dosing process is carried out automatically, and includes a condition, that the dosing sequence is strictly determined – dosing of "Water" ingredient can be initiated only on completing the dosing process of ingredient "Flour".

The condition is marked with signal flags, which determine formulation making process between the weighing platforms, in a way which orders dosing Water ingredient as the second one. The whole process is described below in tables, separately for each weighing platform.

Dosing process code: Instance 2 **Dosing process code:** 2222

Dosing process from an indicator level:

Platform 1

Icon	Step	Value	Description
	[CM] Weight condition	Gross<0.1 kg	Condition checking, unless the weighing platform is loaded with a mass exceeding 100 g
-0-	2. [Z] Zero	Zero	Zeroing the weighing platform no. 1
0	3. [TI] Delay	[5s] Open valve Flour	Pending for opening main valve of the container with "Flour"
	4. [DA] Automatic batching	1,2 kg [Flour]	Automatic dosing of product "Flour" to obtain 1 kg mass in bulk dosing mode (bulk dosing and fine dosing valves are opened – Outputs 1 and 2), and 0,2 kg mass is dosed using fine dosing valve only –fine dosing valve is opened on Output 1 (for two-step dosing process)
0	5. [TI] Delay	[3s] Close valve "Flour"	Pending for closing the main valve of the container "Flour"
40	6. [O] Outputs	Output 11 – "1"	Output 11 takes high status ("1") – signal confirming carrying out the dosing making process on the weighing platform no. 1 is lit up
	7. [F] Set flags	Signal flag 1 – "1"	Setting the characteristic point of the process, which is a condition for carrying out part of the process on the second weighing platform

Dosing on the first weighing platform is carried out in two-steps, as for ingredient "Flour" the outputs are set for two-step dosing – see Products database.

Platform 2

Icon	Step	Value	Description
3 1	1. [CF] Flags condition	Signal flag 1 – "1"	Checking condition, whether signal flag 1 is set to value "1" – i.e. checking whether desired part of the process has been already realized on the weighing platform no. 1. If Yes, then dosing process on the weighing platform no. 2 shall start.
	2. [CM] Weight condition	Gross<0.1 kg	Condition checking, unless the weighing platform is loaded with a mass exceeding 100 g
-0-	3. [Z] Zero	Zero	Zeroing the weighing platform no. 2
0	4. [TI] Delay	[5s] Open valve Water	Pending for opening main valve of the container with "Water"
	5. [DA] Automatic batching	2,2 kg [Water]	Automatic dosing of ingredient "Water" to obtain 2,2 kg mass in single-step dosing mode – Output 6 controls the dosing valve
0	6. [TI] Delay	[5s] Close valve Water	Pending for closing the main valve of the container "Water"
•	7. [O] Outputs	Output 12 – "1"	Output 12 takes high status ("1") – signal confirming carrying out the dosing process on the weighing platform no. 2 is lit up
0	8. [TI] Delay	[5s] Dosing process completed	Displaying a text message on the indicator confirming completion of dosing process.

Additionally, in automatic dosing process, additional setting of dosing outputs for dosed ingredients have to be made – see Products database settings.

28.6.3. Instance 3 – Mixed dosing process

Description:

A dosing process contains 4 ingredients, which are weighed on two weighing platforms:

- Weighing Platform 1: ingredients Flour, Sugar and Seasoning,
- Weighing Platform 2: ingredients: Water

Dosing process is carried out manually and automatically, and it includes a condition that the dosing sequence is strictly determined – dosing of "Water" ingredient can be initiated only on completing the dosing process of ingredient "Flour" and "Sugar". Ingredient "Seasoning" will be added as the last one to the dosing process.

The condition is marked with signal flags, which determine formulation making process between the weighing platforms, in a way which orders dosing "Water" ingredient is dosed in an appropriate time. The whole process is described below in tables, separately for each weighing platform.

Dosing process code: Instance 3 **Dosing process code:** 3333

Dosing process from an indicator level:

Platform 1:

Icon	Step	Value	Description
0	1. [TI] Delay	[5s] Place container Flour on the weighing platform	Pending for loading container "Flour" on the weighing platform no. 1
-0	2. [CI] Input condition	Input 1 – "/"	Input 1 has to take increasing tendency – press function key confirming loading a container
-T-	3. [T] Tare	Tare	Tarring the weighing platform no. 1
51	4. [DH] Dose manually	1 kg [Flour]	Manual weighing product Flour to obtain 1 kg mass
0	5. [TI] Delay	[7s] Unload container with product	Pending for unloading the container with "Flour"
-0,	6. [CI] Input condition	Input 4 – "/"	Input 4 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
◆	7. [O] Outputs	Output 1 – "1"	Signal on completing dosing ingredient "Flour"
-0-	8. [Z] Zero	Zero	Zeroing the weighing platform no. 1
0	9. [TI] Delay	[5s] Place container Sugar on the weighing platform	Pending for loading container "Sugar" on the weighing platform no. 1
-0	10. [CI] Input condition	Input 1 – "/"	Confirm loading of container "Sugar"

-Ī-	11. [T] Tare	Tare	Tarring the weighing platform no. 1
51	12. [DH] Dose manually	0,4 kg [Sugar]	Manual weighing product Sugar to obtain 0,4 kg mass
0	13. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with "Sugar"
9.	14. [CI] Input condition	Input 4 – "/"	Input 4 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
◆	15. [O] Outputs	Output 2 – "1"	Signal on completing dosing ingredient "Sugar"
-0-	16. [Z] Zero	Zero	Zeroing the weighing platform no. 1
-0 ?	17. [CI] Input condition	Input 5 – "1"	Confirm pouring ingredients to a mixer
	18. [F] Set flags	Signal flag 1 – "1"	Setting the characteristic point of the process, which is a condition for carrying out part of the process on the weighing platform no. 2
◆	19. [O] Outputs	Output 5 – "1"	Lighting up a signalling device confirming pouring the ingredients to the mixer
2	20. [CF] Flags condition	Signal flag 1 – "1" Signal flag 2 – "1"	Pending for automatic dosing of water on the weighing platform no. 2
0	21. [TI] Delay	[5s] Place container Seasoning on the weighing platform	Pending for loading container "Seasoning" on the weighing platform no. 1
-0?	22. [CI] Input condition	Input 1 – "/"	Confirm loading of container "Seasoning"
-T-	23. [T] Tare	Tare	Tarring the weighing platform no. 1
SI	24. [DH] Dose manually	0,25 kg [Seasoning]	Manual weighing product Seasoning to obtain 0,25 kg mass
0	25. [TI] Delay	[5s] Unload container with product	Pending for unloading the container with "Seasoning"
-0.	26. [CI] Input condition	Input 4 – "/"	Input 4 has to take increasing tendency – press function key confirming unloading a container from the weighing platform
◆	27. [O] Outputs	Output 3 – "1"	Signal on completing dosing ingredient "Seasoning"
0	28. [TI] Delay	[10s] Dosing completed	Displaying a text message on the indicator confirming completion of dosing process

Platform 2:

Icon	Step	Value	Description
<u>></u>	1. [CF] Flags condition	Signal flag 1 – "1"	Checking condition, whether signal flag 1 is set to value "1" – i.e. checking whether desired part of the process has been already realized on the weighing platform no. 1. If Yes, then dosing process on the weighing platform no. 2 shall start.
-1-	2. [T] Tare	Tare	Tarring the weighing platform no. 2
0	3. [TI] Delay	[5s] Open valve Water	Pending for opening main valve of the container with "Water"
	4. [DA] Automatic batching	2 kg [Water]	Automatic dosing of ingredient "Water" to obtain 2 kg mass in single-step dosing mode – Output 6 controls the dosing valve (set for Water in Products database)
0	6. [TI] Delay	[5s] Close valve Water	Pending for closing the main valve of the container "Water"
◆	7. [O] Outputs	Output 12 – "1"	Output 12 takes high status ("1") – signal confirming carrying out the dosing process on the weighing platform no. 2 is lit up
	8. [F] Set flags	Signal flag 1 – "1" Signal flag 2 – "1"	Setting the characteristic point of the process, which is a condition for carrying out part of the process on the weighing platform no. 1
0	8. [TI] Delay	[10s] Dosing completed	Displaying a text message on the indicator confirming completion of dosing process

An instance of mixed dosing (manual and automatic) has been extended by signalling its corresponding phases to present the possibilities of the working mode **<Dosing>**.

28.7. Reporting of completed dosing processes

On completing each dosing process, the indicator automatically generates a report on that process.

Caution:

Submenu: ' Devices / Printer / Printouts / Dosing report printout template" enables optional modifying of the report template (see ch. 16.2.3 of this user manual).

Default form of the report template on dosing template:

```
Dosing process

{40:Start date:,-25}{180}

{40:End date:,-25}{181}

{40:Name:,-25}{175}

{40:Code:,-25}{176}

{40:Status:,-25}{182}

{40:Measurements:,-25}

{185:(50,-20) (7)(11)

(40:Nominal Mass:,-25)(186)(11)

(40:Difference:,-25)(187)(11)
```

The report from each completed process is simultaneously saved in the database of **Report from dosing>**, where the files are named by their date and hour of process execution and dosing process status. List of data for the dosing process – see ch. 35.5.2 of this user manual.

29. WORKING MODES - FORMULATION

Formulation> is a working mode designed for creating formulations of products on a scale.

29.1. Starting the working mode

Procedure:

- While in main window of the software, press on-screen key, located in the top bar of the window, which opens submenu < Working Modes> containing list of available working modes.
- Select working mode < Formulation >, the software automatically returns to displaying the main window, and the top bar indicates the icon of selected working mode
- Automatically the following on-screen keys are enabled:



Select formulation

Start formula making process

Stop formula making process

Select formulation ingredient from the list

Set "mass from hand" – mass of an ingredient supplied in ready packaged and with determined mass

29.2. Local setting of a working mode

Local settings for the working mode < Formulation > are accessible on pressing a hot key < Local parameters>:

×?	Ask for multiplier	Causes setting a question for formulation multiplier, i.e. the number which is used to multiply the values of mass of all formulation components.
\$?	Ask for number of cycles	Causes setting a question on number of formulation cycles, i.e. number of repetitions of the same formulation.
	Confirm batching ingredients manually	Causes enabling manual confirmation by pressing "Enter/Print" key on indicator's keyboard for each weighing process.
T)	Automatic tare	Enable automatic tarring of mass at the moment of process start and mass of each following ingredient after the sampling process.
	Ingredient control	Enable control mode of an ingredient being part of a formulation. The "Ingredient control" mode orders giving correct ingredient code before its weighing process.
	Portion weighing	Enable portion weighing mode of a formulation for a random number of portions (samples) until obtaining a target mass.
	Report printout	Enable automatic printout of a formulation report after completing the formula ma king process

29.3. Creating a new formulation

Procedure:

- Press key and select option < Databases> from main menu → then select < Formulation>,
- In order to create a formulation, press < Add> key, and confirm creating a new record in formulation database.

List of data specified for a new formulation:

N	Name	Formulation name
C	Code	Formulation code
	Ingredients	Defining formulation ingredients
1 2 3	Number of ingredients	Previewing number of ingredients in a formulation
*	Formulation mass	Previewing total mass of a formulation
ABC	Type of charge *	Type of a measuring series for a formulation
1 2 3	Charge	A measuring series of a formulation

*) – the charge type is definable as one of three values:

None Function disabled	
Global	Charge is carried out globally for the complete formulation
By ingredient	Charge is carried out sequentially for each ingredient

 After entering a selected weighing platform add the formulation ingredients one by one by pressing < Add> key.


List of data created for an ingredient of a formulation:

N	Name	Name of an ingredient in a formulation
G	Code	Code of an ingredient in a formulation
	Product	An ingredient of a formulation selected from the database of products
*	Mass	Mass of an ingredient
%	Deviation type	Declaring the deviation type: the measuring unit fo an active weighing platform or the value in [%]
- 20	Low deviation	Low deviation of an ingredient's mass
+ 20	High deviation	High deviation of an ingredient's mass
8	Dispensing	Enabling down-weighing (weighing to minus) mode
3	Platform	Assigning weighing platform number to an ingredient
8	Dispensing	Enabling down-weighing (weighing to minus)mode


1) – In case of selecting an ingredient from the database of products the software displays the following message:



2) – in case of declaring mass of an ingredient, and when the mass exceeds the maximum capacity of a weighing platform, the software displays the following message:

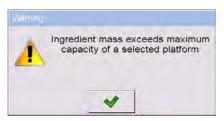

3) – in case of declaring the value of the low deviation as greater than the declared ingredient mass, the software displays the following message:

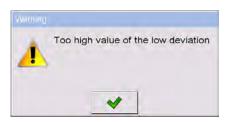

4) – in case the sum of ingredients mass and the value of high deviation are exceeding the maximum capacity of a weighing platform, the software displays the following message:



- On entering the required data press key which is equal to creating a new ingredient and adding it to the formulation composition.
- A created entry on the list comprises: the following number on the list, ingredient's name (selected from the database of products) and mass to be weighed.
- The software enables modifying an existing list of ingredients, i.e. adding
 or deleting an ingredient, e.g. in order to add an ingredient press and hold
 for about 4 seconds an entry on the list before which the ingredient should
 be added. The following menu with below content is displayed:

Edit Add Delete Cancel

- Press "Add" and define a new ingredient of a formulation.
- After specifying all ingredients of a formulation go back to the main window by pressing key.

29.4. Formula making process

Starting the formula making process requires that the authorization (access level) of the logged user is sufficient to start the process.

Caution:

- Starting the process requires that the logged user has access level at least of an **<operator>**. If the logged user or anonymous operator have access level set to **<none>** then on process start the software displays a message: **<Unauthorized access>**.
- 2. The Logging procedure is described in point 11 of this user manual, and the procedure of determining the access level for scale users is described in point 19 of this user manual.
- Press an on-screen button to select a required formulation.
- Enter to scale's memory general parameters on the working mode (in accordance with point 29.2of this user manual),
- After returning to the main window of the **Formulation**> mode press the on-screen function key (process start),
- If the ingredient control mode is enabled, then the scale software opens an
 editing window <Ingredient control> with a numeric keyboard and
 an editing field for entering a correct code of the weighed ingredient using
 a barcode scanner. Weighment of each following ingredient
 requires giving its corresponding code.

In case when:

 The inserted code of the current ingredient is incorrect, and the ingredient is in formulation composition, the software displays the following message: <Incorrect Ingredient Code. Ingredient already in formulation content. Go to this ingredient?>. Accept this message by pressing

key. The software goes to the weighing process of the ingredient. If key is pressed, the software returns to displaying the editing window **<Ingredient control** > featuring the numeric keyboard for entering the correct code of an ingredient.

- 2. The inserted code of the current ingredient is incorrect, and the ingredient is not in the formulation composition. The software displays a message: <No ingredient with specified code. Abort?>. On accepting the message by pressing key the software goes to another ingredient on the list. If key is pressed then the software returns to displaying the editing window <Ingredient control> featuring the numeric keyboard for entering the correct code of an ingredient.
- If the inserted code of the current ingredient is correct, then the software displays a message: <Correct Ingredient code> and goes to ingredient's weighing process.
- The workspace on the display indicates a bargraph denoting mass of a weighed ingredient of a formulation and the following information:

Process in progress: Test formulation

Ingredient: 1/3 [Ingredient 1]

Portion: 0 g / -500.0 g

Charge: 1 / 10 Completed: 0%

Where:

Process in progress:	Process status
Test formulation	Name of prepared formulation
Ingredient: 1/3	Number of weighed ingredient / Total number of ingredients in a formulation
[Ingredient 1]	Name of the weighed ingredient
Portion: 0 g	Current mass of the weighed ingredient
Portion: -500.0 g	Current deviation from the reference mass
Charge: 1 / 10	Number of weighed charge / Total number of charges
Completed: 0%	Process progress

Caution:

 If on process start the weighing platform is loaded, the software will indicate message <Load appropriate product> while trying to accept a measurement.

- If a user tries to accept the following weighed mass without changing
 mass of the load placed on the weighing platform, the software displays a
 message <Load appropriate product>,
- If a user tries to accept mass of a portion while the parameter <
 Portion weighing> is disabled then the software displays the following message <Load appropriate product>,
- If a user tries to accept an exceeded value of permissible ingredient mass, then the software displays the following message <Permissible value of ingredient mass exceeded. Recalculate ingredients?>. On rejecting the message by pressing key the software returns to the previous step. On accepting the message by pressing key the software automatically recalculates mass of the ingredients proportionally to the exceeded value of mass and returns to formulation making process.
- If a user tries to accept an unstable mass indication, the software displays a message <Measurements unstable>.

A user can abort the formula making process at optional moment by pressing an on-screen function key (process stop) located in the bottom bar of the indicator's display.

29.5. Reporting from completed formula making processes

On completing each formula making process, the indicator automatically generates a report on that process.

Caution:

Submenu: 'Devices / Printer / Printouts / Formulation report printout template" enables optional modifying of the report template (see ch. 16.2.3 of this user manual).

Default form of the report template on formula making process:

```
Formulation

{40:Start date:,-25}{240}
{40:End date:,-25}{241}
{40:Name:,-25}{220}
{40:Code:,-25}{221}
{40:Status:,-25}{242}
{40:Measurements:,-25}

{245:(50,-20) (7)(11)
(40:Nominal Mass:,-25)(246)(11)
(40:Difference:,-25)(247)(11)
}

{40:Mass:,-25}{244}
```

The report from each completed formula making process is simultaneously saved in the database of **Reports From Formulation>**, where the files are named by their date and hour of process execution and formulation status. List of data for the formula making process – see ch. 35.5.3 of this user manual.

30. WORKING MODE - PGC (CONTROL OF PREPACKED GOODS)

Working mode < PGC> enables carrying out a control of prepacked goods (single stand of network) that is supported by database containing list of products and operators. A control started from a scale is completed automatically after checking an appropriate quantity of packages (samples).

The scale allows for connecting it with a PC computer featuring computer software **E2R SYSTEM** and thus forming a multiposition (network) system. Each scale in the network system is an independent weighing stand, and data on the control process is sent to the computer software on the real time basis.

The computer software enables real time acquiring data from each connected scale. The system allows for starting a control process from the scale or from the level of computer software.

The acquired data allow for carrying out a quality control of manufactured packaged goods for:

- Compatibility with the Regulation by the Central Office of Measures of 3
 April 1997 on the requirements for a quality control of prepacked goods –
 by random selecting measurement results and sending them to the procedure of control of prepacked goods,
- Compatibility with an internal quality control system of an organization.


Caution:

Establishing a connection of a scale with the **E2R System**> is described in ch. 16.1.5 of this manual.


30.1. Starting the working mode

Procedure:

- While in main window of the software, press on-screen key, located in the top bar of the window, which opens submenu
 Working Modes> containing the list of available working modes,
- Select working mode < PGC>, the software switches to displaying the home screen of the enabled working mode:

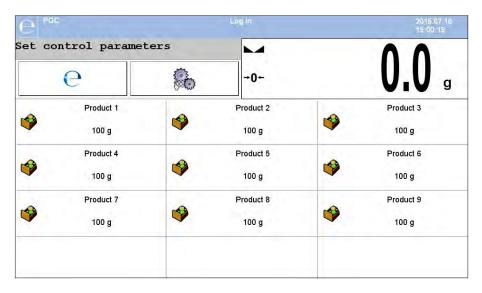

Where:

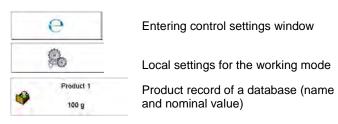


30.2. Control settings mode window

Caution:

Before entering the control settings mode carry out Logging procedure, as described in ch. 11.1 of this manual.

Press button located at the bottom of the **PGC>** mode home screen which opens control settings window:

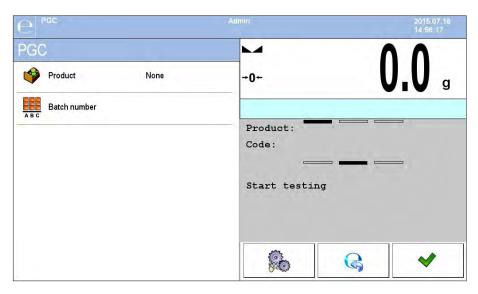

Where:



Selecting product from the database



Declaring number of the controlled batch



Working mode local settings



Returning to the working mode home screen



Control start

30.3. Local setting of a working mode

Local settings of the working mode < PGC> are accessible on pressing a hot-key < Local parameters> in the control settings window:

K	Gross weight on the display	Activation/deactivation of gross weight display on the home screen
3	Save mode	Detailed description in ch. 24.1 of the user manual
<u>e</u>	Number of accessible controls	Enabling simultaneous carrying out two control processes (see ch. 30.12 of the manual)
1288C	Ask for batch number	Function triggering providing batch number before the start of control
	Password required	Enabling the parameter requires Logging in to the scale before each entering the mode settings window
8	Saving notification window	Protection preventing record of unreliable results of controlled product measurement. Value expressed as deviation [%] form nominal weight of controlled product.
	Information about saved measurement	Detailed description in ch. 24.10 of the user manual

30.4. Editing a product to be controlled

A product is edited in submenu " / Databases".

Caution:

In case the scale cooperates with a computer software **E2R System>** editing the databases from the scale level is blocked. Editing and exporting product records to the scales is carried out from the level of computer software.

Procedure:

- Enter submenu " Databases",
- Enter database < Products > and press required product record.

List of data definable for a control:

Picto	gram	Data name	Description
N		Name	Product name
G		Code	Product code
*		Mass	Product nominal mass
483		Tare	Product tare value (set automatically on selecting a product from the database)
e		PGC	-
		PGC mode	Control type: Non-destructive Average Tare, Non-destructive Empty-Full, Destructive Full- Empty, Destructive Empty-Full
	1 2 3	Lot size	Declaring quantity of a controlled batch (Maximal value 999999)
		Charge	Measuring series to be controlled: Non- destructive Empty-Full, Destructive Full-Empty, Destructive Empty-Full
		Unit	Product's weighing unit: [g] or [ml]
		Density	Product density (range of entered values has to contain between 0,1g/cm³ and 5g/cm³)

		Quantity of packages	Declaring quantity of packages to be controlled for determining average tare (for control type "non-destructive average tare")
	♂ >	Cyclic displaying of average tare	Turning on / turning off an option of cyclic estimation of average tare for a product.
	<u>[5]</u>	Interval of average tare determination [h]	Value of time determining frequency of tare control during a process of product control. This means that estimation of average tare for a product will be carried out in accord with declared interval.
		Remind about measurement every [min]	Aktywacja komunikatu przypominającego o konieczności wykonania kolejnego pomiaru
•	St.	Internal control	Submenu for defining internal criteria of a control (see table below)

• List of data for internal criteria

Internal control	Enabling / disabling internal control criteria
Sample quantity	Quantity of a product sample
Error value [- T]	Value of negative permissible error –T, set in a weighing unit determined for the product. Measurements below the Qn-T value will be comprehended as defective.
Error value [+ T]	Value of positive permissible error +T set in a weighing unit determined for the product. Measurements above the Qn+T value will be comprehended as defective.
Quantity of disqualifying samples [Qn – 2T]	Number of recorded negative errors -2T in a tested sample that disqualifies a control
Quantity of disqualifying samples [Qn + 2T]	Number of recorded positive errors +2T in a tested sample that disqualifies a control
Quantity of disqualifying samples [Qn – T]	Number of recorded negative errors -T in a tested sample that disqualifies a control
Quantity of disqualifying samples [Qn + T]	Number of recorded positive errors +T in a tested sample that disqualifies a control
Average limit value	Mode for calculating the average limit value (constant or automatic)

Average limit value [-]	Average limit value (negative) for a tested sample (refers to average limit value as a "constant")
Average limit value [+]	Average limit value (positive) for a tested sample (refers to average limit value as a "constant")
Factor value [- Wk]	Standard deviation multiplier for the average limit value (negative) determined in the automatic mode
Factor value [+ Wk]	Standard deviation multiplier for the average limit value (positive) determined in the automatic mode

30.5. Control start procedure


To start testing:

 An operator needs to be logged on with the authorization access level high enough to perform testing.


Caution:

The Logging on procedure is described in ch. 11. The procedure of outlining the authorization level is described in ch. 19 of this manual.

- Select a product to be tested with correctly determined data for the control process,
- Enter to scale memory general parameters on control mode (in accordance with ch. 30.2 and 30.3 of the manual),
- Remove load from the <u>weighing</u> pan,
- Press function hot-key (control start) located in the bottom bar of the settings window, which opens an information window on entered data:

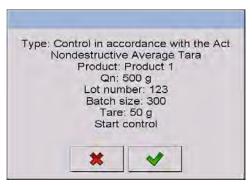

where:

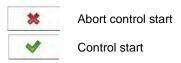

Caution:

If before control start the operator:

- Does not remove a load from the weighing pan or other criteria for zeroing are failed (e.g. unstable weighing result) the scale displays a message: <Unable to start control. Zeroing error>,
- Does not log in or the logged operator is not authorized to carry out the control, the scale displays a message: <No authorization >,
- Does not select a product from the database, the scale displays a message: <Product not selected >,
- Does not declare batch quantity, the scale displays a message:
 <Batch quantity not entered >.

30.6. Control aborting procedure

After control start an operator can abort the control process in an optional moment by pressing a function hot-key (control stop) located in the bottom bar of the control process window.

Pressing the (control stop) key is followed by displaying a message:



Pressing key causes reuniting to the control process in progress.


Pressing key causes terminating the control and returning to settings of the **PGC** mode.

Simultaneously, a control report with status **<Terminated>** is added to the database of **< Controls>**.

30.7. Logging out from a control process in progress

Procedure:

- While in control mode press pictogram with name of the logged operator located in the bottom bar of the display,
- The user is automatically logged out, <Insert Password> window with the name of previously logged operator is displayed,
- Enter correct password and press key to automatically return to the control process in progress,
- Pressing key causes returning to the home screen of the PGC mode:

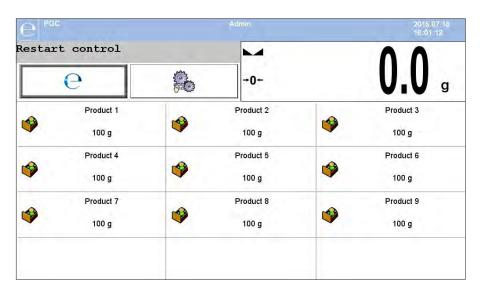

where:

Restart control




- information for an operator on a possibility to resume a control process in progress
- Control resuming button

- Pressing the button causes displaying a Logging in window <Insert Password> with the name of previously logged operator.
- After entering a correct password and accepting it by pressing key
 the scale automatically returns to the control process in progress.

30.8. Non-destructive average tare control mode

Before starting the control process the user can determine average tare by weighing packages. The option is enabled by activating a function **Average Tare Estimation>** in the **PGC** mode settings.

Tare control process is accompanied by below window:

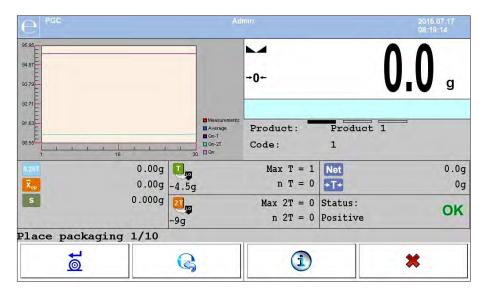


Where:

Product - Product name

Code - Product code

0,25T - 0,25T criterion value in [g]



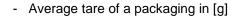



Standard deviation



Characteristics of negative errors T1 in a sample



- Characteristics of negative errors **2T1** in a sample



Net mass of the controlled package





- Packaging tare

Status

- Packaging control status

Place packaging

Command on control process with quantity of all packages to be weighed



Mass confirmation








Data on a control in progress

Control completion

Caution:

In order to carry out a product control using "non-destructive average tare" mode, in accordance with the regulation on standard deviation "S", the mass of packages is determined from at least 10 measurements, and the standard deviation cannot be greater than 0.25 of the maximum permissible negative error **T** for nominal mass of a package.


If an operator carries out the last measurement of the packaging mass, the software displays a summary of the process. Automatically, the system generates a report is saved in the scale database:

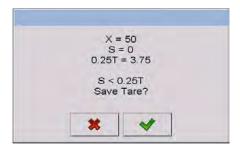

Pressing key causes moving to the control process without saving the determined average mass of a packaging in product record in the database.

Pressing key causes moving to the control process with simultaneous saving the determined average mass of a packaging in product record in the database.

During the control process in progress the software carries out real-time updating of measurement results and displays them in the corresponding fields for informing an operator on control result:

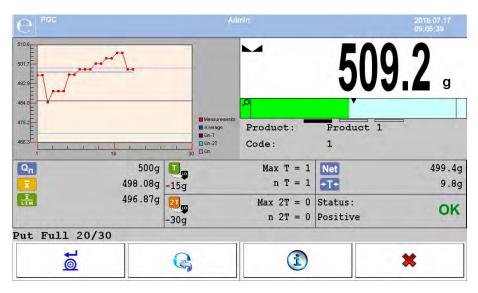

Where:


Product

Code

 Q_n






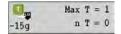

- Name of the controlled product
- Code of the controlled product
- Nominal value of the controlled product
- Average mass of the controlled product
- Value of the disqualifying average
- Characteristics of negative errors **T** in a sample:
 - -15g value of the negative error T

Max T – permissible number of the negative errors T n T – actual number of the negative errors T

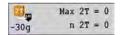

Characteristics of negative errors 2T in a sample:
 -30g - value of the negative error 2T
 Max 2T - permissible number of the negative errors 2T

n 2T - actual number of the negative errors 2T

Net

Net mass of the controlled product

Tare of the packaging

Status - Control status: positive, negative

Put full - Commands on control process with quantity of all measurements in a batch

Control status


Control status features a corresponding graphic interpretation:

OK - positive,

- negative (permitted to control sample 2)

- negative

In case of status marked with pictogram a corresponding workspace field changes its colour to yellow:

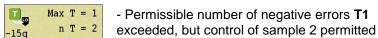


In case of status marked with pictogram 2 a corresponding workspace field changes its colour to red:



- Average mass of the controlled product below the value of the disqualifying average

Data on control process in progress

Pressing key displays data on a control process in progress:

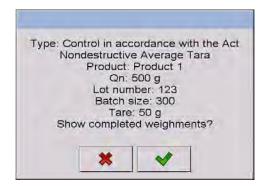

Pressing key causes returning to the control process in progress.

Pressing key causes moving to displaying a list of completed weighments:




In order to return to the control process in progress press key

Additionally, pressing the workspace area enables an operator to change its format (from a line chart to a bar chart):



After completing the control the scale generates a process summary, and the accomplished control is automatically saved in the scale database:

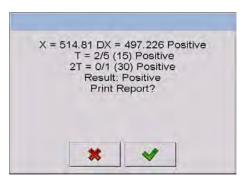


Pressing key causes printing a report on a printer connected to the scale.

Pressing key causes returning to settings window of the working mode PGC> without printing a report.

Caution:

In case the scale cooperates with the computer software < E2R System> the message on process summary does not contain a option for printing a report. The data on a control is automatically sent to the computer software with possibility of printing the report from the computer level.

If the test result is that the number of errors **T**, according to the regulations, requires expanding the sample. Operator is informed about it it the following message box:

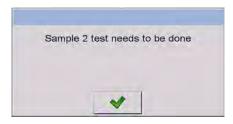


Press and then some descriptions and boundary criteria are changed. After the test has been completed the test is summarized and the results are automatically saved in the database and the report can be printed on an attached printer.

Caution:


A pattern and example of the report from testing products are described in ch. 30.14 of this manual. A pattern and example of the report from estimating average tare are described in ch. 30.13 of this manual.

30.9. Performing non-distructive testing in mode Empty-Full

For mode "Non-destructive Empty-Full" a user sets the measurement "charge" in the product data. According to the set "charge" a message is shown that informs about putting empty packages first and then the same packages after they have been filled up in the same sequence:

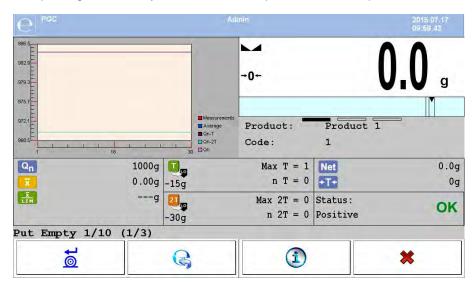

Where:

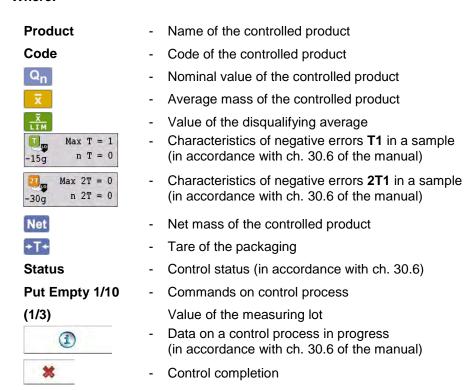

After the test has been completed the test is summarized (see ch. 30.8) and the results are automatically saved in the database.

Caution:

A pattern and example of the report from estimating average tare are described in ch. 30.14 of this manual.

30.10. Performing destructive testing in modes Empty-Full and Full-Empty

"Destructive" control process complying with the regulation, and independently on the batch size that exceeds 100 pcs., the size of a sample accepted by the software for control process is 20 pcs. Other control criteria are accepted as specified in the regulation.

After selecting from a list a product with set options for the destructive control with determined measuring "**lot**", and starting the control process, the software will display messages facilitating the control process (as in the case of control process described above).

Depending on the set control mode, the scale orders the following sequence of weighing products: "empty-full" or "full-empty".

Caution:

Remember to maintain the order for weighing products with packages and empty packages. It is important to the software that carries out mass calculations of products placed in a specific packaging.

After the test has been completed the test is summarized (see ch. 30.8) and the results are automatically saved in the database.

Caution:

A pattern and example of the report from estimating average tare are described in ch. 30.14 of this manual.

30.11. Control in accordance with internal criteria


Select a product with correctly determined parameters for carrying out the control in accordance with the internal criteria (see ch. 30.4 of this manual).

After entering to scale memory general parameters of the working mode (in accordance with ch. 30.2 and ch. 30.3 of this manual), start control process

by pressing key (control start) located in the bottom bar of the mode settings window. The scale automatically displays a window with data on set control parameters:



Accept the message box by pressing key which causes moving to the control process. During control process the software carries out real-time monitoring of the measurement results and displays them it the corresponding fields of the display for informing the operator on control result:

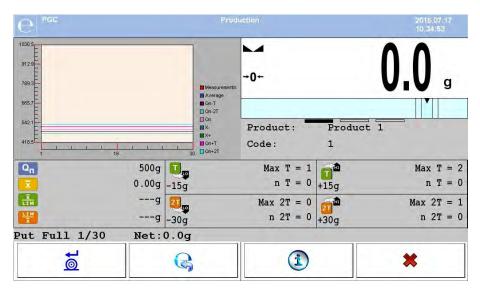

Where:


Product


Code






-30g

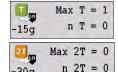

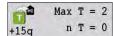


- Name of the controlled product
- Code of the controlled product
- Nominal value of the controlled product
- Average mass of the controlled product
- Value of the negative disqualifying average
- Value of the positive disqualifying average
- Characteristics of negative errors **T** in a sample (in accordance with ch. 30.6 of the manual)
- Characteristics of negative errors **2T** in a sample (in accordance with ch. 30.6 of the manual)
- Characteristics of positive errors **T** in a sample: +15g - value of the positive error T, **Max T** - permissible number of the positive errors **T**, **n T** - actual number of the positive errors **T**

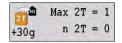

Characteristics of positive errors 2T in a sample:
 +30g - value of the positive error 2T,
 Max 2T - permissible number of the positive errors 2T,
 n 2T - acutal number of the positive errors 2T

Put Full 1/30 Net

Command on control processNet mass of the controlled product

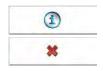

- Data on a control process in progress (in accordance with ch. 30.6 of the manual)
- Abort of control

After the test has been completed the test is summarized (see ch. 30.8) and the results are automatically saved in the database.

Caution:

A pattern and example of the report from estimating average tare are described in ch. 30.14 of this manual.

30.11.1. Abort of control - procedure

User may abort a control that is being carried out with internal criteria.

It may be done by pressing function key (abort control) in any chosen moment. This key is located in the bottom part of a process window. When the key is pressed the following message is displayed.



Pressing key means getting back to the control in progress. Pressing key means abort of the control. Abort of control results in getting back to **PGC** mode setting window.

A report on control will be saved to **Controls>** database, report's status - **Terminated>**.

30.11.2. Procedure of control completion

Completion of control realized in accordance with internal criteria may be carried out in two ways:

Automatically

All samples control – number of controlled samples accordant with declared value in **<Sample quantity>** parameter. On completion of the control a process summary is generated (see point 30.8 of this manual). The control is automatically saved to database.

Manually

Pressing beforehand defined key (finish the control). When the key is pressed the following message is displayed.



Pressing key means getting back to the control in progress.

Pressing key means finish of the control. Finish of control results in getting back to **PGC** mode setting window.

Caution:


Pattern and example of a report on control is described in point 30.14 of this manual.

30.12. Simultaneous carrying out two control processes

The scale enables carrying out two control processes at the same time. The option is enabled in:

- Go to local mode settings and set parameter < Number of accessible controls to value 2 (two controls),
- Change functions of the hot-keys for the following screens: home screen, settings and process screens. Enable hot-keys:
 - Set control 1> and <2 Set control 2> for the above screens.


Entering the "settings window" of a control causes displaying data on a control identifying number of the enabled control:

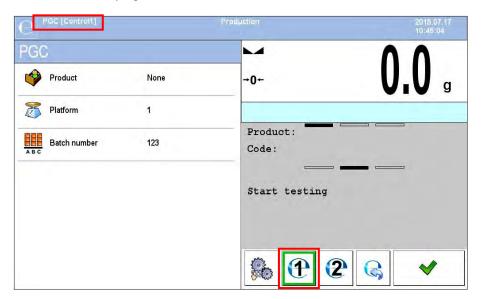

Caution:

With a multiplatform scale, an operator using the parameter < Platform> ma has the option of assigning platform number to the current control.

After entering required data on a control and starting the control process, the scale also displays data identifying the number of the enabled control:

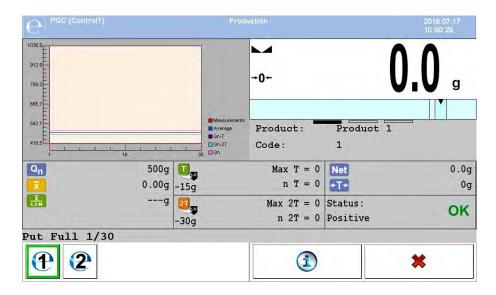

Processes:

- Control carrying out,
- Logging out during control in progress,
- Control termination,

are the same as in case of the above parts of the manual.

30.13. Report from estimating average tare

Report example:

Average Tare Report U/26/09/09/10/56/T

Balance Type: WPY KTP
Max: 1.5/3 kg
d=e: 0.5/1 g
Factory Number: 123589

Date: 2009.09.26 10:56:30

Product: AQUABA SAUCE Tare: 7.9 g

Value 0.25T1: 3.75 g Number of measurements: 10

```
Standard Deviation:
0.3162278

Test result: Positive

Weighments:
1. 8.5 g
2. 7.5 g
3. 8.0 g
4. 8.0 g
5. 8.0 g
6. 7.5 g
7. 7.5 g
8. 8.0 g
9. 8.0 g
10. 8.0 g
```

Report pattern:

In submenu < Printouts> users can edit the pattern of the average tare report (see ch. 16.2.3). The default pattern is shown below:

```
Average Tare Report {301}
{40:Balance type:,-20}{44}
{40:Max:,-20}{34}
{40:d=e:,-20}{33}
{40:Factory number:,-20}{32}
{40:Date:,-20}{295}
{40:Product:,-20}{50}
{40:Tare:,-20}{54} g
{40:Value 0.25T1:,-20}{298} g
{40:Number of measurements:,-20}{299}
{40:Standard deviation:,-20}
{297}
{40:Result:,0}{296}
{40:Measurements:,-20}
{300}
{143:0c}
```

30.14. Report from product testing

Report example:

PGC Report U/26/09/09/10/59

Balance Type: WPY KTP 1.5/3 kgMax: d=e: 0.5/1 g

Factory Number: 123589
Start date: 2009.09.26 10:55:28
End date: 2009.09.26 10:59:53
Operator: Jan Kowalski

Product: AQUABA SAUCE 123/09

Batch Number: Nominal Mass: 520 g Tare: 7.9 q T1 error border: 15 g 2T1 error border: 30 g Batch quantity: 100 Number of measurements: 30 Number of T1 errors: 0 Number of 2T1 errors: 0 Min: 518 g Max: 529.5 g Average: 519.9833 g Total: 15599.5 q

Limit of the average: 518.9138 g Standard Deviation: 2.159515

PGC mode:

Nondestructive Average Tare

Result: Positive

Measurements:

1. 518.0 g	16.	518.0	g
2. 520.5 g	17.	518.0	g
3. 529.5 g	18.	518.0	g
4. 520.0 g	19.	518.5	g
5. 521.0 g	20.	518.5	g
6. 518.0 g	21.	518.5	g
7. 519.0 g	22.	519.0	g
8. 519.0 g	23.	519.0	g
9. 519.0 g	24.	519.0	g
10. 521.0 g	25.	519.0	g
11. 521.0 g	26.	521.0	g
12. 521.0 g	27.	521.0	g
13. 521.0 g	28.	521.0	g
14. 520.0 g	29.	521.0	g
15. 521.0 g	30.	521.0	g

Report pattern:

In submenu < Printouts> users can edit the pattern of the average tare report (see ch. 16.2.3). The default pattern is shown below:

```
PGC Report {279}
{40:Balance type:,-20}{44}
{40:Max:,-20}{34}
{40:d=e:,-20}{33}
{40:Factory number:,-20}{32}
{40:Start date:,-20}{261}
{40:End date:,-20}{262}
{40:Operator:,-20}{75}
{40:Product:,-20}{50}
{40:Batch number:,-20}{260}
{40:Nominal Mass:,-20}{53}{278}
{40:Tare:,-20}{54}g
{40:T1 error border:,-20}{266}{278}
{40:2T1 error border:,-20}{267}{278}
{40:Batch quantity:,-20}{264}
{40:Number of measurements:,-20}{265}
{40:Number of T1 errors:,-20}{268}
{40:Number of 2T1 errors:,-20}{270}
{40:Min:,-20}{272}{278}
40:Max:,-20}{273}{278}
{40:Average:,-20}{274}{278}
{40:Total:,-20}{271}{278}
{40:Limit of the average:,-20}{275}{278}
{40:Standard deviation:,-20}{276}
{40:PGC mode:,-20}
{58}
{40:Result:,0}{263}
{40:Measurements:,-20}
{277}
      {143:0c}
```

31. WORKING MODES - DENSITY

Working mode < Density> enables determining density of solids, liquids and materials of high viscosity. The density is determined on basis of Archimedes principle, according to which any floating object displaces its own weight of fluid. The density mode also enables utilizing a pycnometer for determining density of liquids.

31.1. Starting the working mode

Procedure:

- While in main window of the software, press on-screen key, located in the top bar of the window, which opens submenu
 Working Modes> containing list of available working modes,
- Select working mode < Density>, the software automatically returns
 to displaying the main window, and the top bar indicates the icon of
 selected working mode,
- Simultaneously, the workspace of the display indicates a message: <Start estimating density>.

31.2. Local setting of a working mode

Local settings for the working mode < Density> are accessible on pressing a hot key < Local parameters>:

<u></u>	Standard liquid	Function dedicated for determining the standard liquid. There are three options: water, alcohol and other. If option "other" is selected, then its density should be specified. In case of the other two types of liquids, their density values are implemented in the software
	Temperature	Parameter of the standard liquid inserted by the scale user. Declared temperature of the standard liquid automatically determines its density based on a table of liquid densities. In case of the liquid type "Other", the temperature parameter is not applicable, the density value is inserted manually
	Standard liquid density	Parameter designed for manual determining the density of standard liquid in [g/cm³]
2 0 0	Sinker volume	Parameter implemented for manual determining the volume of a sinker expressed [cm³]

00285	Ask about sample number	Function ordering inserting number of a sample before initiating the test procedure
	Pycnometer mass	Parameter designed for manual determining mass of a pycnometer expressed in [g]. If inserted value is equal to "0" then on test procedure start, the pycnometer mass shall be measured.
2 2	Pycnometer density	Parameter intended for manual determining volume of the pycnometer expressed in [cm³]
(ct) (2) [lb] (3) [g)	Unit	Weighing unit set to read the measurement result. This weighing unit is used for presenting measurement result, data in reports, databases and summaries.
35	Save mode	Detailed description in ch. 24.2 of the user manual
***************************************	Checkweighing	Detailed description in ch. 24.4 of the user manual
483	Tare mode	Detailed description in ch. 24.5 of the user manual
<u>allilia</u>	Statistics	Detailed description in ch. 24.7 of the user manual

31.3. Carrying out density determination procedure

Working mode < Density > enables determining density in 4 different methods, depending on material which density should be measured.

Methods of density determination: Liquid, Solids, Pycnometer, Porous material.

31.3.1. Determining density of liquids

Density of liquid is determined by measuring mass of a sinker with determined volume. First, the sinker has to be weighed in the air, and then in liquid of which the density should be measured.

The difference between the two measurements is displacement weight, which is used by scale software to calculate the density of tested liquid. Before starting the measurement, the sinker's volume should be inserted to scale's memory. The sinker's volume is given on its hook.

Process course:

- Press < Local parameters> key to enter the setting of local parameters in density mode.
- Press < Sinker volume> in order to insert the volume of the sinker (given in [cm³]) which is immersed in the tested liquid.
- On specifying the parameters exit to main menu of the density mode by pressing key.
- In order to start density determination of liquid, press
 Determine liquid density> key, using a pre-defined hot keys on indicator's display.

Caution:

If in the local parameters, < 00285 **Ask about sample number>** function is enabled, then on initiating the process, the system asks for inserting the number of tested sample. The inserted sample number is linked to the process data and saved in the database.

- The first phase of the density determination of liquid is measurement of sinker's mass in the air. Place the sinker on the scale's weighing platform. On obtaining stable measurement result, accept it by pressing
- Next, place on scale's weighing platform tested liquid with immersed sinker. On obtaining stable measurement result, carry out the measuring process, and accept it by pressing key.
- On carrying out the second measurement, the scale determines
 density of tested liquid and indicates the result on indicator's display.
 If the user needs a report from the density determination process, it
 can be printed on a plugged printer by pressing key. The
 density determination process is then completed.
- A report from density determination of liquid is saved in < Density> database. The report is named by process date.

31.3.2. Determining density of solids

Density of solids is determined by weighing a solid object in two different medium: in the air and in auxiliary liquid with determined density. The difference between the two measurements is displacement weight, which is used by scale software to calculate the density of tested solid.

Before starting the measurement select < Local parameters> menu and choose < Standard liquid> to be utilized in the density determination process. Also determine the temperature of the auxiliary liquid. Declaring the temperature of the auxiliary liquid enables matching its density to a table of liquid densities. In case of selecting liquid type "Other", its density value should be specified in parameter < Standard liquid density>. Here, the < Temperature> parameter is specified only for information purpose of the report.

Process course:

- Press < Local parameters> key to enter the setting of local parameters in density mode.
- Press < Standard liquid> key to select the auxiliary liquid used for the density determination procedure. If the auxiliary liquid is other than "Water" or "Alcohol", then select "Other" from the available list.
- Press < Temperature> key and specify the temperature of the auxiliary liquid [°C]. Accept inserted value by pressing key.
- If "Other" liquid has been selected, then press < Standard liquid density > and insert the density value of the auxiliary liquid expressed in [g/cm³] for the specified temperature of the measurement.
- On specifying the parameters exit to main menu of the density mode by pressing key.
- In order to start density determination of a solid, press < Page 2015
 Determine solid density key, using a pre-defined hot keys on indicator's display.

If in the local parameters, < 00285 Ask about sample number> function is enabled, then on initiating the process, the system asks for inserting the number of tested sample. The inserted sample number is linked to the process data and saved in the database.

- The first phase of the density determination of solid, is measurement of the solid object in the air. Place the object on the scale's weighing platform. On obtaining stable measurement result, accept it by
 pressing
- Next, in the auxiliary liquid place scale's weighing platform with immersed tested solid object. On obtaining stable measurement result, carry out the measuring process, and accept it by pressing
 key,
- On carrying out the second measurement, the scale determines density of tested solid and indicates the result on indicator's display.
 If the user needs a report from the density determination process, it can be printed on a plugged printer by pressing key. The density determination process is then completed.
- A report from density determination of solids is saved in < Density> database. The report is named by process date.

31.3.3. Determining density of pycnometer

Pycnometer- it is a glass vessel which enables precise measurement of liquid mass at a precisely determined volume. A measurement method applying a pycnometer is one of the simplest means of determining density of liquids (densimetric method).

The key component of a pycnometer is a ground-in stopper with dumped capillary tube, which allows easy observation of the level of liquid contained in the vessel. Before the measurement process, the pycnometer is intentionally overfilled with tested liquid, then it is closed tightly with a stopper and thermally stabilized.

The excess of liquid pouring through the capillary tube is removed with an absorbent paper. Then, the vessel is immediately placed on a scale, and its mass is determined as quickly as possible. During the mass measurement, due to contraction of the volume of liquid its level usually decreases in the capillary tube, but this does not matter if at the time of placing instrument on the scale, it was completely filled and had correct temperature. Small diameter of the capillary tube prevents evaporation of

the liquid from the vessel, and therefore it does not affect the measurement result.

Before starting the density determination using a pycnometer, data on its volume and mass should be inserted to scale's memory. If pycnometer's mass is not specified in the local parameters, than the process starts with determining mass of an empty pycnometer.

Process course:

- Press < Local parameters> key to enter the setting of local parameters in density mode.
- Press < Pycnometer mass> key to insert the mass of a
 pycnometer used for determining density of tested liquid. Pycnometer's
 mass is expressed in grams [g]. Accept inserted
 value by pressing key.
- Press < Pycnometer volume> to specify the volume of the pycnometer used for determining density of tested liquid. The volume is expressed in grams [cm³]. Accept inserted value by pressing key.
- Press < Temperature> key and specify the temperature in which the test of liquid density determination is carried out. The temperature value is expressed in [°C]. Accept inserted value by pressing key. The temperature serves here for information purpose, and it is placed on reports from carried out processes.
- On specifying the parameters exit to main menu of the density mode by pressing key.
- In order to start density determination using a pycnometer, press
 Determine pycnometer density> key, using a pre-defined hot keys on indicator's display.

If in the local parameters, < 00285 **Ask about sample number>** function is enabled, then on initiating the process, the system asks for inserting the number of tested sample. The inserted sample number is linked to the process data and saved in the database.

- The first phase of density determination process is weighing a pycnometer (if its mass has been determined as "0" in the local parameters) place an empty pycnometer on scale's weighing platform. On obtaining stable measurement result, accept it by pressing key. If mass of a pycnometer has been determined in parameter < Pycnometer mass>, then this phase of the process is omitted.
- Then place on the scale's weighing platform a pycnometer filled with liquid. On obtaining stable measurement result, carry out the measuring process, and accept it by pressing key,
- On carrying out the measurement of the pycnometer with tested liquid, the scale determines the density of the liquid, and the density determination result is indicated on indicator's display. If the user needs a report from the density determination process, it can be printed on a plugged printer by pressing key. The density determination process is then completed,
- A report from density determination using a pycnometer is saved in < Density > database. The report is named by process date.

31.3.4. Determining density of a porous body

Determining density of a porous body is carried out in three phases:

- Weighing a porous body in the air,
- Weighing in the air of a porous body impregnated with oil,
- Weighing in auxiliary liquid of a porous body impregnated with oil.

In case of porous objects, it is necessary to carry out an oil bath, which fills and closes the pores of the material before its actual weighing in the auxiliary liquid.

Process course:

- Press < Local parameters> key to enter the setting of local parameters in density mode.
- Press < Standard liquid > key to select the auxiliary liquid used for the density determination procedure. If the auxiliary liquid is other than "Water" or "Alcohol", then select "Other" from the available list.
- Press < I Temperature> key and specify the temperature of the auxiliary liquid [°C]. Accept inserted value by pressing key.
- If "Other" liquid has been selected, then press < Standard liquid density> insert the density value of the auxiliary liquid expressed in [g/cm³] for the specified temperature of the measurement.
- On specifying the parameters exit to main menu of the density mode by pressing key.
- In order to start density determination of porous body, press < Determine porous body density > key, using a pre-defined hot keys on indicator's display.

Caution:

If in the local parameters, < goz Ask about sample number> function is enabled, then on initiating the process, the system asks for inserting the number of tested sample. The inserted sample number is linked to the process data and saved in the database.

- The first phase of the density determination of a porous body in the air.
 Place the object on the scale's weighing platform. On obtaining stable
 measurement result, accept it by pressing
- Then immerse the tested porous body in oil to fill its pores. Place
 the tested porous body impregnated with oil on scale's weighing
 platform. On obtaining stable measurement result, carry out the
 measuring process, and accept it by pressing
- In the third step, weight the tested porous object impregnated with
 oil in the auxiliary liquid. Place the tested object in the auxiliary liquid,
 on scale's weighing platform and immerse both in the auxiliary liquid.
 On obtaining stable measurement result, carry out the measuring
 process, and accept it by pressing key,

- On carrying out the third measurement, the scale automatically determines the density of the porous body, and indicates the result on indicator's display. If the user needs a report from the density determination process, it can be printed on a plugged printer by pressing key. The density determination process is then completed,
- A report from density determination of a porous body is saved in
 Density> database. The report is named by process date.

31.4. Reporting from completed density determination processes

On completing each density determination process, the scale's software automatically generates a report.

Caution:

Submenu: 'Devices / Printer / Printouts / Density printout template" enables optional configuration of report template (see ch. 16.2.3 of this user manual).

Default form of the report from density determination template:

```
Density

{40:Operator:,-25}{75}
{40:Start date:,-25}{155}
{40:End date:,-25}{156}
{40:Standard liquid:,-25}{158}
{40:Method:,-25}{157}
{40:Weighing 1:,-25}{165}
{40:Density:,-25}{162}{163}
```

The report from each completed density determination process is simultaneously saved in the database of **Density Reports**, where the files are named by their date and hour of process execution. List of data for the density determination process – see ch. 35.5.4 of this user manual.

31.5. Table of density parameter for water

T/°C	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9
10.	0.99973	0.99972	0.99971	0.99970	0.99969	0.99968	0.99967	0.99966	0.99965	0.99964
11.	0.99963	0.99962	0.99961	0.99960	0.99959	0.99958	0.99957	0.99956	0.99955	0.99954
12.	0.99953	0.99951	0.99950	0.99949	0.99948	0.99947	0.99946	0.99944	0.99943	0.99942
13.	0.99941	0.99939	0.99938	0.99937	0.99935	0.99934	0.99933	0.99931	0.99930	0.99929
14.	0.99927	0.99926	0.99924	0.99923	0.99922	0.99920	0.99919	0.99917	0.99916	0.99914
15.	0.99913	0.99911	0.99910	0.99908	0.99907	0.99905	0.99904	0.99902	0.99900	0.99899
16.	0.99897	0.99896	0.99894	0.99892	0.99891	0.99889	0.99887	0.99885	0.99884	0.99882
17.	0.99880	0.99879	0.99877	0.99875	0.99873	0.99871	0.99870	0.99868	0.99866	0.99864
18.	0.99862	0.99860	0.99859	0.99857	0.99855	0.99853	0.99851	0.99849	0.99847	0.99845
19.	0.99843	0.99841	0.99839	0.99837	0.99835	0.99833	0.99831	0.99829	0.99827	0.99825
20.	0.99823	0.99821	0.99819	0.99817	0.99815	0.99813	0.99811	0.99808	0.99806	0.99804
21.	0.99802	0.99800	0.99798	0.99795	0.99793	0.99791	0.99789	0.99786	0.99784	0.99782
22.	0.99780	0.99777	0.99775	0.99773	0.99771	0.99768	0.99766	0.99764	0.99761	0.99759
23.	0.99756	0.99754	0.99752	0.99749	0.99747	0.99744	0.99742	0.99740	0.99737	0.99735
24.	0.99732	0.99730	0.99727	0.99725	0.99722	0.99720	0.99717	0.99715	0.99712	0.99710
25.	0.99707	0.99704	0.99702	0.99699	0.99697	0.99694	0.99691	0.99689	0.99686	0.99684
26.	0.99681	0.99678	0.99676	0.99673	0.99670	0.99668	0.99665	0.99662	0.99659	0.99657
27.	0.99654	0.99651	0.99648	0.99646	0.99643	0.99640	0.99637	0.99634	0.99632	0.99629
28.	0.99626	0.99623	0.99620	0.99617	0.99614	0.99612	0.99609	0.99606	0.99603	0.99600
29.	0.99597	0.99594	0.99591	0.99588	0.99585	0.99582	0.99579	0.99576	0.99573	0.99570
30.	0.99567	0.99564	0.99561	0.99558	0.99555	0.99552	0.99549	0.99546	0.99543	0.99540

31.6. Table of density parameter for ethyl alcohol

T/°C	0.0	0.1	0.2	0.3	0.4	0.5	0.6	0.7	0.8	0.9
10.	0.79784	0.79775	0.79767	0.79758	0.79750	0.79741	0.79733	0.79725	0.79716	0.79708
11.	0.79699	0.79691	0.79682	0.79674	0.79665	0.79657	0.79648	0.79640	0.79631	0.79623
12.	0.79614	0.79606	0.79598	0.79589	0.79581	0.79572	0.79564	0.79555	0.79547	0.79538
13.	0.79530	0.79521	0.79513	0.79504	0.79496	0.79487	0.79479	0.79470	0.79462	0.79453
14.	0.79445	0.79436	0.79428	0.79419	0.79411	0.79402	0.79394	0.79385	0.79377	0.79368
15.	0.79360	0.79352	0.79343	0.79335	0.79326	0.79318	0.79309	0.79301	0.79292	0.79284
16.	0.79275	0.79267	0.79258	0.79250	0.79241	0.79232	0.79224	0.79215	0.79207	0.79198
17.	0.79190	0.79181	0.79173	0.79164	0.79156	0.79147	0.79139	0.79130	0.79122	0.79113
18.	0.79105	0.79096	0.79088	0.79079	0.79071	0.79062	0.79054	0.79045	0.79037	0.79028
19.	0.79020	0.79011	0.79002	0.78994	0.78985	0.78977	0.78968	0.78960	0.78951	0.78943
20.	0.78934	0.78926	0.78917	0.78909	0.78900	0.78892	0.78883	0.78874	0.78866	0.78857
21.	0.78849	0.78840	0.78832	0.78823	0.78815	0.78806	0.78797	0.78789	0.78780	0.78772
22.	0.78763	0.78755	0.78746	0.78738	0.78729	0.78720	0.78712	0.78703	0.78695	0.78686
23.	0.78678	0.78669	0.78660	0.78652	0.78643	0.78635	0.78626	0.78618	0.78609	0.78600
24.	0.78592	0.78583	0.78575	0.78566	0.78558	0.78549	0.78540	0.78532	0.78523	0.78515
25.	0.78506	0.78497	0.78489	0.78480	0.78472	0.78463	0.78454	0.78446	0.78437	0.78429
26.	0.78420	0.78411	0.78403	0.78394	0.78386	0.78377	0.78368	0.78360	0.78351	0.78343
27.	0.78334	0.78325	0.78317	0.78308	0.78299	0.78291	0.78282	0.78274	0.78265	0.78256
28.	0.78248	0.78239	0.78230	0.78222	0.78213	0.78205	0.78196	0.78187	0.78179	0.78170
29.	0.78161	0.78153	0.78144	0.78136	0.78127	0.78118	0.78110	0.78101	0.78092	0.78084
30.	0.78075	0.78066	0.78058	0.78049	0.78040	0.78032	0.78023	0.78014	0.78006	0.77997

32. WORKING MODES – ANIMAL WEIGHING

Working mode < Animal weighing> enables weighing objects which do not stabilize if placed on scale's weighing platform and while carrying out weighing process. Weighing process is achieved by implementing parameter of time for stability of measurement, which is set in global parameters of the working mode. This working mode is mainly utilized for weighing different kinds of animals. The mode may be controlled automatically or manually – i.e. the weighing process is triggered manually or automatically.

32.1. Starting the operating mode

Procedure:

- While in main window of the software, press on-screen key, located in the top bar of the window, which opens submenu <working Modes> containing list of available working modes,
- Select working mode < Animal weighing >, the software automatically returns to displaying the main window, and the top bar indicates the icon of selected working mode.
- Special on-screen button is activated automatically
 - Start animal weighing process

32.2. Local setting of a working mode

Local settings for the working mode < Animal weighing> are accessible on pressing a hot key < Local parameters>:

8	Checkweighing	Detailed description in ch. 24.4 of the user manual
483	Tare mode	Detailed description in ch. 24.5 of the user manual
	Labelling mode	Detailed description in ch. 24.6 of the user manual
<u>ullim</u>	Statistics	Detailed description in ch. 24.7 of the user manual

M	Averaging time	Declaration of process duration in seconds (from 1s to 90s) – measurements carried out in set time interval are used to calculate mean value, which is the result of the measurement
Colo	Automatic mode	Operation mode, in which the scale automatically begins the following measuring process, if the load placed on scale's weighing platform exceeds value of mass set in LO threshold.

32.3. Carrying out animals weighing procedure

- Enter the working mode < Animal weighing> according to ch. 32.1 of this user manual,
- Should the tested animal be weighed in a container, load the container of scale's weighing platform and tare its mass,
- On placing the tested animal on the scale's weighing platform (in the tarred container), press key (Process start), which displays a message box indicating course of the process,
- The message box contains data on:
 - o Progress bar indicated in %,
 - o Value of averaging time interval, set in local parameters,
 - key enabling aborting the process,
- On completing the measuring process, the value of measured result is locked in the message box,
- Confirm completing the process by pressing key.


33. WORKING MODE - VEHICLE SCALE

Working mode < Vehicle Scale> enables weighing trucks, determining mass of loads based on weighments carried out on entering and exiting a weighbridge.


33.1. Working mode activating procedure

• When in the main software window press pictogram located in the top bar of the display which opens a submenu **Working modes**> containing list of available working modes,

• Select working mode < Vehicle Scale>, the software automatically returns to the main window:

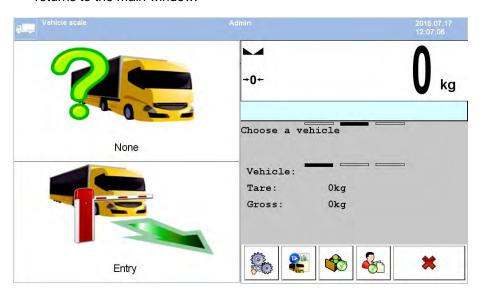

Where:

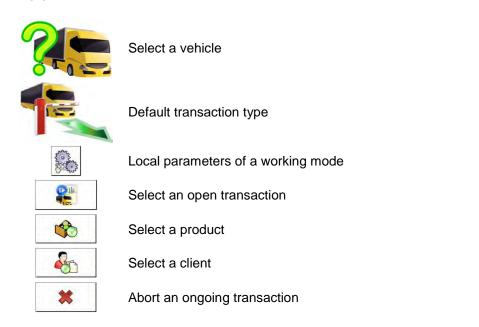

33.2. Working mode local settings

The local settings of working mode < Vehicle Scale> are accessed by pressing an hot-key < Local settings>:

∀ ←	Default transaction type	Selecting a default transaction type. Available settings: Entrance, Exit, Control weighment.
	Select vehicle	Declaring the means for selecting a vehicle. Available options: From list, From hand, By name, By code.
C.	Print report	Enabling automatic report printout on completing a vehicle transaction.

33.3. Vehicle transaction course

Starting a vehicle transaction, requires that a logged operator features appropriate access level for carrying out the transaction.

Caution:


In order to start a transaction, the access level of a logged user must be at least **<operator>**. IF the logged user or anonymous user feature access level **<none>** then on starting a transaction the software displays a message: **<No authorization>**.

An operator can carry out three types of transactions:

- Entrance,
- Exit,
- · Control weighment.

33.3.1. Entrance / Exit transaction

Changes of transaction type are carried out by pressing ** , where

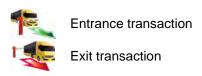


Procedures for carrying out an entrance transaction and an exit transaction are the same, therefore the further part of the user manual contains description of an entrance transaction only.

Before starting a transaction enter to scale memory general parameters of the working mode (see point 33.2 of this user manual).

Procedure:

 Press hot-key to select a required vehicle, which opens the following window:

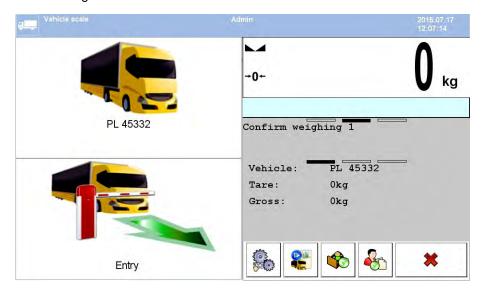

Where:



- A vehicle with saved registration number




- Transaction type (entrance)

Confirm weighing 1

 A message for an operator. The scale waits for accepting the weighment on entrance

- 1. Additionally, an operator can:
 - Assign a product to a transaction by pressing _____ button
 - Assign a client to a transaction by pressing button.
- 2. Before starting a transaction, first an operator should select a vehicle to be weighed. Otherwise the scale displays a message
 - < Vehicle not selected>.
- After the vehicle enters onto the weighbridge (entrance), and stabilizing
 of the measuring result, accept the measurement by pressing
 button,
 which opens the following window:

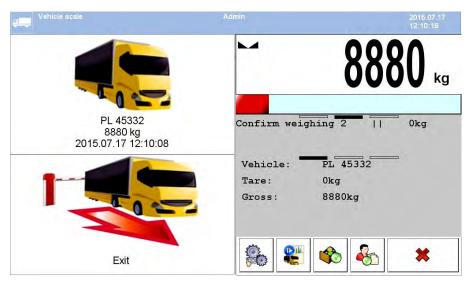

Where:



PL 45332 8880 kg 2015.07.17 12:10:08 A vehicle with saved registration number, accepted mass on entrance and time and date of entrance weighment



- Transaction type (exit)

Confirm weighing 2

- Message for an operator. The scale waits for accepting the exit weighment

0 kg


- Mass of the load

• At the same time, a printer connected to the scale prints an "Entrance ticket".

Caution:

A default format of an "Entrance ticket" template is described in point 33.5 of this user manual.

 After the same vehicle enters onto the weighbridge (entrance) and stabilizing of measurement result, accept the measurement by pressing button which opens a process summary window:

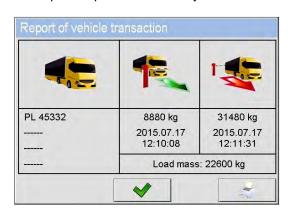

Caution:


The non-declared transaction items are represented by dashes, correspondingly denoting:

- Missing code assigned to a vehicle,
- Missing product assigned to a transaction,
- Missing client assigned to a transaction.
- At the same time, a printer connected to the scale prints a ticket "Exit ticket".

- In case of declaring an automatic printout of a report, on completing a vehicle transaction the scale orders printing a "Report from Vehicle Scale" together with the printout of the "Exit ticket".
- 2. A default format of the printout template of the "Exit ticket" and a "Report from Vehicle Scale" are described in point 33.5 of this user manual.
- After accepting the summary window of the "Report from Vehicle Transaction" the software automatically returns to the main window.

33.3.2. Control weighment transaction

Changes of transaction type are carried out by pressing ** where:

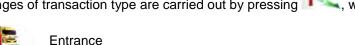




Control weighment

Before starting a transaction enter to scale memory general parameters of the working mode (see point 33.2 of this user manual).

Procedure:

 Press hot-key to select a required vehicle, which opens the following window:

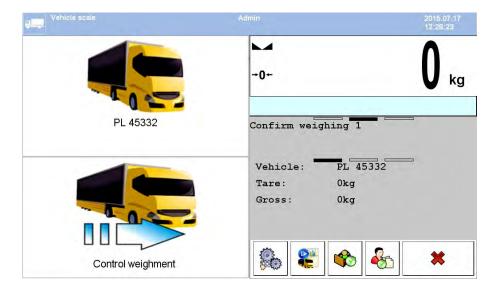

Where:



PL 45332

- A vehicle with saved registration number



- Transaction type (control weighment)

Confirm weighing 1

 A message for an operator. The scale waits for accepting the control weighment

Caution:

Additionally, an operator should determine:

- Assign a product to a transaction by pressing ______ button
- Assign a client to a transaction by pressing button,
- After the vehicle enters onto the weighbridge (control weighment) and stabilizing of the measuring result, accept the measurement by pressing button, which opens a window on process summary:



The non-declared transaction items are represented by dashes, correspondingly denoting:

- Missing code assigned to a vehicle,
- Missing product assigned to a transaction,
- · Missing client assigned to a transaction,
- Missing value of load mass.
- At the same time, a printer connected to the scale prints a ticket "Control weighment ticket".

Caution:

A default format of the printout template of the "Control weighment ticket" is described in point 33.5 of this user manual.

 After accepting the summary window of the "Report from Vehicle Transaction" the software automatically returns to the main window.

33.4. Open transactions table

A scale user is able to start an optional number of transactions at the same time. All opened (unfinished) transactions are temporarily saved in the "table of opened transactions". A list of opened transactions to be completed is

accessed by pressing a hot-key display.



located in the bottom bar of the scale

If a user attempts to choose a vehicle for which a transaction is already opened, then the software displays a message box:



33.5. Printout templates for an ongoing transaction

During ongoing vehicle transaction the user can print transaction tickets (reports) with the use of a printer connected to the scales.

List of standard printouts for "Vehicle scales" operating mode:

- Entrance Ticket Printout Template
- Exit Ticket Printout Template
- Control Weighment Ticket Printout Template
- Report from Vehicle Scale Printout Template:

Default content of printout templates:

Entrance Ticket Printout Template:	Entrance ticket
	{40:Date:,-20}{4} {40:Vehicle:,-20}{210} {40:Mass on entrance:,-20}{7}{11}
	Signature
Exit Ticket Printout	
Template:	Exit ticket
Template:	Exit ticket

Control Weighment Ticket Printout Template:	Control weighment ticket
	{40: Date:,-20}{4} {40: Vehicle:,-20}{210} {40: Mass:,-20}{7}{11}
	Signature
Report from Vehicle Scale Printout Template:	Report from Vehicle Scale
	{40:Start date:,-20}{213} {40:End date:,-20}{214} {40:Vehicle:,-20}{210} {40:Mass on entrance:,-20}{215}{11} {40:Mass on exit:,-20}{216}{11} {40:Mass of load:,-20}{217}{11}
	Signature

" Devices / Printer / Printouts" submenu user can freely modify printout standards (see point 16.2.3 of this manual).

33.6. Executed transactions - reporting

Each completed transaction is automatically saved and stored in the database of < Reports from Vehicle Scale>.

Each database record features the following data:

- Vehicle registration number,
- Transaction type (entrance, exit or control weighment),
- Transaction status (loading or unloading).

Additionally, the type and status of a transaction are marked by a corresponding colour:

Green	- Transaction completed successfully	
Yellow	- Transaction not completed	
Red	- Transaction aborted	

Detailed list of data for an executed vehicle transaction – see point 35.5.7 of this manual.

34. DATABASES

Scale databases hold different data:

Products

Operators

Clients

Nosing processes

Formulations

e Vehicles

Identification processes

Time Schedule PGC

Packages

Warehouses

Labels

Universal variables

Extra variables

lmages

In order to enter < Databases>, press and choose < Databases>.

34.1. Database configuration

Databases configuration> submenu enables the user to:

- Set databases availability
- Categorize product
- Declare data operation for databases: product, operators, clients, extra variables
- Change databases records preview
- Import databases from a memory stick to the scale
- · Export databases to a memory stick

Caution:

Configuration can be executed by a user with "Administrator" authority.

34.1.1. Databases accessibility

Databases accessibility> submenu allows to declare databases which are to be available for the user.

Procedure:

- Enter submenu: "Databases / databases configuration", according to ch. 34 of this manual,
- Choose < Databases accessibility> to view a list of available databases.

Where:



- Accessible database
- Inaccessible database

34.1.2. Categories

Categories> serves to divide product databases into folders (categories) in order to optimally group particular records.

To operate product categories Product categories parameter needs to be activated. The parameter is located in "Databases configuration categories" submenu.

How to create databases categories - procedure:

- Enter " Databases configuration/ Categories
 / Database of categories",
- Press button to see <Create new record?> message.
- Press button to confirm, the program will automatically edit the new position field.
- Edit the < Name > position and write a desired name of the category.

Procedure of assigning a product to a category

- Following point 34 of this manual enter < Databases>,
- Enter < Products> database and choose a demanded record,
- Chose < Category> position to open categories that have already been created.
- Choose a demanded position and exit in order to start weighment.

Caution:

Product that haven't been given a category are automatically located in a folder < Not assigned>.

34.1.3. Database variables operation

The user can turn on/off operation of database variables for:

- · Product database,
- Operators database,
- Clients database.

Procedure:

• Enter < Database configuration> submenu,

 Choose a demanded database to view a list of variables with accessibility attribute.

Where:



- Accessible variable
- Inaccessible variable
- Set accessibility of a demanded variable and exit in order to start weighment.

34.1.4. Change name of an extra variables database

The user can change a name of an extra variables chart (table) in the following cases:

- When using programmable buttons < Choose an extra variable>,
- When using < Choose an extra variable from database> function during an identification process.

Procedure:

- Enter submenu: " Databases configuration / Taxtra variables",
- Assign to a demanded variable the name of a database which will be shown when the above mentioned function is in use.

34.1.5. Change database records preview

Records preview> submenu allows to swap between two different views of the displayed records: "list" or "tiles".

Procedure:

- Enter submenu: " Databases configuration / Records preview",
- Change records view for a demanded database.

Where:



List



Tiles

34.1.6. Databases export / import

The user can export/import all databases with the use of a memory stick.

Database export procedure:

- Put a memory stick into USB port of a scale,
- Enter: "Database configuration / Export" submenu to start automatic database export from scales to a memory stick.
- After the procedure has been completed a following message is displayed "Operation completed successfully".

Database import procedure:

- Put a memory stick into USB port of a scale,
- Enter: " Database configuration / Import" submenu to start automatic database import from a memory stick.
- After the procedure has been completed a following message is displayed "Operation completed successfully".

34.2. Searching databases

Users can quickly search databases according to the following criteria:



🔟 Name



34.2.1. Quick name search

Procedure:

- Enter < Databases > according to ch. 34 of the manual,
- Enter < Products>,
- Press , then an editing field appears <Search by name> with the screen keyboard,
- Enter the name of a product or its part and press
- The program will automatically edit the required product.

34.2.2. Quick code search

Procedure:

- Enter < Databases > according to ch. 34 of the manual,
- Enter < Products>,
- Press , then an editing field appears <Search by code> with the screen keyboard,
- Enter the name of a product or its part and press
- The program will automatically edit the required product.

34.3. Adding new items in databases

- Enter < Databases> according to ch. 34 of this manual,
- Enter database < Products>,
- Press then the message is displayed: <Create new record?>,
- Confirm it by pressing _____, the program automatically enters edit window of a new record.

Caution:

Adding new records in databases is possible only by logged-in administrators.

34.4. Deleting items in databases

Procedure:

- Enter < Databases > according to ch. 34 of the manual,
- Enter < Products>.
- · Give a long press to the item, then the context menu is displayed,
- Press <Delete>, then a message is displayed:
 <Are you sure you want to delete?>,
- Confirm it by pressing

Caution:

Deleting records in databases is possible only by logged-in administrators.

34.5. Printing items from databases

Users can print any record in databases.

Procedure:

- Enter the submenu **Databases** according to ch. 34 of the manual,
- Enter < Products> and press the required item,
- After editing the required record press in the top bar of the display,
- If a printer is connected information about the selected product is printed.

Caution:

Default printout templates for printing records from different databases are described in ch. 16.2.3 of this manual.

34.6. Context menu

Context menu enables the user to a quick access to database functions. Pressing a demanded database element (submenu) for about 2 seconds is required in order to activate a context menu.

Context menu for each of the databases displays the following list of functions:

Open	
Import	
Export	
Delete all	
Cancel	

Where:

Open	Opening a content of a folder	
Import	Import of a database from a memory stick to a scale	
Export	Export of a database to a memory stick	
Delete all	Deleting all records of a particular database	
Cancel	Cancelling (turning off) the context menu	

The following list of functions will be displayed after activation of a context menu for one of a given database records:

Edit	
Delete	
Print	
Сору	
Cancel	

Where:

Edit	Edit record
Delete	Delete record
Print	Printout of information about a record
Сору	Make a record copy
Cancel	Cancel (turn off) the context menu

34.7. Database edit window

The database edition can be performed by an administrator.

34.7.1. Operators' database

Procedure:

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Operators > and press the required position.

Record of operator:

N		Name	Operator name
C		Code	Operator code
		Password	Password to log on (max. 16 characters)
AS		Access level	Authorization access level
1,2n RFID		Card number	Transponder card reader for Logging on
9		Working modes	Assigning a working mode to an operator
	auto	Automatically	Automatic mode: Logging out a user automatically enables a working mode recently enabled by this user
	⊕	Change working mode	Permanent assigning a specific working mode to a logged operator. Setting "None" disables the function.
		Identification process	Assigning an identification process to a logging operator

34.7.2. Database of products

- Enter < Databases> according to ch. 34 of this manual,
- Enter < Products>and press the required position.

Product record:

N	Name	Product name
C	Code	Product code
	EAN code	Product barcode
8	Mass 1)	Nominal product mass
F→S	Mass for fast dosing	Mass of an ingredient for bulk dosing (in case of two-step dosing process)
1	Batching outputs ²⁾	Declaring numbers of outputs for fine dosing
*	Bulk batching output 2)	Declaring numbers of outputs for bulk dosing
+∎→	Correction 1 2)	Value of dosing correction for weighing platform no. 1
+-■→	Correction 2 2)	Value of dosing correction for weighing platform no. 2
+-■→	Correction 3 ²⁾	Value of dosing correction for weighing platform no. 3
	Correction 4 ²⁾	Value of dosing correction for weighing platform no. 4
MAX	Maximum correction value ²⁾	Maximal value of dosing correction
min	Min ³⁾	Minimum mass for checkweighing
max	Max ³⁾	Maximum mass for checkweighing
%	Deviation type 4)	Declaring deviation type: measuring unit of a value in [%]
- 20	Low deviation 4)	Low deviation from mass (mass of an ingredient in a formulation)
+ 20	High deviation 4)	High deviation from mass (mass of an ingredient in a formulation)
483	Tare	Tare value (it is preset automatically after selecting a product)
	Price	Unit price
£\$€	Currency	Currency assigned to a product price

e	PGC mode ⁵⁾	Submenu with data declared in the working mode PGC (see ch. 30.4 of the manual)
[5]	Number of validity dates	Number of days to calculate expiry date
£5]	Additional days of expiry period	Offset of number of days of assortment expiry date
15	Date	Constant product date
VAT	VAT	Value Added Tax in [%]
	Ingredients	Dialogue box for entering ingredients
C	Label	Basic label template attributed to a product
G	C Label	Cumulative label template attributed to a product
Z XX	CC Label	Cumulative of cumulative label template attributed to a product
	Category	Category assigned to a product
2	Image	Graphic (image) assigned to a product
	Identification process	Identification process assigned to a product

- 1) Variable name dependant on an enabled working mode. In case of working modes: Weighing, Dosing, Formulation, Density, Animal weighing the variable takes the name: "Mass". In case of the working mode "Parts counting" the variable takes the name: "Part mass". In case of the working mode "Percent setup (Deviations)" the variable takes the name "Standard mass".
- 2) The variables accessible only in the working mode "Dosing".
- 3) The variable inaccessible for a product in the working mode "Formulation".
- 4) The variables accessible for a product only in the working mode "Formulation".
- 5) The variables accessible for a product only in the working mode "PGC".

34.7.3. Database of clients

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Client> and press the required position.

Client records:

N	Name	Client's name
C	Code	Client's code
VAT	Tax ID	Client's tax ID
	Address	Client's address
-	Postal code	Client's postal code
4	City	Client's Town/City
95€	Discount	Client's discount
6	Label	Client's label template

34.7.4. Database of dosing processes

Procedure:

- Enter < Databases> according to ch. 34 of this manual,
- Enter < A Dosing processes> and press the required position.

List of data for a selected dosing process:

N	Name	Dosing process name
G	Code	Dosing process code
3	Platform 1	Weighing platform no. 1 determined for a specific indicator
3	Platform 2 *	Weighing platform no. 2 determined for a specific indicator
3	Platform 3 *	Weighing platform no. 3 determined for a specific indicator
8	Platform 4 *	Weighing platform no. 4 determined for a specific indicator

^{*) –} number of weighing platforms depends on determined data in the indicator settings

34.7.5. Database of formulations

Procedure:

• Enter < Databases> according to ch. 34 of this manual,

• Enter < Formulations> and press the required position.

List of data for a specific formulations:

N	Name	Formulation name
G	Code	Formulation code
13	Ingredients	Defining ingredients of a formulation
123	Number of ingredients	Previewing number of created ingredients in a formulation
*	Formulation mass	Previewing total mass of a formulation
ABC	Type of charge	Type of measuring charge of a formulation
1 2 3	Charge	Measuring portion of a formulation

34.7.6. PGC time schedules database

Procedure:

• Enter < Databases> according to ch. 34 of this manual,

• Enter Time Schedules PGC> and press the required position.

List of data for selected PGC schedule:

	Product	Assigning product to PGC schedule
1 2 3	Batch size	Specifying controlled batch quantity for PGC schedule
15	Date	Specifying PGC schedule start date

15	Cyclic control	Activating cyclic control
15	Interval [min]	Specifying time interval in [min] for cyclic control

34.7.7. Database of vehicles

Procedure:

Enter < Databases > according to ch. 34 of this manual,

• Enter < Vehicles> and press the required position.

List of data definable for a vehicle:

N	Name *	Name of a vehicle (registration number)
C	Code	Vehicle code
483	Tare	Vehicle tare value (set automatically when selecting a vehicle record from the database)
1,2n RFID	Card no.	Transponder card number for selecting a vehicle
	Description	Additional vehicle description

*) – When declaring means of selecting a vehicle "From hand", entering a new registration number causes automatic adding a new vehicle record to the database with a name corresponding to the registration number.

34.7.8. Identification processes database

Procedure:

• Enter < Databases > according to ch. 34 of this manual,

• Enter < Identification processes> and press the required position.

List of data for a selected identification process:

N	Name	Identification process name
G	Code	Identification process code
auto	Repeat the process	Enables an already initiated identification process to be performed in a cyclic manner
	Process creator	Submenu used for defining (creating) an identification process

34.7.9. Database of packages

Procedure:

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Packages> and press the required position.

Package record:

N	Name	Package name
C	Code	Package code
4	Mass	Package weight (set automatically after choosing after choosing a package from the database)

34.7.10. Database of warehouses

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Warehouses> and press the required position.

Warehouse record:

N	Name	Warehouse name
C	Code	Warehouse code
	Description	Additional warehouse description

34.7.11. Database of labels

The database comprises templates of labels which users can attribute to products or clients to operate in labelling mode.

Procedure of editing databases:

- Enter < Databases> according to ch. 34 of this manual,
- Enter < Labels> and press the required position.

Label record:

N	Name	Label name
C	Code	Label code
	Label template*	Label printout template
8	Printer 1	Printer 1 printout declaration (default setting)
	Printer 2	Printer 2 printout declaration
8	Printer 3	Printer 3 printout declaration

*) Ways of designing and sending templates to a scale can be found in **APPENDIX 03** of this manual.

34.7.12. Database of universal variables

The database includes templates of general purpose variables which user can attribute to screen function buttons 2, 2, 3, in order to enter any alphanumeric text intended to be printed.

Additionally values of three first universal variables \$\sim_1\$, \$\sim_2\$, \$\sim_3\$ are stored in scales storage. If edited they will be saved in a record of an executed weighment.

Caution:

The procedure of attributing functions to buttons is described in ch. 17.2 of this manual.

Procedure of editing databases:

- Enter < Databases> according to ch. 34 of this manual,
- Enter < universal variables> and press the required position.

Universal variable record:

G	Code	Universal variable code
N	Name	Universal variable name, used for printout and/or for a weighment record
	Value Universal variable value used for printout and/or for a weighment record	

34.7.13. Extra variables database

The database includes templates of extra variables which user can attribute to screen function buttons 1, 2, 3, 4, 5 in order to enter any alphanumeric text intended to be printed.

Caution:

Procedure of defining screen function buttons is described in point 17.2 of this manual.

34.7.14. Images database

The database contains graphics that can be assigned to particular records of < Products> database.

Creating a new record - procedure:

- Put a memory stick into USB port of a scale,
- Press button to see < Create new record? > message,
- Press button to confirm, the program will automatically edit the new position.
- Enter < Name > field and give a demanded name to a graphic.
- Select < Image> option to open the main folder of a memory stick,

Choose the demanded graphic file. The program will automatically return to the previous submenu. The chosen graphic and name will be displayed in a

< 1 Image > field


Caution:

Maintained file formats are *.jpg, *.png, with the optimal (max.) resolution of 150x150 pixels, where:

- for a list record view an optimal resolution is 57x57 pixels;
- for a tile record view an optimal resolution is 133x133 pixels;

35. REPORTS

Software enables the following reports:

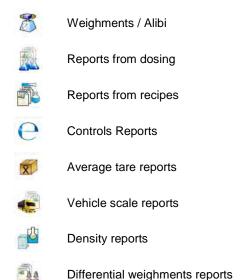

To enter < Reports> menu press button, which is located in the window of the indicator, and choose < Reports> option.

35.1. Reports configuration

Submenu < Report configuration> allows for:

- · declaration of reports, which are to be accessible for the user,
- configuration of lot number and batch number,
- activating option < Ask for number of weighings to be deleted>.

35.1.1. Reports accessibility

Submenu < Reports accessibility> allows for declaration of reports that are to be accessible for the user.

Procedure:

- Enter submenu < Reports> according to ch. 35 of this manual,
- Select < Reports accessibility> to view a list of reports with the accessibility attribute.

Where:



- Accessible reportInaccessible report

35.1.2. Configuration of a lot number

Procedure:

- Enter submenu: " Reports / Reports configuration" according to ch. 35 of this manual.
- Select < 00285 Lot number> and carry out the configuration.

List of data definable for a lot number:

N	Name	Change of the lot number name
G	Template	Lot number template, allows using variables that are intended for a printout

35.1.3. Configuration of a batch number

- Enter submenu: " Reports / Reports configuration" according to ch. 35 of this manual,
- Select < 2880 Batch number> and carry out the configuration.

List of data definable for a batch number:

N	Name	Change of the batch number name
G		Batch number template, allows using variables that are intended for a printout

35.1.4. Query for number of weighings to be deleted

The user with Administrator permissions level can delete (undo) recently performed weighings using programmable button: < Undo weighing>.

Reports configuration> submenu additionally allows to declare how many weighings are to be deleted. In order to specify number of weighings that are to be subjected to deletion process it is necessary to activate option:

Ask for number of weighings to be deleted>.

Procedure:

- Enter submenu: "
 "
 Reports / Reports configuration" according to ch. 35 of this manual,
- Activate option < Ask for number of weighings to be deleted>,
- Upon returning to home screen and pressing programmable button
 Undo weighing>, message: <Number of weighings to be deleted> with a numeric keyboard is displayed.
- Enter appropriate value (from 1 to 10) and press button for confirmation, message: <Number of deleted weighings: x> is displayed, where x number of deleted weighings.

Caution:

When:

 Some of the weighings that are to be deleted refer to any kind of report (report on dosing, report on formula, report on PGC control, report on vehicle scale, report on density, report on differential weighing) then the following message is displayed <Number of deleted weighings: x. Remaining weighings are report-related>. All of the weighings that are to be deleted refer to any kind of report (report
on dosing, report on formula, report on PGC control, report on vehicle
scale, report on density, report on differential weighing) then the following
message is displayed <Operation not allowed. Weighings are reportrelated>.

35.2. Deleting older data

A user after Logging on as **administrator** can delete older position in the database of weighings **Weighing / Alibi>**.

Procedure:

- Enter the submenu < Reports > according to ch. 35 of the manual,
- Enter < Delete older data>, then an editing field is displayed <Give year> with the screen keyboard,
- Give a date before which data need to be removed and confirm it by pressing

Caution:

If a user enters a date from the protected period the program displays a message box: **<Wrong value>**.

- After entering a date beside protected period the program displays a message box: <Are you sure you want to delete?>,
- After it is confirmed by the program will start removing data and after completing it displays the number of deleted records,
- Press to leave.

35.3. Weighment date search

- Enter < Reports> according to ch. 35 of the manual,
- Enter < Weighing / Alibi>,

- Press , then an editing field appears < Specify year> with the screen keyboard,
- Enter: year, month, day, hour, minute of weighing and confirm it by pressing
- The program will automatically display the list of weighments putting at the top the position with the entered date.

35.4. Reports from weighment records

Submenu < Reports from weighing records> allows for:

- preview of data for particular weighments,
- · data filtering,
- printout of a weighments report,
- · preview and a printout of weighments diagram,
- export of weighments database to file,
- preview and edition of global weighing counter.

Each weighment sent from scales to a printer or to a computer is saved in weighments reports. The user may preview data of a particular weighment (see point 35.5.1 of this manual).

35.4.1. Filtering

The user may filter reports form carried out weighments. The reports will be printed with the use of a printer connected to scales.

Weighments reports may be filtered according to:

- start date.
- end date.
- operator name,
- product name,
- client name,
- packaging name,
- MIN value,
- MAX value.

- lot number.
- batch number,
- source warehouse name.
- target warehouse name,
- result control.
- platform number.

Procedure:

- Enter submenu: " Reports / Reports From weighing records / Filtering" according to ch. 35 of this manual,
- Enter a particular filter position and activate <Filtering> option.

Where:



- Active filteringInactive filtering

35.4.2. Report printout

The user can print a report after executed weighing series. The reports will be printed with the use of a printer connected to scales.

Procedure:

- Enter submenu: " Reports / Reports From weighing records" according to ch. 35 of this manual,
- Entering Report printout> option enables automatic printout of a weighments report. The report can be printed with the use of a printer connected to scale.

Default value of a weighment report template:

```
Report from weighments
{40:Start date:,-20}{101}
{40:End date:,-20}{102}
```


Caution:

- Submenu: "Devices / Printer / Printout / Report From Weighments Printout Template" allows for free modification of a report template (see point 16.2.3 of this manual);
- If there is too much information printed (too many weighments) the program displays the following message <Process in progress>. Percentage (%) notification is added.

35.4.3. Weighments chart

For an executed weighment series < Weighments chart> option generates and displays a diagram of measurements distribution in a measurement value / measurement coordinate system.

Example view of a diagram:

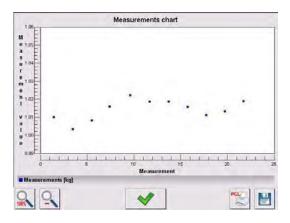

Available options, located below the diagram:

100%	100% zoom of a diagram	
0	Zoom out, the diagram gets back to its previous size	
~	Display the previous window	
PCL	Print the diagram, use a PCL type printer	
	Save the diagram as a *.bmp file, save it to a memory stick connected to USB port	

35.4.4. Export a database to a file

An operator after a series of weighments can export a database to a file using a pen drive. Additionally, a user can select data to be exported.

- Connect a pen drive to USB,
- Enter submenu: "Reports / Weighing/Alibi" according to ch. 35 of this manual,
- Enter submenu: "Export database of weighments to a file / Data selection", which contains the following options:

Icon	Option	Default value
	Automatically *	<>
1	Date and Time	⋖
1	Mass	*
(I)	Tare	◆
00285	Lot number	⋖
1288C	Batch number	◆

8	Operator	⋖
	Product	✓
30	Client	✓
	Package	◆
	Source warehouse	*
	Target warehouse	<
5	Checkweighing	⋖
3	Platform number	❤
-00251-	Statistics: Number of measurements	❤
-02478-	Weighing counter	⋖
	Trade settlement	◆
	Vehicle	*
Ser.	Universal variable	*
Var	Extra variable	❤
Var	Custom variable: Value	<
Var	Custom variable: Name	❤
min	Min	✓
max	Max	❤

- *) Automatic selection of data to be exported (unfilled fields are omitted)
 - After declaring data to be exported go back to the submenu
 Export database of weighments to a file> and select option
 Export>. The software automatically initiates exporting of the database of weighments.

Caution:

In case a pen drive is not recognized after entering < Export database of weighments to a file> a message is displayed: < Operation failed>.

 After the operation has been completed: "Operation finished successfully" is displayed together with the file name (with extension *.txt) created on the pen drive,

Caution:

The file name consists of a database name and scale factory number, e.g. <**Weighments_239800.txt>**.

Disconnect the pen drive to USB.

File template:

The created file comprises a table with columns separated by tabulation characters **<Tab>** in case to allow direct export to a spreadsheet **<Excel>**. The table features all data on a completed weighment record declared in

the submenu: " Export database of weighments to a file / Data selection".

35.4.5. Counter of weighments records

The counter of weighments records contains global number of completed weighments records carried out on the scale. The user can edit the counter of weighments records.

Caution:

Access to the editing of the **Weighing counter>** is conditioned by the accessibility settings for this parameter.

Editing procedure:

 Enter submenu < Reports> in accordance with point 35 of the user manual,

- Enter option < Weighing counter> which opens an editing window with the value of the counter of weighing records and an on-screen numeric keyboard.
- Insert desired value and accept it by pressing key.

35.5. Reports preview

35.5.1. Weighments / Alibi

Procedure:

- Enter < Reports > according to ch. 35 of this manual,
- Enter < Weighments / Alibi> and press the required position.

Weighment record:

	Date	Weighment date
*	Mass	Weighment result
4 8 3	Tare	Tare value
1	Product	Product name
8	Operator	Operator name
	Client	Client name
00285	Lot number	Number of produced lot
12ABC	Batch number	Number of produced batch
	Source warehouse	Source warehouse name
	Target warehouse	Target warehouse name
	Package	Package name
8	Checkweighing	A weighment threshold (MIN, OK or MAX)

	Platform number	Platform number to perform weighments
-00257-	Statistics: Number of measurements	Statistics: Current number of measurements
-02418-	Weighing counter	Global counter of weighment records

Trade settlement> submenu will be created automatically in a weighment record when a chosen product is being weighed.

List of < Trade settlement> submenu data:

*	Mass	Weighment mass
	Mass of the unit	Unit mass of the product
	Price	Unit price of the product
VAT	VAT	Percent Vat value of the product [%]
%€	Discount	Percent discount for the client [%]
-	Value	Net charge
VAT	Gross	Gross charge

35.5.2. Reports from dosing

- Enter < Reports > according to ch. 35 of this manual,
- Enter < Reports from dosing> and press the required position.

List of data for a selected report from dosing:

8	Status Status of correctness for a completed dosing proces	
	Start date Start date of dosing process	
	End date End date of dosing process	
A	Dosing process Name of completed dosing process	
8	Operator Operator preparing a dosing process	
	Client	Client for which the dosing process is prepared
023	Number of Measurements	Number of measurements within a completed dosing process

35.5.3. Reports from recipes

Procedure:

- Enter < Reports> according to ch. 35 of this manual,
- Enter < Report from formulation> and press the required position.

List of data for a specific report from a formulation:

8	Status	Status of correctness for a completed formulation
	Start date	Start date of formula making process
	End date	End date of formula making process
	Formulation	Name of completed formulation
8	Operator Operator preparing a formulation	
	Client	Client for which the formulation is prepared

ULJ	Number of	Number of measurements within a completed
	Measurements	formulation making process

35.5.4. Density reports

Procedure:

- Enter < Reports> according to ch. 35 of this manual,
- Enter < Density Reports> and press the required position.

List of data for a specific report from density determination process:

00285	Sample number	Number of sample for which the density is determined
(E)	Start date	Start date of density determination process
E	End date	End date of density determination process
	Density	Value of determined density
	Volume	Value of determined volume
	Determination method	Method used in process of determining density
2	Operator	Operator carrying out density determination process
	Product	Product for which density is determined
<u></u>	Standard liquid	Standard liquid utilized during density determination process
	Standard liquid density	Density value assigned to the standard liquid
	Temperature	Temperature of the density determination process
	Sinker volume	Value of sinker's volume immersed in tested liquid
8	Weighing 1	Mass value of the 1 measurement

8	Weighing 2	Mass value of the 2 measurement
8	Weighing 3	Mass value of the 3 measurement
	Pycnometer mass	Value of pycnometer's mass utilized during density determination process
7 0 0	Pycnometer density	Value of pycnometer's volume utilized during density determination process

35.5.5. Controls reports

Every control procedure performed on the scale is sent to a printer and saved in database **Controls Reports>**. Every saved control has its unique number given at the moment it is completed.

Control number pattern:

X/yy/MM/dd/HH/mm/ss, where:

X - Controle mode:

U - regulation compliant control,

W – Internal control

Z – control terminated by an operator,

yy - the last two digits of year,

MM - month,

dd - day,

HH - hour,

mm - minute of control completion,

ss - second of control completion.

Users can view data from subsequent controls.

- Enter submenu < Reports> according to ch. 35 of this manual,
- Enter database < Controls Reports> and choose a required one.

Inventory of fields in every control:

ABC	Batch number	Batch number of tested goods
3	Status	Control Status/Result
	Start Date	Control beginning date
(E)	End Date	Control finishing date
	Product	Tested product name
8	Operator	Operator performing the test
dilitte	x	Average value of weighments
dilitio	DX	Disqualifying average value
dilitin	Standard deviation	
1 2 3	Batch quantity Number of products in a batch for which a sam quantity is calculated	
023 A	Sample quantity Number of weighments to be performed	

35.5.6. Average tare reports

Before starting control **<Nondestructive Average Tare>** it is possible to perform the procedure of estimating average tare that consist in weighing empty packages. Every such procedure is automatically saved in database **<**XI Average Tare Reports>. Every report saved in the database is given

a unique number after the procedure has been completed.

Report number pattern:

X/yy/MM/dd/HH/mm/ss/T, where:

X - Test mode:

U – regulation compliant test,

Z – test terminated by an operator,

yy - the last two digits of year,

MM - month,

dd - day,

HH - hour.

mm - minute of test complation,

mm - second of test complation,

T – average tare estimation.

Users can view data from subsequent average tare tests.

Procedure:

- Enter submenu < Reports > according to ch. 35 of this manual,
- Enter database < X Average Tare Reports> and choose a required one.

Inventory of fields in the average tare database:

	Product	Product name which packages are tested
8	Status	Test Status/Result
(E)	Date	Date of performing procedure
483	Tare	The result
alllin	s	Standard deviation
alltin	0.25 T1	Condition to fulfill
023	Number of measurements	Number of measurements of subsequent packages
2	Operator	An operator name

35.5.7. Report from vehicle scale

Procedure:

- Enter submenu < Reports> according to ch. 35 of this manual,
- Enter database < Vehicle Scale Reports> and choose a required one.

List of data for an individual report from vehicle scale:

	Vehicle Vehicle registration number	
8	Status	Transaction status. Accessible values: Loading, Unloading
∀ ← × →	Transaction type	Type of carried out transaction. Accessible values: Entrance, Exit, Control weighment
(E)	Start date	Transaction start date
	End date	Transaction end date
*	Load mass	Mass of load on weighed vehicle
*	Mass on entrance	Mass of weighed vehicle on entrance
*	Mass on exit	Mass of weighed vehicle on exit
8	Operator	Operator carrying out a transaction process
	Client	Client assigned to a transaction
	Product Product assigned to a transaction	

35.5.8. Differential weighments reports

Procedure:

• Enter submenu < Reports> according to ch. 35 of this manual,

Go to submenu < Differential weighments reports> and press appropriate position.

List of data definable for differential weighments report:

		Start date	Start date of the differential weighing process
		End date	End date of the differential weighing process
8		Weighing 1 *	List of data for an executed weighment 1
8		Weighing 2 *	List of data for an executed weighment 2
		Difference	Difference (absolute value) between weighment 1 and weighment 2. In case of processes consisting of more than two weighments this value is inaccessible.
		Statistics	Statistical data of a differential weighing process. Submenu is available in case of a process consisting of more than two weighments.
	min	Weighing: Min	Minimal weighment value, the lowest value out of the whole series of measurement
	max	Weighing: Max	Maximal weighment value, the highest value out of the whole series of measurement
	<u>ullitu.</u>	Average	Average value out of the whole series of measurement
	<u>allina</u>	Standard deviation	Average standard deviation out of the whole series of measurement

^{*) –} in case of process consisting of more than two weighments the data will be grouped in a folder <Weighing records>.

36. IDENTIFICATION PROCESSES

The user can create his own scales operation algorithm and at the same time adjust the device to his needs (production department specific, production line, etc...).

This allows the user to register detailed weighment report with unique data being stored during the process. Through this it is possible to identify and localize faulty products (lot of products) of chain manufacturing processes.

Identification processes can be carried out in the following working modes:

- · weighment,
- · items counting,
- deviations.

Identification processes can be activated by:

- programmable button,
- operator logging,
- product selection.

36.1. Identification process - creation

Identification processes are designed in < Identification processes> database.

Caution:

Process identification database mechanisms of edition and record finding are similar to other databases mechanisms.

- Enter submenu: " Databases / Identification processes",
- Press ①, to see<Create new record?> message,
- Press to confirm, the program will automatically edit the new position.
- Fill in the required fields and go to < Process design> submenu,
- To set the process operation algorithm press < Add> and choose one of the available functions of the process (see point 36.2 to view the chart). Each of the functions is added one by one.

Caution:

It is possible to modify an already existing process. To add an element to the existing process press and hold for about 2 seconds the element before which the function is to be added. The following menu will be shown:

Edit Add Delete Cancel

36.2. List of identification process functions

When designing the identification process the user can use the following functions (steps of a process):

Ice	on	Function	Description
		Select item from database	Function enabling to select the database demanded record
	•	Databases	Database declaration procedure that allows to choose a record: product, operator, client, packaging, source warehouse, target warehouse, extra variable
		Selection mode	Position declaration procedure according to which the search is to be done. Possible positions: standard, name, code. In case of " extra variables" function is not available.
	Var n	Assign to extra variable	Assignment of a extra variable chosen during the process to a particular extra variable of the weighment database reports. Possible values range from 1 to 5. Function available only in case of "extra variables" database.
		Initial position	Declaration of initial position of database chart. It is displayed during the process of record searching.
	nt.	Final position	Declaration of final position of database chart. It is displayed during the process of record searching. Setting 0 value results in display of the whole database chart.
		Set position taken form database	Function sets a demanded record taken from a particular database.
	•	Databases	Declaration of a database for setting a record: product, client, packaging, source warehouse, target warehouse, lot number, batch number, extra variable, universal variable

	•	Product	Selection of a demanded position out of product chart (default database). This function is dependent form declared database.
8		Do a series of weighments	Function inducing execution of a particular weighments series.
	007	Mode	Weighments series mode Number – execution of a particular number of weighments Mass – weighing-out a determined mass. None – no limit for number of weighings and no weight limit
	THE STATE OF THE S	Threshold	Declaration of either weighing number or mass value, depending on the weighments series mode
TORKS		Set MIN and MAX	Function setting MIN, MAX thresholds of checkweighing
-0-		Zero	Function of platform zeroing, identical like →0← button of the indicator
-1-		Tare	Function of platform tarring, identical like →T← button of the indicator
28500		Edit lot number	Function editing a lot number
12RBC		Edit batch number	Function editing a batch number
1		Information window	Function inducing freely designed information window
		Name	Information window name, located at the top bar of the window
	~	Description	Information window description
	2	Image	Information window image. Possible choices: < information>, < Information>, < Information>.
	A	Button	Declaration of buttons for an information window. Possible choices: "Ok" or "Ok Cancel"
Var		Add custom variable	Function inducing a new custom variable. This variable is automatically saved in a report (weighments database) upon the end of a process.
	Var 12AB	Type of variable	Declaration of custom variable type. Possible choices: text variable, numeric variable.
	N	Name	Custom variable name.
	Var n	Assign to custom variable	Assigning of a custom variable to a proper custom variable of the weighing database reports. Possible values range from 1 to 255.
		Edit product	Function inducing change (edition) of variables for a given product. It is omitted if during previous steps of the process the product has not been chosen.

	Var 12AB	Type of variable	Declaration of type of product variable, which is to be edited: mass, price, number of days left before the expiry date, additional days of expiry period
•		Outputs	Function setting indicator outputs state, for control of peripherals. Possible values: None: - inactive output; "0" – low output state; "1" – high output state.
0		Delay	Function setting intervals between steps of a dosing process. Function defines amount of time interval until the next step of a process, given in [s].
Ş.		Input condition	Conditional function, determines when the next step of a process is to be executed, it depends on an input state of an indicator. Possible values: None – inactive input; "0" - low input state; "1" – high input state; "/" – rising edge on input (change from low state to high state, e.g.: the moment of pressing a button); "\" – trailing edge (change from high state to low state, e.g.: the moment of releasing a button)
5		Edit universal variable	Function activating edition of universal variable
	Var n	Assign to universal variable	Assigning a universal variable to an appropriate universal variable in reports (database). Values: from 1 to 3.
000		Button functions	Activating determined button function.
	0	Operation	Selecting button function.

36.3. Identification process - activation procedure

Identification processes may be activated by:

- Programmable button,
- Operator logging,
- Product selection.

36.3.1. Activation by programmable button

Submenu < Button functions> allows for free configuration of programmable buttons (see point 17.2 of this manual).

Procedure:

For a chosen button set one of three functions:

	Select an identification process
name	Select an identification process by name
Code	Select an identification process by code

- · Go back to the main window,
- Press programmable button and select an appropriate identification process to activate it.

36.3.2. Activation by operator logging

User may assign an identification process to an operator. It results in automatic start of a process right after the logging procedure has been carried out.

Procedure:

- Enter submenu: "Databases / Operators" and select an appropriate position,
- Go to < Identification process> field and select a demanded process, than go back to the main window.
- Log in as an earlier edited operator, and wait for an automatic activation of an identification process assigned to this operator to proceed.

36.3.3. Activation by product selection

User may assign an identification process to a product. It results in automatic start of a process right after a product has been selected out of a database.

Procedure:

- Enter submenu: "Databases / Products" and select an appropriate position,
- Go to < Identification process> field and select a demanded process, than go back to the main window,

 Out of a database select an earlier edited product, and wait for an automatic activation of an identification process assigned to this operator to proceed.

36.3.4. Example of process forming and its realization

Description:

User must get through the following balance operation algorithm:

- 1. Carry out the operator logging process with the use of a transponder card,
- 2. Give a shift number,
- Zero scales.
- 4. Information window "Prepare a product to be weighed" (message 60[s]),
- 5. Select a product by EAN code, use a barcode scanner,
- 6. Give a present price of a product,
- 7. Out of a list select "Country of origin",
- 8. Select client code,
- 9. Out of a list select "Supplier country",
- 10. Give a lot number,
- 11. Give a batch number,
- 12. Information window "Start a weighing process".

Identification process forming:

- Create a new record Identification process> according to point 36.1. of this manual.
- Go to submenu
 Process creator> to create further steps of the process:

Step	Function	Description
Add custom variable	Variable type: numeric variable; Name: shift number; assign to custom variable 1	Displays "Shift number" dialog window for edition with a numeric keyboard
2. Zero	Zero	Automatic zeroing
3. Delay	Time: 60s; Description: Prepare a product to be weighed	Displays window "Prepare product to be weighed" for 60 seconds
4. Select item from database	Database: Product; selection mode: Standard; start position: 1; end position: 0	Displays list of products. Configuration and selection of data with the use of barcode scanner is described in point 16.3 of this manual.

5. Edit product	Variable type: Price	Displays window: "Record edition: product / price" with a numeric keyboard				
6. Select item from database	Database: extra variable; assign to extra variable: 2; start position: 1; end position: 20	Displays chart of extra variable from position 1 to 20. Naming chart: "Country of origin" – see point 34.1.4 of this manual				
7. Select item from database	Database: Client; selection mode: Code; start position: 1; end position: 0	Displays window: "Search by code".				
8. Select item from database	Database: extra variable; Assign extra variable: 3; start position: 21; end position: 40	Displays chart of extra variables from position 21 to 40. Naming chart: "Supplier country" – see point 34.1.4 of this manual				
9. Edit lot number	Edit lot number	Displaying "Lot number" dialog window with numeric keyboard				
10. Edit batch number	Edit batch number	Displaying "Batch number" dialog window with numeric keyboard				
11. Information window	Name: Information; Description: start weighing; Image: Information; Button: OK	Displaying "Start weighing process" information window				

- Assign transponder card number to an appropriate operator, to do it follow point 16.4.2 of this manual,
- Assign a created identification process to an appropriate operator to do it follow point 36.3.2 of this manual,
- Log in with the use of a transponder card to automatically activate identification process assigned to the given operator,
- After weighing all unique data edited during weighing process will be saved to reports from weighing:
 - Mass,
 - Shift number,
 - Product name,
 - Product price,
 - Country of origin,
 - Client name,
 - Supplier country,
 - Lot number,
 - Batch number.

User may break the identification process or get back to its previous step.

In order to break identification process one must:

Press button of the main window of a process to see a message:



Press button to confirm and wait for the following window:



Press < Abort> button.

Press button of an edit window or information window, press button of database data chart to see the following window:



Press < Abort> button.

In order to get back to a previous step of a process one must:

Press button of an edit window or information window, press button of database data chart to see the following window:



- Press List of steps> button to see the list of carried out steps,
- Select a given position (step) out of the list and wait, the program will automatically get back to a chosen step.

37. COMMUNICATION PROTOCOL

37.1. General information

- A. Scales- indicator serial communication protocol serves for communication between RADWAG scales and peripheral device, it uses RS-232C and Ethernet interface:
- B. It consists of commands sent from an external device to the scale and a responses from a scale.
- C. Responses are sent every time after receiving a command (reaction for any command).
- D. Using commands allows users to receive some information about the state of scale and/or influence the operation e.g.: Requesting weighing results, display control.

Caution:

Go to submenu: " Devices / Computer / Port" to declare communication port (see point 16.1.1 of this manual).

37.2. List of RS commands

Commands	Description of commands
Z	Zeroing
Т	Tarring
ОТ	Get tare value
UT	Set tare value
S	Send the stable result in basic unit
SI	Send the result immediately in basic unit
SIA	Send immediate results from all platforms in basic units
SU	Send the stable result in current unit
SUI	Send the result immediately in current unit
C1	Switch on continuous transmission in basic unit
C0	Switch off continuous transmission in basic unit
CU1	Switch on continuous transmission in current unit
CU0	Switch off continuous transmission in current unit
DH	Set lower threshold
UH	Set upper threshold
ODH	Read lower threshold
OUH	Read upper threshold
SS	Simulation of pressing ENTER/PRINT key
Р	Change platform
NB	Give balance serial number
SM	Set mass value of a single item
RM	Set reference mass value
BP	Activate sound signal
ОМІ	Give available working modes
OMS	Set working mode
OMG	Give current working mode
PC	Send all implemented commands

Caution:

- 1. Each command have to be terminated in CR LF;
- 2. The best Policy for communication is not sending another command until the former answer has been received.

37.3. Respond message format

After sending a request message you can receive:

XX_A CR LF	command accepted and in progress						
XX_D CR LF	command completed (appears only after XX_A)						
XX_I CR LF	command comprehended but cannot be executed						
XX _ ^ CR LF	command comprehended but time overflow error appeared						
XX _ v CR LF	command comprehended but the indication below the						
XX _ OK CR LF	Command done						
ES_CR LF	Command not comprehended						
XX _ E CR LF	error while executing command – time limit for stable result exceeded (limit time is a descriptive parameter of the scale)						

XX - command name

substitutes spaces

37.4. Command's description

37.4.1. Zeroing

Syntax Z CR LF

Possible answers:

Z_A CR LF - command accepted and in progress

Z_D CR LF - command completed

Z_A CR LF - command accepted and in progress

Z_^ CR LF - command comprehended but zero range overflow appeared

Z_A CR LF - command accepted and in progressZ_E CR LF - time limit for stable result exceeded

Z_I CR LF - command comprehended but cannot be executed

37.4.2. Tarring

Syntax: T CR LF

Possible answers:

T_A CR LF - command accepted and in progress

T_D CR LF - command completed

T_A CR LF - command accepted and in progress

T_v CR LF - command comprehended but tare range overflow appeared

T_A CR LF - command accepted and in progressT_E CR LF - time limit for stable result exceeded

T_I CR LF - command comprehended but cannot be executed

37.4.3. Get tare value

Syntax: OT CR LF

Reply: OT_TARA CR LF - command executed

Frame format:

1	2	3	4-12	13	14 15		16	17	18	19
0	Т	space	tare	space	unit			space	CR	LF

Tare - 9 characters justified to the rightUnit - 3 characters justified to the left

Caution:

Tare values are always send in adjustment unit.

37.4.4. Set tare value

Syntax: UT_TARE CR LF, where TARE – tare value

Possible replies:

UT_OK CR LF - command completed

UT_I CR LF - command correct, but not accessible at the moment

ES CR LF - command incorrect (e.g. incorrect tare format)

Caution:

Use dots as decimal points in tare values.

37.4.5. Send the stable result in basic unit

Syntax: S CR LF

Possible answers:

S_A CR LF - command accepted and in progress
S E CR LF - time limit for stable result exceeded

S_I CR LF - command comprehended but cannot be executed

S_A CR LF - command accepted and in progress
MASS FRAME - mass value in basic unit is returned

Frame format:

1	2-3	4	5	6	7-15	16	17	18	19	20	21
S	space	stability	space	sign	mass	space	unit			CR	LF

Example:

S CR LF - computer command

S _ A CR LF - command accepted and in progress

S _ _ _ _ 8 . 5 _ g _ _ CR LF – command done, mass value in basic unit is returned.

37.4.6. Send the result immediately in basic unit

Syntax: SI CR LF

Possible answers:

SI_I CR LF - command comprehended but cannot be executed at the moment

MASS FRAME - mass value in basic unit is returned

Frame format:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
S	I	space	stability	space	sign	mass	space	unit		CR	LF	

Example:

SICR LF - computer command **SI_?____18.5_kg_CR LF** - command done, mass value in basic unit is returned immediately.

37.4.7. Send immediate results from all platforms in basic units

Syntax: SIA CR LF

Possible answers:

SIA_I CR LF - command comprehended but cannot be executed at the moment

MASS FRAME "P1" CR LF

MASS FRAME "P2" CR LF - mass values are immediately returned from all platforms in basic units

Frame format with mass from subsequent platforms as indicator reply:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
Р	n	space	stability	space	sign	mass	space	unit		CR	LF	

n - weighing platform number

mass - 9 characters justified to the right

unit - 3 characters justified to the left

Example:

Let us assume that both platforms are connected to scale.

SIACRLF - computer command

P1_?____118.5_g__CRLF

P 2 _ _ _ _ 3 6 . 2 _ k g _ CR LF - command done, mass values from both platforms are returned in basic units

37.4.8. Send the stable result in current unit

Syntax: SU CR LF

Possible answers:

SU_A CR LF - command accepted and in progress SU_E CR LF - timeout while waiting for stable results

SU_I CR LF - command comprehended but cannot be executed

SU_A CR LF - command accepted and in progress
MASS FRAME - mass value in current unit is returned

Frame format:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
S	U	space	stability	space	sign	mass	space	unit		CR	LF	

Example:

S U CR LF – computer command
S U _ A CR LF - command accepted and in progress
S U _ _ - _ 1 7 2 . 1 3 5 _ N _ CR LF - command done, mass
value in current unit is returned.

37.4.9. Send the result immediately in current unit

Syntax: SUI CR LF

Possible answers:

SUI_I CR LF - command comprehended but cannot be executed **MASS FRAME** - mass value in current unit is returned immediately

Frame format:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
S	U	I	stability	space	sign	mass	space	unit		CR	LF	

Example:

S U I CR LF – computer command S U I ? _ - _ _ 5 8 . 2 3 7 _ k g _ CR LF - command executed and mass returned

37.4.10. Switch on continuous transmission in basic unit

Syntax: C1 CR LF

Possible answers:

C1 I CR LF - command comprehended but cannot be executed

C1 A CR LF - command comprehended and in progress

MASS FRAME - mass value in basic unit is returned

Frame format:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
S	ı	space	stability	space	sign	mass	space	unit		CR	LF	

37.4.11. Switch off continuous transmission in basic unit

Syntax: C0 CR LF

Possible answers:

C0_I CR LF - command comprehended but cannot be executed

C0_A CR LF - command comprehended and executed

37.4.12. Switch on continuous transmission in current unit

Syntax: CU1 CR LF

Possible answers:

CU1_I CR LF - command comprehended but cannot be executed

CU1 A CR LF - command comprehended and in progress MASS FRAME - mass value in current unit is returned

Frame format:

1	2	3	4	5	6	7-15	16	17	18	19	20	21
S	U	I	stability	space	sign	mass	space	unit		CR	LF	

37.4.13. Switch off continuous transmission in current unit

Syntax: CU0 CR LF

Possible answers:

CU0_I CR LF - command comprehended but cannot be executed

CU0_A CR LF - command comprehended and executed

37.4.14. Set lower threshold

Syntax: **DH_XXXXX CR LF**, where: **XXXXX** – mass format

Possible answers:

DH_OK CR LF - command executed

ES CR LF - command not comprehended (wrong mass format)

37.4.15. Set upper threshold

Syntax: UH_XXXXX CR LF, where: XXXXX - mass format

Possible answers:

UH_OK CR LF - command executed

ES CR LF - command not comprehended (wrong mass format)

37.4.16. Read lower threshold

Syntax: ODH CR LF

Possible answers: DH MASA CR LF - command executed

Frame format:

1	2	3	4-12	13	14	15	16	17	18	19
D	Н	space	mass	space		unit		space	CR	LF

Mass - 9 characters justified to the rightUnit - 3 characters justified to the left

37.4.17. Read upper threshold

Syntax: OUH CR LF

Possible answers: UH_MASA CR LF - command executed

Frame format:

1	2	3	4-12	13	14	15	16	17	18	19
U	Н	space	mass	space	unit		space	CR	LF	

Mass - 9 characters justified to the rightUnit - 3 characters justified to the left

37.4.18. Simulation of pressing ENTER/PRINT key

Syntax: SS CR LF

Sending a command **S S CR LF** to a scale causes automatic saving of a weighing record in the database and simultaneous activating a declared printout template.

Caution:

While sending the command to a scale, all criteria for successful measurement execution have to be met, i.e. result control, stable mass indication, etc.

37.4.19. Change platform

Syntax: **PN CR LF**, where **N** – number of platforms (1 to 4)

Possible answers:

PN_OK CR LF - command completed

PN_I CR LF - command correct, but not accessible at the moment

ES CR LF - command incorrect (e.g. incorrect number of platforms)

37.4.20. Give balance serial number

Syntax: **NB CR LF**

Possible answers:

NB_A_"x" CR LF - command understood, returns serial number

NB I CR LF - command understood but not accessible at this moment

x – serial number of the device (inserted in between inverted commas)

Example:

NB CR LF – give serial number

NB_A_"123456" CR LF - serial number of the device - 123456

37.4.21. Set mass value of a single item

Syntax: SM_XXXXX CR LF, where: _ - space, XXXXX - mass format

Possible answers:

SM_OK CR LF - command understood

SM_I CR LF - command understood but not accessible at this moment

(e.g. mode other than "Parts counting")

ES CR LF - command not recognised (mass format incorrect)

Notice:

Command supported for "Parts counting" mode exclusively.

37.4.22. Set reference mass value

Syntax: **RM_XXXXX CR LF**, where: _ - space, XXXXX – mass format

Possible answers:

RM OK CR LF - command understood

RM_I CR LF - command understood but not accessible at this moment

(e.g. mode other than "Deviations")

ES CR LF - command not recognised (mass format incorrect)

Notice:

Command supported for "Deviations" mode exclusively.

37.4.23. Activate sound signal

Syntax: BP TIME CR LF

Where: _ - space, **TIME** – parameter, decimal specifying how long shall the sound last, parameter given in [ms]. Recommended range <50 - 5000>.

Possible answers:

BP_I CR LF - command carried out, BEEP sound signal activated - command understood but not accessible at this moment

ES CR LF - no parameter or incorrect format

Example:

BP_350 CR LF - activate BEEP for 350 [ms] **BP_OKCR LF** - BEEP activated

Notice:

- 1. If value greater than the permissible high limit is given, than BEEP sound is operated for the maximum permissible amount of time.
- 2. BEEP sound activated via BP command is inhibited if in-course of its activation the sound is activated by means of other device: keypad, touch panel, proximity sensors.

37.4.24. Give available working modes

Syntax: OMI CR LF

Possible answers:

OMI CR LF n_Mode name CR LF

OK CR LF - command carried out, accessible working modes returned
OMI_I CR LF - command understood but not accessible at this moment

Mode name – parameter, working mode name, inserted in between inverted comas. The name takes form given on a particular balance display, it is provided in a currently selected language.

n – parameter, decimal value determining working mode number

Working modes list:

- 1 Weighing
- 2 Parts Counting
- 3 Deviations
- 4 Dosing
- 5 Recipes
- 6 -Weighing Animals
- 7 Density
- 17 Control of packaged goods PGC
- 20 Comparator
- 21 Vehicle scale

Notice:

Working modes numbering is identical for each kind of balance. The numbers are assigned to working modes names. Some balances give only the number as a response.

Example:

OMI CR LF - give accessible working modes
OMI CR LF - accessible working modes are given

2_"Parts Counting" CR LF - number + name

4_"Dosing" CR LF 5 "Recipes" CR LF

OK CR LF - command carried out

37.4.25. Set working mode

Syntax: OMS_n CR LF

Where: n – parameter, decimal value determining working mode number. To see detailed description go to OMI command.

Possible answers:

OMS_OK CR LF - command carried out

OMS_I CR LF - command understood but not accessible at this moment

OMS_E CR LF - error in-course of command execution, no parameter

or incorrect format

Example:

OMS 2 CR LF - set working mode "Parts counting" OMS OK CR LF - working mode "Parts counting"

37.4.26. Give current working mode

Syntax: OMG CR LF

Possible answers:

OMG_n_Mode name CR LF - command carried out, current working mode given

OMG I CR LF

- command understood but not accessible at this

moment

Mode name – working mode name, presented in a form that is displayed for a particular device type, written in a currently selected language.

n – parameter, decimal value determining working mode number. To see detailed description go to **OMI** command.

Example:

OMG CR LF- give current working mode OMG 2 Parts counting CR LF - balance operates in working mode "Parts counting"

37.4.27. Send all implemented commands

Syntax: **PC CR LF**

Possible answers:

PC A "Z,T,S,SI,SU,SUI,C1,C0,CU1,CU0,DH,ODH,UH,OUH,OT,UT,SIA, SS,PC,P1,P2,P3,P4,NB,SM,RM,BP,OMI,OMS,OMG" - command executed, the indicator have sent all the implemented commands.

37.5. Manual printouts / automatic printouts

Users can general manual or automatic printouts from the scale.

- Manual printouts can be performed after loading the pan and stabilizing indication by pressing
- Automatic printouts can be performed only after loading the pan and stabilizing indication.

Format frame:

1	2	3	4 -12	13	14	15	16	17	18
stability	space	sign	mass	space		unit		CR	LF

Stability character [space] if stable

[?] if not stable

[^] if an indication over the range[v] if fan indication below the range

sign [space] for positive values or

[-] for negative values

mass9 characters justified to the rightunit3 characters justified to the leftcommand3 characters justified to the left

Example:

_____1832.0_g__CR LF – the printout generated from the scale after pressing

38. MODBUS RTU COMMUNICATION PROTOCOL

The indicator PUE HY10 enables complete operation of programmable controllers (PLC), which communicate through Modbus protocol class 0. The indicator in a network using modbus standard operates as slave on an accessible interfaces, *RS232* or *Ethernet*. According to the standard, Modbus class 0, the device uses two functions:

 Read multiple registers (fc 3), for cyclic readout of signals from the weighing module, Write multiple registers (fc 16), for cyclic record of the weighing module statuses.

The superordinate unit (master):

- · Cyclically reads inputs signals from the indicator PUE HY10,
- Cyclically saves outputs status to the indicator PUE HY10.

Functions of Modbus communication with the indicator PUE HY10:

- Mass readout
- Reading current measuring unit
- Reading status
- Tarring
- Zeroing
- Setting and reading tare value
- Setting and reading LO threshold value
- Setting and reading Min threshold value
- Setting and reading Max threshold value
- Reading inputs status
- Setting outputs status
- · Selecting an operator,
- Selecting a product,
- Selecting a client,
- Selecting a packaging,
- · Selecting a source warehouse,
- · Selecting a destination warehouse,
- Selecting a formulation,
- Setting the status of dosing process
- · Reading the status of dosing process
- Setting LOT number
- Process stopping,
- · Process starting,
- Saving / Printing,

38.1. Memory map

38.1.1. Output address

Address Offset	0	1	2	3	4	5	6	7	8	9
0	M 1	M 1	M 1	M 1	T 1	T 1	T 1	T 1	J 1	J 1
1	S 1	S 1	LO 1	LO 1	LO 1	LO1	M 2	M 2	M 2	M 2
2	T 2	T 2	T 2	T 2	J 2	J 2	S 2	S 2	LO 2	LO 2
3	LO 2	LO 2	М3	М3	М3	М3	Т3	Т3	Т3	Т3
4	J 3	J 3	S 3	S 3	LO 3	LO 3	LO 3	LO 3	M 4	M 4
5	M 4	M4	T 4	T 4	T 4	T 4	J 4	J 4	S 4	S 4
6	LO 4	LO 4	LO 4	LO 4	ST	ST	SW	SW	MIN	MIN
7	MIN	MIN	MAX	MAX	MAX	MAX	-	-	-	-
8	-	-	-	-	LOT	LOT	LOT	LOT	0	0
9	Α	Α	K	K	OK	OK	MZ	MZ	MD	MD
10	RC	RC	1	-	-	1	-	-	-	-

Where:

M - Mass for a platform, 4 bytes, floatT - Tare for a platform, 4 bytes, float

Current measuring unit of a platform, 2 bytes, word

S - Platform status, 2 bytes, word

LO - Lo threshold of a platform, 4 bytes, float

ST - Process status, 2 bytes, word MIN - MIN threshold, 4 bytes, float MAX - MAX threshold, 4 bytes, float LOT - LOT number, 4 bytes, word 0 - Operator, 2 bytes, word Α - Product, 2 bytes, word Κ - Client, 2 bytes word OK - Package, 2 bytes, word

MZ - Source warehouse, 2 bytes, wordMD - Destination warehouse, 2 bytes, word

RC - Formulation, 2 bytes, word
ST - Process status, 2 bytes, word
SW - Inputs status, 2 bytes, word

38.1.2. Input address

Address Offset	0	1	2	3	4	5	6	7	8	9
0	С	С	СР	СР	Р	Р	Т	Т	Т	Т
1	LO	LO	LO	LO	SW	SW	MIN	MIN	MIN	MIN
2	MAX	MAX	MAX	MAX	-	-	-	-	-	-
3	1	1	LOT	LOT	LOT	LOT	0	0	Α	Α
4	K	K	OK	OK	MZ	MZ	MD	MD	RC	RC

Where:

C - command, 2 bytes, word

CP - command with a parameter, 2 bytes, word

P - Actual platform, 2 bytes, word T - Tare for a platform, 4 bytes, float

LO - Lo threshold of a platform, 4 bytes, float

SW - Outputs status, 2 bytes, word
MIN - MIN threshold, 4 bytes, float
MAX - MAX threshold, 4 bytes, float
LOT - LOT number, 4 bytes, word
O - Operator, 2 bytes, word
A - Product, 2 bytes, word

K - Client, 2 bytes, word
OK - Package, 2 bytes, word

MZ - Source warehouse 2 bytes, wordMD - Destination warehouse, 2 bytes, word

RC - Formulation, 2 bytes, word

38.2. Description of variables

38.2.1. Output variables

Readout of output variables enables obtaining data on instrument's status.

Notice:

All output values, except for mass, are displayed in adjustment/calibration unit.

List of output variable:

Name of output variable	Adress	Length [word]	Data type
Mass platform 1	0	2	float
Tare platform1	4	2	float
Unit platform 1	8	1	word
Status platform 1	10	1	word
Lo platform 1	12	2	float
Mass platform 2	16	2	float
Tare platform 2	20	2	float
Unit platform 2	24	1	word
Status platform 2	26	1	word
Lo platform 2	28	2	float
Mass platform 3	32	2	float
Tare platform 3	36	2	float
Unit platform 3	40	1	word
Status platform 3	42	1	word
Lo platform 3	44	2	float
Mass platform 4	48	2	float
Tare platform 4	52	2	float
Unit platform 4	56	1	word
Status platform 4	58	1	word
Lo platform 4	60	2	float
Process status (Stop, Start)	64	1	word
Input status	66	1	word
Min	68	2	float
Max	72	2	float
LOT number	84	2	dword
Operator	88	1	word
Product	90	1	word
Client	92	1	word
Package	94	1	word
Source warehouse	96	1	word
Destination warehouse	98	1	word
Formulation / Dosing	100	1	word

- mass mass value in current unit is returned,
- tare tare value in calibration/adjustment unit is returned,
- unit determines current (displayed) measuring unit:

Unit	Byte no. Unit		В4	В3	B2	B1	В0	Dec
g	gram	0	0	0	0	1	0	1
kg	kilogram	0	0	0	0	0	1	2
ct	carat	0	0	0	1	0	0	4
lb	pound	0	0	1	0	0	0	8
OZ	ounce	0	1	0	0	0	0	16
N	Newton	1	0	0	0	0	0	32

For instance:

Byte no	В5	В4	В3	B2	B1	В0
Value	0	0	0	0	1	0

Scale use kilogram [kg].

• status – determines scale's status

Status bytes	Task	Dec
0	correct measurement (no error message from scale)	1
1	stable measurement	2
2	scale in zero indication	4
3	scale tarred	8
4	scale in second measuring range	16
5	scale in third measuring range	32
6	scale reports NULL error	64
7	scale reports LH error	128
8	scale reports FULL error	256

For instance:

byte no.	B8	B7	В6	B5	B4	В3	B2	B1	В0
value	0	0	0	0	1	0	0	1	1

The scale does not report an error, the measurement is stable in the second measuring range.

- LO the value of LO threshold in calibration/adjustment unit is returned.
- **Process status** determines the status of dosing process

Decimal value of		byte no.		
a variable (Dec)	process status	B1	B0	
0	process disabled (inactive)	0	0	
1	dosing start	0	1	
2	dosing stop	1	0	
3	end of dosing process	1	1	

Inputs status – determines the status of inputs in an indicator PUE HY10:

Input no.	12	11	10	9	8	7	6	5	4	3	2	1	Decimal value of a variable (Dec)
OFF	0	0	0	0	0	0	0	0	0	0	0	0	0
ON	1	1	1	1	1	1	1	1	1	1	1	1	4094

- MIN set value of MIN Threshold (in calibration/adjustment unit) is returned.
- MAX set value of MAX Threshold (in calibration/adjustment unit) is returned.
- Lot number response is the value of lot number (numeric range 0 2147483647).
- **Operator** response is the value of a logged operator (numeric range 0 32767).
- Product response is the value of a selected product (numeric range 0 - 32767).
- **Client** response is the value of a code of a selected client (numeric range 0 32767).
- **Packaging** response is the value of a code of a selected packaging (numeric range 0 32767).

- **Source warehouse** response is the value of a code of a source warehouse (numeric range 0 32767).
- **Destination warehouse** response is the value of a code of a destination warehouse (numeric range 0 32767).
- **Formulation** response is the value of a code of a selected formulation (numeric range 0 32767).

38.2.2. Input variables

Saving the input variables into the indicator PUE HY10 enables controlling module's operation.

Notice:

All input values are set in reaction to calibration/adjustment unit.

Name of input variable	address	length [word]	data type				
Command	0	1	word				
Complex command	2	1	word				
Complex command parameter	Complex command parameters						
Platform	4	1	word				
Tare	6	2	float				
LO limit	10	2	float				
Output status	14	1	word				
Min	16	2	float				
Max	20	2	float				
Lot number	32	2	word				
Operator	36	1	word				
Product	38	1	word				
Client	40	1	word				
Packaging	42	1	word				
Source warehouse	44	1	word				
Destination warehouse	46	1	word				
Formulation / Dossing	48	1	word				

• **command** – basic command. Setting of an appropriate command's byte is directly responsible for carrying out a task, in accordance with below table:

command bytes	task	Dec
0	scale zeroing	1
1	scale tarring	2
5	dosing process start	32
6	dosing process stop (emergency stop)	64

For instance:

0000 0000 0010 0000 - command carried out, dosing process start

 complex command - Setting of an appropriate command's byte is directly responsible for carrying out a task, in accordance with below table:

command bytes	task	Dec
0	setting tare value	1
1	setting LO threshold value	2
2	setting outputs status	4
3	setting MIN threshold value	8
4	setting MAX threshold value	16

For instance:

0000 0000 0000 0010 – command carried out, LO threshold set to value given in LO parameter (address 10); See Table "Input variables".

Notice:

A complex command requires setting an appropriate address parameter from 6 to 28. See table "Input variables".

- Platform complex command parameter: number of a weighing platform.
- **tare** complex command parameter tare value (in calibration / adjustment unit).

- LO complex command parameter LO threshold value (in calibration / adjustment unit).
- outputs status complex command parameter determining outputs status of an indicator PUE HY10 series.

Output status			byte no.			Dec
Out3	Out2	Out1	B2	B1	В0	Dec
OFF	OFF	OFF	0	0	0	0
OFF	OFF	ON	0	0	1	1
OFF	ON	OFF	0	1	0	2
OFF	ON	ON	0	1	1	3
ON	OFF	OFF	1	0	0	4
ON	OFF	ON	1	0	1	5
ON	ON	OFF	1	1	0	6
ON	ON	ON	1	1	1	7

- MIN complex command parameter MIN threshold value (in calibration / adjustment unit).
- MAX complex command parameter MAX threshold value (in calibration / adjustment unit).
- **Lot number** complex command parameter: the value of lot number (numeric range 0 2147483647).
- **Operator** complex command parameter: the value of a code of a logged operator (numeric range 0 32767).
- **Product** complex command parameter: the value of a code of a selected product (numeric range 0 32767).
- Client complex command parameter: he value of a code of a selected client (numeric range 0 32767).
- **Packaging** complex command parameter: he value of a code of a selected packaging (numeric range 0 32767).
- **Source warehouse** complex command parameter: he value of a code of a selected source warehouse (numeric range 0 32767).

- Destination warehouse complex command parameter: he value of a code of a selected destination warehouse (numeric range 0 - 32767).
- **Formulation** complex command parameter: response is the value of a code of a selected formulation (numeric range 0 32767).

Notice:

A command or a command with a parameter is carried out once on detecting the setting of a corresponding bit. If it is necessary to repeat a command with the same bit, then first it has to be zeroed.

For instance:

command	address 1	address 0
tarring	0000 0000	0000 0010
zeroing command bytes	0000 0000	0000 0000
tarring	0000 0000	0000 0010

39. COOPERATION WITH PERIPHERAL DEVICES

Weighing indicators can cooperate with the following devices:

- Computer,
- · Receipt printer,
- · Label printer,
- Additional display,
- Barcode scanner,
- Any peripheral device with the compatible ASCII protocol.

40. OPTIONAL EXTENSIONS MODULES

40.1. Additional I/O module

The module has been designed to improve functionality of an indicator for additional 12 inputs and 12 outputs. The module features optoisolated inputs and solid-state relay outputs. It enables free inputs and outputs setup (using indicator menu). Module's housing cover features two cable glands through which cables are fed, which cables are 3-metre long and terminated with stripped wires.

Caution:

Installed 12IN/12OUT module disables installation of ANxxxx analog output module.

40.1.1. 12IN/12OUT module: technical specifications

Output parameters					
Outputs number	12				
Outputs types	Solid-state relay				
Wire cross-section	0,14 - 0,5mm ²				
Maximum switching current	0,5A DC				
Maximum forward voltage	30VDC, AC				
Input parameters					
Input number	12				
Input types	Optoisolated				
Wire cross-section	0,14 - 0,5mm ²				
Control voltage	5 -24V DC				


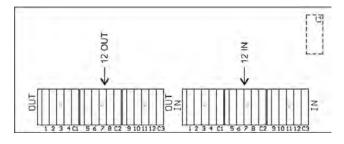


Fig.21. 12IN/12OUT

40.1.2. 12IN/OUT schematic diagrams

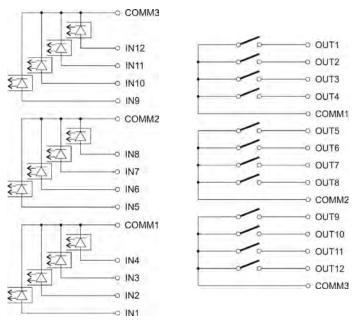

12 inputs 12 outputs

40.1.3. Inputs/Outputs signals overview

Signals transferred via 16x0.5mm² cable with numbered wires.

INPU	TS	OUTPUTS		
WIRE NUMBER	SIGNAL	WIRE NUMBER	SIGNAL	
1	IN1	1	OUT1	
2	IN2	2	OUT2	
3	IN3	3	OUT3	
4	IN4	4	OUT4	
5	COMM1	5	COMM1	
6	IN5	6	OUT5	
7	IN6	7	OUT6	
8	IN7	8	OUT7	
9	IN8	9	OUT8	
10	IN9	10	OUT9	
11	COMM2	11	COMM2	
12	IN10	12	OUT10	
13	IN11	13	OUT11	
14	IN12	14	OUT12	
15	COMM3	15	COMM3	

40.2. 4IN/4OUT – 4IN


Signals are transmitted via cables fed through cable glands.

40.2.1. 4IN/4OUT module: technical specifications

Output parameters				
Outputs number	4			
Outputs types	Solid-state relay			
Wire cross-section	0,14 - 0,5mm ²			
Maximum switching current	0,5A DC			
Maximum forward voltage	30VDC, AC			

Input parameters				
Inputs number	4			
Inputs type	Optoisolated			
Wire cross-section	0,14 - 0,5mm ²			
Control voltage	5 -24VDC			

40.2.2. 4IN/4OUT schematic diagram

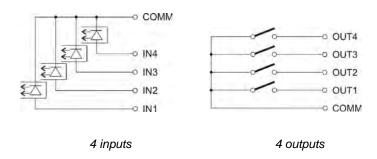

40.2.3. Inputs/Outputs signals overview

INP	UTS	OUTPUTS		
WIRE NUMBER	SIGNAL	WIRE NUMBER	SIGNAL	
1	IN1	1	OUT1	
2	IN2	2	OUT2	
3	IN3	3	OUT3	
4	IN4	4	OUT4	
5	COMIN	5	COMOUT	
6	GNDIN	6	GNDOUT	
7	+24VDC	7	+24VDC	

40.3. Analog outputs module

Module accessible in three configurations:

Voltage output AN 0-10V Current output AN 4-20mA Current output AN 0-20mA

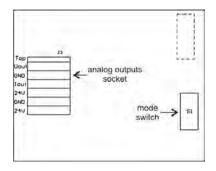


Fig.22. Analog outputs module

40.3.1. AN module setup

The module's working mode is set by means of **S1** switch, while setting the working mode refer to the below table. Analog outputs module board provides description of settings, for the description look around **S1** switch.

R1	R2	WORKING MODE
0	0	0-10V
0	1	4-20mA
1	0	0-20mA
1	1	0-24mA

BY DEFAULT, SET CURRENT LOOP (4-20mA) MODE FOR ANALOG OUTPUTS MODULE.

Calibrate analog output – using potentiometer P1 set correct offset (e.g. for 4-20mA output adjust potentiometer P1 in a way providing that loop current for 0kg indication is 4mA precisely). For remaining working modes of analog outputs module likewise.

Caution:


Installed AN module disables installation of 12IN/12OUT module.

40.3.2. AN module: technical specifications

Working modes	4 - 20mA , 0 - 20mA, 0 - 10V
Resolution	16 bit
Current output resistance	<500Ω
Voltage output resistance	>400Ω
Power supply	24VDC (12 - 30V DC), max 40mA


40.3.3. Wiring diagrams for the AN module

Voltage output wiring diagram:

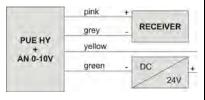

WIRES' COLOURS		
Colour	Signal	
pink	U _{OUT} +	
grey	GND	
yellow	+24V DC	
green	GND	

Current output wiring diagram:

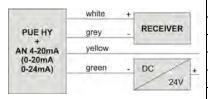

WIRES' COLOURS		
Colour	Colour	
white	l _{out} +	
grey	GND	
yellow	+24V DC	
green	GND	

40.4. Module for an additional platform – DP4

The module increases functionality of PUE HY10 indicators, with it an additional platform can be supported. The module is intended to be mounted inside the indicator. For a weighing indicator featuring DP4 module (384Rxxxx) the additional platform is connected via cable gland mounted on a housing cover.

40.4.1. DP4 module: technical specifications

Working temperature	-10°C ÷ 40°C
OIML	III
Verification units quantity	6000
Max input signal	19,5mV
Max voltage per verification unit	3,25µV
Min voltage per verification unit	0,4µV
Min impedance of load cell	50 Ω
Max impedance of load cell	1200 Ω
Load cell power supply	5V
Load cells wiring	4 or 6 wires + shield
Multirange function	YES

40.4.2. Colours of weighing platform signal wires

RADWAG markings	Colour	Markings of connectors on RADWAG A/D converter boards
+INPUT	brown	+5V
-INPUT	green	AGND
+OUTPUT	yellow	+IN
- OUTPUT	white	-IN
+SENSE	grey	+REF
- SENSE	pink	- REF
SHIELD	yellow-green	Refer to shield wiring rules

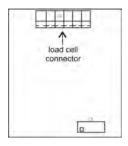


Fig.23. Additional A/D converter module – DP4

40.5. RS485 module (309Rxxxx)

The PUE HY10 indicator can be equipped with RS485 interface (option). This requires installation of **309Rxxxx** board which is mounted in U1 socket on universal communication modules board (385Rxxxx board).

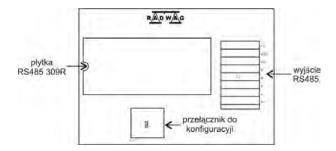


Fig.24 Position of RS485 module on the 385Rxxxx board

Caution:

If the 385Rxxxx board comprises the PROFIBUS module, then simultaneous installation of the RS 485 module on the same connector is impossible. The modules are installed interchangeably on the same connector of the 385Rxxxx board.

40.6. PROFIBUS board

The PUE HY10 indicator can be equipped with PROFIBUS interface (option). This requires installation of **AB6000 Anybus-IC** module which is mounted in U1 socket on universal communication modules board (385Rxxxx board).

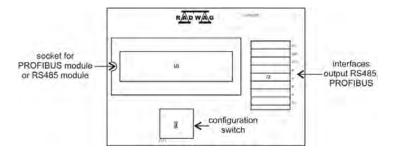


Fig.25 Position of AB6000 module on the 385Rxxxx board

The indicator is equipped with input and output connectors. Voltage on an output connector is 5VDC, this provides correct operation of a terminator. The indicator features M12 5 pin B coded connectors (for PROFIBUS DP).

Connector's pins layout:

PROFIBUS IN (male)	3. 1. 2.	Pin1 – NC Pin2 – A Pin3 – NC Pin4 – B Pin5 – NC
PROFIBUS OUT (female)	3 4 0 2 0 1 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	Pin1 - +5V Pin2 – A Pin3 – GND Pin4 – B Pin5 – NC

Caution:

If the 385Rxxxx board comprises the PROFIBUS module, then simultaneous installation of the RS 485 module on the same connector is impossible. The modules are installed interchangeably on the same connector of the 385Rxxxx board.

40.7. Additional modules positioning

It is possible to install different modules to one and the J1 socket on the main board. Rules for additional modules installation are to be found in an exclusion table (go to section 8.7.1.).

The below figure presents an exemplary positioning of modules on 383R main board.

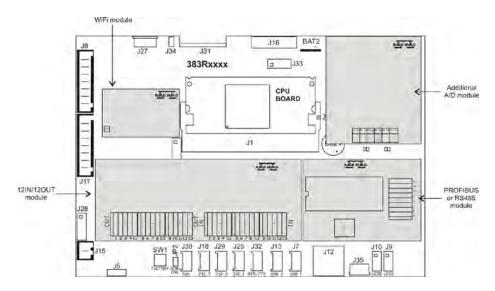


Fig.26. Additional modules positioning

40.7.1. Exclusions for additional modules installation

WHEN INSTALLED	EXCLUDED MODULES
12IN/OUT	ANxxxx
ANxxxx	12IN/OUT
PROFIBUS	RS485
RS485	PROFIBUS
Wi-Fi	-
Additional platform	-

41. PROFIBUS COMMUNICATION MODULE

Profibus Communication Module ensures data exchange between a supervising controlling device (master) and a scale (Slave) in accordance with the Profibus DP protocol.

The supervising unit enables:

- Cyclic reading in input signals from an indicator PUE HY10 series,
- Cyclic saving outputs status to an indicator PUE HY10 series.

Profibus communication functionality with the indicator PUE HY10 enables:

- Operation of four weighing platforms,
- Tarring,
- Zeroing,
- · Setting tare value,
- Setting the value of LO limit,
- Setting the value of Min threshold,
- · Setting the value of Max threshold,
- · Reading inputs status,
- Setting outputs,
- Selecting an operator,
- Selecting a product,
- · Selecting a client,
- · Selecting a packaging,
- · Selecting a source warehouse,
- Selecting a destination warehouse,
- Selecting a formulation,
- · Setting lot number,
- Process stopping,
- Process starting,
- Saving / Printing,
- · Statistics zeroing.

41.1. Socket topology

The indicator is equipped with input socket and output socket. At the output socket the power supply voltage is 5VDC, value required for proper indicator operation. M12 5 pin sockets with B coding are used (type intended for PROFIBUS DP).

PROFIBUS IN (male)	3 1 5 2	Pin1 – NC Pin2 – A Pin3 – NC Pin4 – B Pin5 – NC
PROFIBUS OUT (female)	3 4 0 5 0 2 0 1	Pin1 - +5V Pin2 – A Pin3 – GND Pin4 – B Pin5 – NC

Caution:

If the main board features RS485 module then it is impossible to install PROFIBUS module onto it, these two are installed interchangeably in one and the same interface of the interfaces board.

41.2. Memory map

41.2.1. Output address

Address Offset	0	1	2	3	4	5	6	7	8	9
0	M 1	M 1	M 1	M 1	T 1	T 1	T 1	T 1	J 1	J 1
1	S 1	S 1	LO 1	LO 1	LO 1	LO1	M 2	M 2	M 2	M 2
2	T 2	T 2	T 2	T 2	J 2	J 2	S 2	S 2	LO 2	LO 2
3	LO 2	LO 2	М3	М3	М3	М3	Т3	Т3	Т3	Т3
4	J 3	J 3	S 3	S 3	LO3	LO3	LO 3	LO 3	M 4	M 4
5	M 4	M4	T 4	T 4	T 4	T 4	J 4	J 4	S 4	S 4
6	LO 4	LO 4	LO 4	LO 4	ST	ST	SW	SW	MIN	MIN
7	MIN	MIN	MAX	MAX	MAX	MAX	-	-	-	-
8	-	-	-	-	LOT	LOT	LOT	LOT	0	0
9	Α	Α	K	K	OK	OK	MZ	MZ	MD	MD
10	RC	RC	-	-	-	1	-	1	-	-

Where:

Mass of a weighing platform, 4 bytes, float

T - Tare of a weighing platform, 4 bytes, float

J - Measuring unit of a weighing platform, 2 bytes, word

S - Status of a weighing platform, 2 bytes, word
 LO - Lo limit of a weighing platform, 4 bytes, float

MIN - MIN threshold, 4 bytes, floatMAX - MAX threshold, 4 bytes, float

LOT - Lot, 4 bytes, word

O - Operator, 2 bytes, word
A - Product, 2 bytes, word
K - Client, 2 bytes, word
OK - Packages, 2 bytes, word

MZ - Source warehouse, 2 bytes, wordDestination warehouse, 2 bytes, word

RC - Formulation, 2 bytes, word

41.2.2. Input address

Address Offset	0	1	2	3	4	5	6	7	8	9
0	С	С	СР	CP	Р	Р	Т	Т	Т	Т
1	LO	LO	LO	LO	SW	SW	MIN	MIN	MIN	MIN
2	MAX	MAX	MAX	MAX	-	-	-	-	-	-
3	-	-	LOT	LOT	LOT	LOT	0	0	Α	Α
4	K	K	OK	OK	MZ	MZ	MD	MD	RC	RC

Where:

C - Command, 2 bytes, word

CP - Command with a parameter, 2 bytes, word
 P - Active weighing platform, 2 bytes, word
 T - Tare of a weighing platform, 4 bytes, float
 LO - Lo limit of a weighing platform, 4 bytes, float

SW - Inputs/Outputs statuses, 2 bytes, word

MIN - MIN threshold, 4 bytes, floatMAX - MAX threshold, 4 bytes, float

LOT - Lot, 4 bytes, wordO - Operator, 2 bytes, word

A - Product, 2 bytes, word
K - Client, 2 bytes, word
OK - Packages, 2 bytes, word

MZ - Source warehouse, 2 bytes, wordMD - Destination warehouse, 2 bytes, word

RC - Formulation, 2 bytes, word

41.3. Description of variables

41.3.1. Output variables

Reading the output variables enables obtaining data on device status.

List of output variables:

Variable	Address	Length [word]	Data type
Mass of platform 1	0	2	float
Tare of platform 1	4	2	float
Measuring unit of platform 1	8	1	word
Status of platform 1	10	1	word
Lo limit of platform 1	12	2	float
Mass of platform 2	16	2	float
Tare of platform 2	20	2	float
Measuring unit of platform 2	24	1	word
Status of platform 2	26	1	word
Lo limit of platform 2	28	2	float
Mass of platform 3	32	2	float
Tare of platform 3	36	2	float
Measuring unit of platform 3	40	1	word
Status of platform 3	42	1	word
Lo limit of platform 3	44	2	float
Mass of platform 4	48	2	float
Tare of platform 4	52	2	float
Measuring unit of platform 4	56	1	word
Status of platform 4	58	1	word
Lo limit of platform 4	60	2	float
Process status (Stop, Start)	64	1	word
Inputs status	66	1	word

Min	68	2	float
Max	72	2	float
Lot number	84	2	word
Operator	88	1	word
Product	90	1	word
Client	92	1	word
Packaging	94	1	word
Source warehouse	96	1	word
Destination warehouse	98	1	word
Formulation	100	1	word

- Mass of platform response is mass on a weighing platform in current measuring unit.
- Tare of platform response is the value of tare on a weighing platform in adjustment unit.
- **Measuring unit of a platform** determines current (displayed) measuring unit set for a weighing platform.

Measuring unit bits:

- **0** gram [g]
- 1 kilogram [kg]
- 2 carat [ct]
- **3** pound [lb]
- 4 ounce [oz]
- **5** Newton [N]

Example:

Bit no.	B5	B4	В3	B2	B1	В0
Value	0	0	0	0	1	0

The scale measures with a unit: kilogram [kg].

• Status of a platform – determines status of a weighing platform

Status bits:

- correct measurement (the scale does not report an error)
- stable measurement
- 2 scale in precise zero
- 3 scale tarred
- 4 scale in 2nd measuring range
- 5 scale in 3rd measuring range
- 6 scale reports NULL error
- 7 scale reports LH error
- 8 scale reports FULL error

Example:

Bit no.	В8	В7	В6	В5	В4	В3	B2	B1	В0
Value	0	0	0	0	1	0	0	1	1

The scale does not report an error, the measurement is stabilized in the 2nd measuring range.

- **LO** response is the value of **LO** limit in an adjustment unit of a given weighing platform.
- **Process status** determines status of a process

Decimal value of a	Process status	Bit no.		
variable	F100ess status	B1	В0	
0	Process inactive	0	0	
1	Process start	0	1	
2	Process stop	1	0	
3	Process end	1	1	

• Inputs status – response is the status of set inputs

Input no.	12	11	10	9	8	7	6	5	4	3	2	1
OFF	0	0	0	0	0	0	0	0	0	0	0	0
ON	1	1	1	1	1	1	1	1	1	1	1	1

Example:

Mask of set inputs 2 and 4: 0000 0000 0000 1010

- MIN response is the value of set MIN threshold (in a measuring unit of an enabled working mode).
- MAX response is the value of set MAX threshold (in a measuring unit of an enabled working mode).
- Lot number response is the value of lot number.
- **Operator** response is the value of a logged operator.
- Product response is the value of a selected product.
- Client response is the value of a code of a selected client.
- Packaging response is the value of a code of a selected packaging.
- Source warehouse response is the value of a code of a source warehouse.
- **Destination warehouse** response is the value of a code of a destination warehouse.
- Formulation response is the value of a code of a selected formulation.

41.4. Input variables

Saving input variables in an indicator PUE HY10 series enables influencing its operation.

List of input variables:

Variable	Address	Length [word]	Data type
Command	0	1	word
Command with a parameter	2	1	word

List of parameters of a complex command:

Parameter	Address	Length [word]	Data type
Platform	4	1	word
Tare	6	2	float
LO limit	10	2	float
Output status	14	1	word
Min	16	2	float
Max	20	2	float
Lot number	32	2	word
Operator	36	1	word
Product	38	1	word
Client	40	1	word
Packaging	42	1	word
Source warehouse	44	1	word
Destination warehouse	46	1	word
Formulation	48	1	word

• **basic command** – Setting a bit causes carrying out a task as specified in a below table:

Command bit	Command
0	Zero platform
1	Tare platform
3	Clear statistics
4	Save / Print
5	Start
6	Stop

Example:

0000 0000 0010 0000 - the command carries out process start

• **complex command** - Setting a bit causes carrying out a task as specified in a below table:

Command bit	Command
0	Setting tare value of a weighing platform
1	Setting the value of LO limit of a weighing platform
2	Setting outputs status
3	Setting the value of MIN threshold
4	Setting the value of MAX threshold

Notice:

A complex command requires setting an appropriate parameter (addresses from 4 to 48. – see table "List of parameters in a complex command").

Example:

0000 0000 0000 0010 – a command carries out setting of the LO limit for a value given in parameter LO (address 10 – see table "List of parameters in a complex command").

- Platform complex command parameter: number of a weighing platform.
- **Tare** complex command parameter: tare value (in an adjustment unit).
- LO complex command parameter: the value of LO limit (in an adjustment unit).
- Outputs status complex command parameter: determines outputs status of an indicator.

Output no.	12	11	10	9	8	7	6	5	4	3	2	1
OFF	0	0	0	0	0	0	0	0	0	0	0	0
ON	1	1	1	1	1	1	1	1	1	1	1	1

Example:

Mask of active outputs 2 and 4: 0000 0000 0000 1010

- **MIN** complex command parameter: the value of MIN threshold (in a measuring unit of an enabled working mode).
- MAX complex command parameter: the value of MAX threshold (in a measuring unit of an enabled working mode).

- Lot number complex command parameter: the value of lot number.
- **Operator** complex command parameter: the value of a code of a logged operator.
- Product complex command parameter: the value of a code of a selected product.
- Client complex command parameter: he value of a code of a selected client.
- Packaging complex command parameter: he value of a code of a selected packaging.
- Source warehouse complex command parameter: he value of a code of a selected source warehouse.
- Destination warehouse complex command parameter: he value of a code of a selected destination warehouse.
- Formulation complex command parameter: response is the value of a code of a selected formulation.


Notice:

A command or a command with a parameter is carried out once on detecting the setting of a corresponding bit. If it is necessary to repeat a command with the same bit, then first it has to be zeroed.


Example:

Command	address 1	address 0
Tarring	0000 0000	0000 0010
Zeroing command bits	0000 0000	0000 0000
Tarring	0000 0000	0000 0010


42. DIAGRAMS OF CONNECTION CABLES

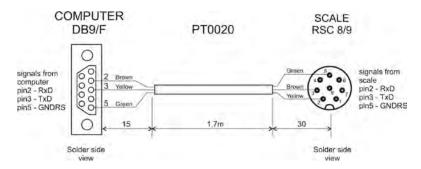


Indicator - computer cable

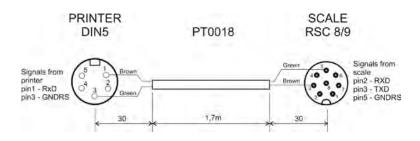


Indicator - KAFKA printer cable

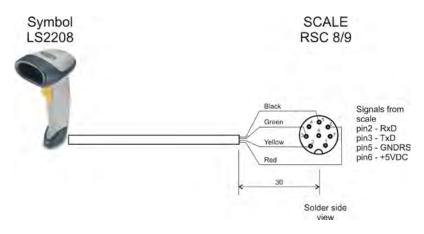

Indicator - barcode scanner (LS2208) cable

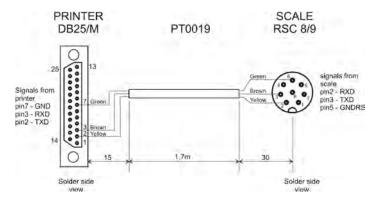


Indicator - printer (CITIZEN, EPSON) cable

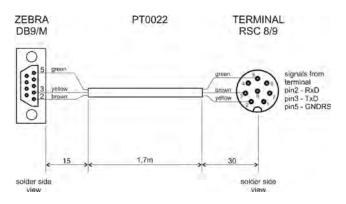


Indicator - ZEBRA printer cable

PT0256

TERMINAL RSTS 8-184/2M

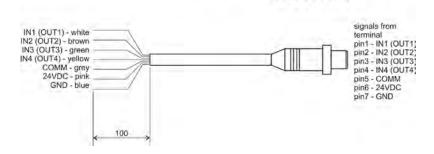

Indicator - IN/OUT cable

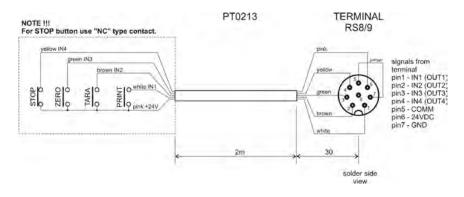

Indicator - PRINT, TARE, ZERO, STOP cable

Caution:

Cable "scale – Ethernet" is a standard network cable with RJ45 connectors on both sides.

43. ADDITIONAL EQUIPMENT

Accessories:

- Cable RS232 for computer PT0020,
- Cable RS232 for CITIZEN, EPSON printer PT0019,
- Cable RS232 for ZEBRA printer PT0022,
- Cable RS232 for KAFKA printer PT0018,
- Cable USB for EPSON, CITIZEN, ZEBRA printer PT0087,
- USB adapter cable PT0084,
- Impact printer EPSON,
- Label printer CITIZEN, ZEBRA,
- Large-size display WWG-2,
- Transponder card reader CK-01,
- Barcode scanner LS2208, D8330, M8330,
- Mouse, PC keyboard.

Computer programs:

- "E2R SYSTEM" computer program,
- "ViewerPGC" computer program,

- "LABEL EDITOR R02" computer program,
- "RAD-KEY" computer program,
- "PW-WIN" computer program.

44. TECHNICAL PARAMETERS

	PUE HY10
Housing	Stainless steel
IP rating acc. to PN-EN 60529	IP68 / IP69
Display	10,1" – widescreen display 1024 x 600 + capacitive touch screen
Power supply	100-240VAC 50-60Hz
Optional power supply	External 12-24VDC
Operating temperature	-10°C ÷ 40°C
OIML	III
Verification units quantity	6000
Max input signal	19,5mV
Max voltage per verification unit	3,25µV
Min voltage per verification unit	0,4µV
Min load cell impedance	50 Ω
Max load cell impedance	1200 Ω
Load cell power supply	5V
Load cell connection	4 or 6 wires + shield
Weighing platforms quantity	Standard 1, max.2
RS232x2	M12 8P hermetic connector
USBx2	M12 4P hermetic connector USB A hermetic connector
Ethernet	10/100Mb, RJ45 hermetic connector
IN/OUT	4IN – M12 8P connector 4OUT – M12 8P connector

OPTIONAL EQUIPMENT	
IN12 module	12IN/12OUT - gland
ANxxxx module	Current loop 4-20mA, 0-20mA, Voltage loop 0-10V
Profibus module	2x M12 5P B-coded connector
RS485 module	Cable through gland
RS232x1	M12 8P hermetic connector

45. ERROR MESSAGES












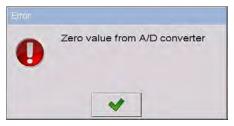

46. APPENDIX 01 - Variables for printouts

46.1. Inventory of variables

Caution:

Every variable needs to be included in brace brackets e.g. $\{x\}$, where x – variable number.

A list of variables accessible in the system for defining printout templates and data displayed in the workspace of scale's screen:

Symbol	Description
{0} ¹⁾	Standard printout in adjustment unit
{1} ¹⁾	Standard printout in current unit
{2}	Date
{3}	Time
{4}	Date & Time
{5}	Mathematical function
{6}	Net mass in current unit
{7}	Net mass in adjustment unit
{8}	Gross mass
{9}	Tare
{10}	Current unit
{11}	Adjustment unit
{12}	Minimum threshold
{13}	Maximum threshold
{14}	Lot number
{15}	Statistics: Number
{16}	Statistics: Sum
{17}	Statistics: Average
{18}	Statistics: Minimum
{19}	Statistics: Maximum
{20}	Cumulative of Cumulative Statistics: Quantity
{21}	Cumulative of Cumulative Statistics: Sum
{22}	Cumulative of Cumulative Statistics: Average
{23}	Cumulative of Cumulative Statistics: Min

{24}	Cumulative of Cumulative Statistics: Max
{25}	Mass: lb
{26}	Checkweighing
{27}	Value to pay
{28}	C Value (cumulative amount to pay)
{29}	CC value (cumulative of cumulatives amount to pay)
{30}	Gross (amount to pay + VAT)
{31}	Platform number
{32}	Factory Number
{33}	Scale division
{34}	Range
{35}	Counting pieces: Sample weight
{36}	Deviations: Sample weight
{37}	Statistics: Standard deviation
{38}	CC Statistics: Standard deviation
{39} ²⁾	Universal variable: Value
{40}	Text information
{41}	Batch number: Value
{42}	Statistics: Weighing counter
{43}	Platform mass
{44}	Scales name
{45}	Parts counting: Sample size
{46}	CC Statistics: Number of measurements
{47}	Statistics: Gross sum
{48}	CC Statistics: Gross sum
{49}	Universal variable: Name
{50}	Product: Name
{51}	Product: Code
{52}	Product: EAN Code
{53}	Product: Mass
{54}	Product: Tare
{55}	Product: Unit price
{56}	Product: Min
{57}	Product: Max

{58} ³⁾	Product: Testing Pre-packages mode (PGC)
{59}	Product: Number of validity days
{60}	Product: VAT
{61}	Product: Date
{62}	Product: Expiry Date
{63} ³⁾	Product: Density
{64} ⁴⁾	Product: Ingredients
{65}	Product: Description
{66}	Product: Low deviation
{67}	Product: High deviation
{68}	Product: Category
{69}	Product: Expiry Date 1
{70}	Product: Expiry Date 2
{75}	Operator: Name
{76}	Operator: Code
{77}	Operator: Access level
{80}	Package: Name
{81}	Package: Code
{82}	Package: Mass
{85}	Client: Name
{86}	Client: Code
{87}	Client: Tax ID
{88}	Client: Address
{89}	Client: Postal code
{90}	Client: City
{91}	Client: Discount
{100}	Report From weighments: Measurements
{101}	Filter of weighments report: Start date
{102}	Filter of weighments report: End date
{103}	Filter of weighments report: Product
{104}	Filter of weighments report: Operator
{105}	Filter of weighments report: Client
{106}	Filter of weighments report: Package
{107}	Filter of weighments report: Min

Filter of weighments report: Max
Filter of weighments report: Lot number
Filter of weighments report: Batch number
Filter of weighments report: Target warehouse
Filter of weighments report: Source warehouse
Filter of weighments report: Checkweighing
Filter of weighments report: Platform number
Report From weighments: Number of weighments
Report From weighments: Totalized weighments
Report From weighments: Value
Report From weighments: Gross
Report From weighments: Average
Report From weighments: Min
Report From weighments: Max
Report From weighments: Vehicle scale
Source Warehouse: Name
Source Warehouse: Code
Source Warehouse: Description
Target warehouse: Name
Target warehouse: Code
Target warehouse: Description
Net mass in adjustment unit: Total
Additional display: WD
Additional display: WWG
Hex
Hex UTF8
Partial mass
Gross mass in current unit
Tare in current unit
Lot number: Name
Batch number: Name
Custom variable: Name
Custom variable: Value
Density: Start date

{156}	Density: End date
{157}	Density: Method
{158}	Density: Standard liquid
{159}	Density: Standard liquid density
{160}	Density: Temperature
{161}	Density: Sinker volume
{162}	Density
{163}	Density: Unit
{164}	Density: Sample number
{165}	Density: Weighing 1
{166}	Density: Weighing 2
{167}	Density: Weighing 3
{168}	Density: Volume
{169}	Density: Pycnometer mass
{170}	Density: Pycnometer density
{175}	Dosing process: Name
{176}	Dosing process: Code
{177}	Dosing process: Cycle number
{178}	Dosing process: Number of cycles
{180}	Dosing report: Start date
{181}	Dosing report: End date
{182}	Dosing report: Result
{183}	Dosing report: Number of measurements
{184}	Dosing report: Total
{185}	Dosing report: Measurements
{186}	Measurements: Nominal mass
{187}	Measurements: Difference
{205}	Adjustment track record: Nominal Mass
{206}	Adjustment track record: Platform number
{209}	Vehicle: Operator
{210}	Vehicle: Name
{211}	Vehicle: Code
{212}	Vehicle: Description
{213}	Vehicle scale: Start date
{214}	Vehicle scale: End date
{215}	Vehicle scale: Entry mass
{216}	Vehicle scale: Exit mass

{217}	Vehicle scale: Load mass
{218}	Vehicle scale: Transaction type
{219}	Vehicle scale: Status
{220}	Recipe: Name
{221}	Recipe: Code
{222}	Recipe: Cycle number
{223}	Recipe: Number of cycles
{224}	Recipe: Process progress
{225}	Recipe: Process progress in %
{226}	Recipe: Ingredient name
{227}	Recipe: Difference
{228}	Recipe: Portion
{229}	Recipe: Nominal mass
{230}	Recipe: Number of current ingredient
{231}	Recipe: Number of ingredient
{232}	Recipe: Number of current manufacturing unit
{233}	Recipe: Number of manufacturing unit
{234}	Recipe: Status
{235}	Recipe: Low deviation
{236}	Recipe: High deviation
{237}	Recipe: Ingredient code
{240}	Recipe: report: Start Date
{241}	Recipe: report: End Date
{242}	Recipe: report: Result
{243}	Recipe: report: Number of measurements
{244}	Recipe: report: Total
{245}	Recipe: report: Measurements
{246}	Measurements: Nominal mass
{247}	Measurements: Difference
{248}	Recipe report: Ingredient code
{249}	Recipe report: Ingredient weight entered manually
{250}	Recipe report: Ingredients
{251}	Recipe report: Ingredient Name
{260}	Report on control: Batch Number
{261}	Report on control: Start date
{262}	Report on control: Start date
	·
{263}	Report on control: Let quentity
{264}	Report on control: Lot quantity
{265}	Report on control: Number of Measurements

{266}	Report on control: T1 error border
{267}	Report on control: 2T1 error border
{268}	Report on control: Number of T1 errors
{269}	Report on control: Acceptable number of T1 errors
{270}	Report on control: Number of 2T1 errors
{271}	Report on control: Total
{272}	Report on control: Min
{273}	Report on control: Max
{274}	Report on control: Average
{275}	Report on control: Limit of the average
{276}	Report on control: Standard deviation
{277}	Report on control: Measurements
{278}	Report on control: Unit
{279}	Report on control: Report Number
{280}	Report on control: Value of T1 error [+]
{281}	Report on control: Value of 2T1 error [+]
{282}	Report on control: Number of T1 errors [+]
{283}	Report on control: Permissible number of T1 errors [+]
{284}	Report on control: Number of 2T1 errors [+]
{285}	Report on control: Permissible number of 2T1 errors
{286}	Report on control: Permissible number of 2T1 errors [+]
{287}	Report on control: Navigating bar
{288}	Report on control: Qualifying number of T1 errors
{289}	Report on control: Tare
{290}	Report on control: Average limit value [+]
{291}	Report on control: Note
{292}	Report on control: Density
{293}	Report on control: D
{294}	Report on control: RDV
{295}	Average Tare Report: Date
{296}	Average Tare Report: Result
{297}	Average Tare Report: Standard deviation
{298}	Average Tare Report: 0.25T1
{299}	Average Tare Report: Number of Measurements
{300}	Average Tare Report: Measurements
{301}	Average Tare Report: Report Number
{302}	Average Tare Report: Average Tare
{303}	Average Tare Report: Note
{320}	Identification process: Name

{321}	Identification process: Code
{330}	Differential weighing: Start date
{331}	Differential weighing: End date
{332}	Differential weighing: Number of weighments
{333}	Differential weighing: Measurements
{334}	Differential weighing: Measurement
{340}	Extra variable: Name
{341}	Extra variable: Value
{342}	Extra variable: Code
{350}	EPSON paper cutting
{351}	EPSON polish signs
{352}	Additional display: PUE7
{353}	IP Address
{354}	Code Page
{355}	Day-of-year
{356}	Number of packages
{357}	Mass to be dosed
{358}	Smart Connect
{359}	Working mode
{360}	Printer: Allergens start [pl]
{361}	Printer: Non allergens start [pl]
{362}	Printer: Allergens end
{363}	Printer: Allergens start [de]
{365}	Printer: Non allergens start [de]
{366}	Printer: Allergens start [es]
{367}	Printer: Non allergens start [es]
{368}	Printer: Allergens start [fr]
{369}	Printer: Non allergens start [fr]
{398}	Weighing

Caution:

- 1) Variables {0} and {1} is terminated by CR LF, i.e. the cursor is moved to the beginning of the next line by default,
- 2) In case of variable {39}, each position from the database (1,2-n) is formatted as follows: Position 1 {39:1}, Position 2 {39:2}, etc.
- 3) In case of variable {64}, each line (L1-Ln) is formatted according to the template: Line 1 {64:L1}, Line 2 {64:L2}, etc.

46.2. Formatting variables

Users can format numeric, text and date variables intended for displaying or printing out.

Different format commands:

- Justification to the left,
- Justification to the right,
- Setting the number of characters for printout / display,
- Declaration of the number of digital places for numeric variables,
- Date&Time formatting,
- Formatting numeric variables for EAN13 codes,
- Formatting numeric variables and dates for EAN128/GS1-128 codes.

Format characters:

Character	Description	Example
,	Separates variables from format strings	(7,10) – Net mass in adjustment unit situated in 10-character string justified to the right.
-	Minus sign or justification to the left	{7,-10} - Net mass in adjustment unit situated in 10-character string justified to the left
:	Precedes formatting or separates hours, minutes and seconds	{7:0.000} - Net mass in adjustment unit always with three decimal places; {3:hh:mm:ss} - Present time in the format : hours : minutes : seconds
	The first dot in the format string determines the location of the decimal separator in the formatted value; any additional dot characters are ignored.	{55:0.00} – Unit price always with two decimal places; {17:0.0000} – Average value form weighments with four decimal places;
F	The number is converted to a string of the form "-ddd.ddd" where each 'd' indicates a digit (0-9). The string starts with a minus sign if the number is negative.	{7:F2} - Net mass in adjustment unit always with two decimal places. {7,9:F2} - Net mass in adjustment unit always with two decimal places in 9-character string justified to the right.
V	Formatting mass and derivatives for EAN13 codes	{7:V6.3} - Net mass for EAN13 (6-character code) with three decimal characters
Т	Formatowanie masy i wielkości pochodnych do masy w kodzie EAN128	{7:T6.3} – Net mass for EAN128/GS1-128 with two decimal places.

1	Date separator between days, months and years	{2:yy/MM/dd} – Present date formatted as: year - month - day, where yy represents two less significant digits of year.
\	"Escape" character removing formatting function form next character to allow it to be used as a character in a text string.	{2:yyVMMVdd} – Present date formatted as yesr / month / day; {2:yy\:MM\:dd} –Present date formatted as: year: month: day. In case of necessity of using "\" as literal it should be preceded by another escape character; "\".

Format examples:

Symbol	Description
{7:V6.3}	Net mass for EAN 13 (6-character code)
{7:V7.3}	Net mass for EAN 13 (7-character code)
{27:V6.3}	Net amount to pay for EAN 13 (6-character code)
{27:V7.3}	Net amount to pay for EAN 13 (7-character code)
{7:T6.3}	Net mass for EAN 128/GS1-128
{16:T6.3}	Cumulative net mass for EAN 128/GS1-128
{21:T6.3}	Cumulative of cumulative net mass for EAN 128/GS1-128
{25:T6.3}	Net mass in lb for EAN 128/GS1-128
{8:T6.3}	Gross mass for EAN 128/GS1-128
{55:T6}	Product price for EAN 128/GS1-128
{2:yyMMdd}	Date for EAN 128/GS1-128
{61:yyMMdd}	Product date for EAN 128/GS1-128
{62:yyMMdd}	Expiry date for EAN 128/GS1-128
{16:V6.3}	Cumulative net mass for EAN 13 (6-character code)
{16:V7.3}	Cumulative net mass for EAN 13 (7-character code)
{28:V6.3}	Total/cumulative amount to pay for EAN 13 (6-character code)
{28:V7.3}	Total/cumulative amount to pay for EAN 13 (7-character code)
{21:V6.3}	Cumulative of cumulative net mass EAN 13 (6-character code)
{21:V7.3}	Cumulative of cumulative net mass EAN 13 (7-character code)
{29:V6.3}	Total/cumulative of cumulative amount to pay EAN 13 (6-character code)
{29:V7.3}	Total/cumulative of cumulative amount to pay EAN 13 (7-character code)

46.3. Mathematical function

Extended functionality of the mathematical functions with use of a variable <**{5} Mathematical function>** enables carrying out an optional operation on numbers and variables available on the list. The basic available mathematical functions are:

- Adding (+)
- Subtracting (-)
- Multiplying (*)
- Dividing (/)

The additional functionality provides using in the calculation the existing variables, thus enabling acquiring mass from a specified weighing platform, and its processing in a desired way.

An example:

{5: ([43:1] + [43:2]) / 2}

The above application of a variable <{43} Platform mass> causes acquiring mass from a weighing platform determined in the formatter (:1 and :2), and their dividing by 2 which enables taking the average mass from both weighing platforms. Use of the brackets enables carrying out the operation in an appropriate sequence and in accordance with basic mathematical principles.

Caution:

Variables in the structure of the mathematical operations are noted in square brackets [] and not as previously in {} brackets.

Additionally, a operator can use the advanced functions enabling extended means of data modification. The advanced functions are used in a form of text marker and arguments in brackets:

- round (numeric value, rounding precision (number)) rounding
- abs (numeric value) absolute value
- sin (numeric value) sine
- cos (numeric value) cosine
- tan (numeric value) tangent
- sqrt (numeric value) radical
- pow (numeric value, power base (number)) power
- log (numeric value) logarithm
- log10 (numeric value) logarithm base 10

Caution:

A numeric value is comprehended as an optional number or an optional mathematical operation that returns a numeric value.

There are additional functions that modify the text values, and they can also operate on numbers that are converted to text:

- remove ("text value", initial place (number), quantity of characters to be removed (number)) – a return is a residue after deleting a part of the text value, from the initial point to a determined quantity of characters. In case the third parameter is not specified the text value will be deleted till its end.
- substring ("text value", initial place (number), quantity of characters to be copied (number)) a return is copied text value from the initial point to a quantity of characters to be copied. In case the third parameter is not specified the text value will be copied till the end.
- tolower ("text value") a return is a complete text value in small letters.
- toupper ("text value") a return is a complete text value in capital letters.
- replace ("text value", old text, new text) a return is a text with replaced letters of parts of the text, determined in the second and their parameter.

Caution:

The text values are put in quotation marks "".

Examples:

remove ("Text sample", 4) – the operation causes returning text value: "Text".

toupper ("Text sample") – the operation causes returning text value: "TEXT SAMPLE".

replace ("Text sample", "sample ", "smp") - the operation causes returning text value: "Text smp".

replace ("2.000","0","1") - the operation causes returning text value "2.111". The value can be used for standard mathematical calculations, where it will be converted "on the fly" in case the operation requires it.

47. APPENDIX 02 – Functions of programmable buttons

Icon	Function name
10	ENTER
-0-	Zero
-1-	Tare
-I-	Enter tare
	Parameters
	Local Parameters
min max	Set MIN and MAX
	Statistics (cumulative) : Print and zero
5	Statistics (cumulative) : Print
-0-	Statistics (cumulative) : zero
	Statistics (cumulative of cumulative): Print and zero
5	Statistics (cumulative of cumulative): Print
-0-	Statistics (cumulative of cumulative): zero
-0123	Edit lot number
12RBC	Edit batch number
*	Start
*	Stop
8	Choose an operator

name	Choose an operator by name
olcos)	Choose an operator by code
	Choose a product
Pharms !	Choose a product by name
	Choose a product by code
	Choose a package
namo	Choose a package by name
code	Choose a package by code
	Choose a client
name	Choose a client by name
codu	Choose a client by code
	Choose a source warehouse
name.	Choose a source warehouse by name
O COM	Choose a source warehouse by code
	Choose a target warehouse
DECEMBER OF THE PARTY OF THE PA	Choose a target warehouse by name
COSE	Choose a target warehouse by code
	Change working mode
3	Counting pieces: Specify piece mass
G12.341	Counting pieces: Estimate piece mass
	·

<u>åå</u>	Counting pieces: Ascribe standard
5	Counting pieces: Quantity of sample - 5 pcs
	Counting pieces: Quantity of sample - 10 pcs
20	Counting pieces: Quantity of sample - 20 pcs
50	Counting pieces: Quantity of sample - 50 pcs
9%	Deviations: Specify sample mass
96	Deviations: Estimate sample mass
STOP	Emergency stop
800	Chute permission
OFF	Disable tare
ON	Restore tare
kg	Change unit
$\overline{\Lambda}$	Change platform
Var 1	Edit universal variable 1
Var 2	Edit universal variable 2
Var 3	Edit universal variable 3
	Select dosing process
name	Select dosing process by name
code	Select dosing process by code

	Select formulation
name	Select formulation by name
Code Code	Select formulation by code
18	Ingredients
	Determine liquid density
	Determine solid density
	Determine pycnometer density
	Determine porous body density
	Edit number of labels
	Edit number of C labels
	Edit number of CC labels
e	Control: Set control
6	Control: Return to home screen
To the second	Control: Average tare start
1	Control: Data on control in progress
Z	Control: Edit note
×	Control: Finish control
P	Choose a vehicle
name	Choose a vehicle by name

code	Choose a vehicle by code
U.S	Choose a vehicle "manually"
-	Start entry transaction
-	Start exit transaction
	Choose transaction
	Choose traceability process
name	Choose traceability process by name
Code	Choose traceability process by code
	Print Screen
1	Select platform 1
2	Select platform 2
3	Select platform 3
4	Select platform 4
Var	Choose an extra variable no 1
Var 2	Choose an extra variable no 2
Var 3	Choose an extra variable no 3

Var 4	Choose an extra variable no 4
Var 5	Choose an extra variable no 5
1	Zero platform 1
2	Zero platform 2
3	Zero platform 3
4	Zero platform 4
1	Tare platform 1
2	Tare platform 2
3	Tare platform 3
4	Tare platform 4
\$	Undo weighing
00.257	Increase accuracy
E	Set date and time
*	Select record from the database

48. APPENDIX 03 – Label template

A label template can be created in 2 ways:

- From the indicator level using variables,
- Using PC software EDYTOR ETYKIET R02. A created project needs to be saved as an "Ib" file then copied on a pen drive that can be connected to the indicator. Finally transfer the file to the database in the scale.

While a label is in the database of labels it can be ascribed to products or/and clients in order to work in labelling mode.

48.1. Designing a label from the indicator level

Procedure:

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Labels> and press on the required position.
- After entering < Label template> an editing field with the screen keyboard appears
- Modify the existing template using the list of variables accessible after pressing
- Confirm changes by pressing

Caution:

In the bottom line of the screen keyboard there are additional buttons that help to modify a label template:



On-screen keyboard on / off



Read label templates from *.lb files (see - ch. 45.3)



Saving printout template in a file format *.lb (option enabled on plugging a portable data storage device to scale port)



Select variables for the display template (inventory of variables can be found in APPENDIX 01)




Clearing the editing field

48.2. Designing a label on a computer

Example:

Let us create a label template for the label below:

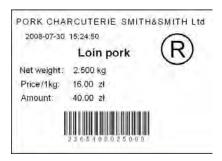


Caution:

The installer of **EDYTOR ETYKIET R02** is accessible to download on website: **www.radwag.com.** on the overlap: Products / Measuring indicators / PUE HY10.

Procedure:

3. Run computer program **LABEL EDITOR R02**, then the main window of the program is displayed:

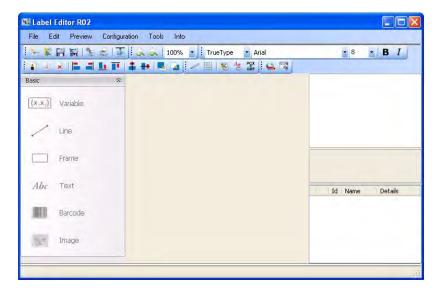


Caution:

Prior to designing a label a new project needs to be created with initial printer and label settings. A description of creating new projects can be found in instruction manual "Label Editor R02" accessible in the program menu: "Info / User manual".


4. In order to add a text to the label chose < Abc Text> from the list of objects and then click on the workspace of label, then window < Text field settings> opens:



- 5. Type the required text in the box at the bottom of the window: PORK CHARCUTERIE SMITH&SMITH Ltd and press to confirm, then the text is put automatically on the label,
- 6. In order to add a variable to the label chose <[x,x,] Variable> from the list of objects and then click on the workspace of label, then window <Variable settings> opens:

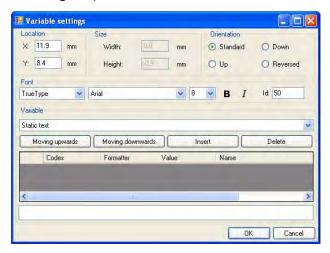

- 7. From list **<Variable>** chose variable type **"4 Date and time"** and press linsert —, then the variable is placed in the table of variables show below.
- 8. Confirm it by pressing , then the variable is automatically placed on the label.
- 9. Place the rest of variables and constant texts on the label in the same way,

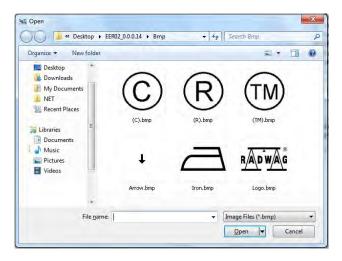


11. Chose one and press **<Open>**, then the image is placed on the label.

Caution:

Graphic images placed on the label can be printed only when they are downoladed to the printer memory. It is described in the instruction manual "Label Editor R02" accessible in the program menu on the overlap: "Info / User manual".

12. In order to add a barcode to the label chose **Barcode** and then click on the workspace of label, then window **Barcode settings** opens:

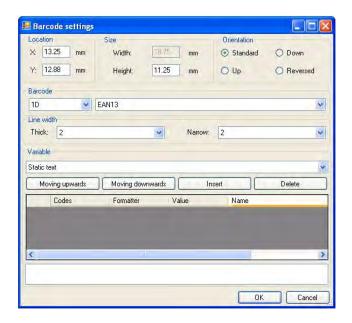

- 13. Chose **<Barcode>** from the list e.g. **EAN-13**.
- 14. Chose from list **<Variable>** item "**7 Net mass in adjustment unit**" and press in adjustment unit, then the variable is placed in the table of variables show below.
- 15. In column **<Formatter>** type:**V6.3** (mass in EAN13 as a 6-digit code with 3 decimal places).
- 16. Confirm the entered item by pressing _____, then the barcode is automatically placed on the label.
- 17. Save the created pattern chosing from the menu "File / Export *.lb".

Caution:

Recorded templates of labels in files with *.lb extension are not editable. This is advisable to record designs of labels in files with *.lab extension as well (software menu: File / Save as...) to use/edit the designs of labels in the future.

48.3. Saving label templates in the scale

Procedure:

- A label template *.lb created in EDYTOR ETYKIET R02 needs to be copied to a pen drive,
- Connect the pen drive to USB in the scale,
- Enter: " Databases / Labels" and press the required item,
- Enter < Label templates>, then an editing field and the screen keyboard appears,
- Press , to open a window showing files on the pen drive,
- Select the required *.lb file. It is automatically copied to the editing field,
- Confirm the changes by pressing

Caution:

If a pen drive is not recognized by the system button will remain inactive.

48.4. Attributing a label to a product

Procedure:

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Products> and press the required item,
- Enter < Label>, then the database of labels is open with the list of all labels,
- Choose the required label. The program automatically ascribes the label to the product.

48.5. Attributing a label to a client

Procedure:

- Enter < Databases > according to ch. 34 of this manual,
- Enter < Clients> and press the required item,
- Enter < Label>, then the database of labels is open with the list of all labels.
- Choose the required label. The program automatically ascribes the label to the client.

48.6. Printing labels

Procedure:

- While in the main window choose a product (button or a client (button) that has attributed a label,
- Place a load on the pan and wait for

 then press
- The label is printed on a printer connected to the scale.

Caution:

- 1. Labels can be attributed to products or/and clients. After pressing a label is printed on a connected printer, provided a selected client or product has an ascribed label.
- 2. Users can perform the test label printout see ch. 34.5 of this manual.

49. APPENDIX 04 - CITIZEN printer setting

Baud rate : 9600b/sec

Parity control : No
Number of data bits
Number of stop bits
Flow control : No
IEEE 1284 : ON

Information printed by the printer via RS232:

[Interface Menu]

RS-232C Baud rate : 9600bps
RS-232C Parity : None
RS-232C Length : 8 bit
RS-232C Stop bit : 1 bit
RS-232C X-ON : No
IEEE 1284 : On

The way of generating the setup printout and setting CITIZEN printers are described in manuals attached to printers or present on the website of the manufacturer.

50. APPENDIX 05 - ZEBRA printer setting

Baud rate – 9600b/sec Parity control – none No of data bits – 8bit No of stop bits – 1 bit

Information printed by the printer via RS232:

Serial port : 96, N, 8, 1

The way of generating the setup printout and setting ZEBRA (Eltron) printers are described in manuals attached to printers or present on the website of the manufacturer.

51. APPENDIX 06 - Communication with barcode scanners

- For communication with barcode scanners RADWAG scales use RS232 interfaces and simplex transmission (one direction) without handshaking. Only two wires are required for assuring such a transmission. Used scanners should be equipped in such interface with disabled both hardware and software handshaking.
- 2. Both scales and scanners have the possibility of setting of transmission parameters. Both devices are required to have the same parameters set: baud rate, number of data bits, parity control, stop bits. e.g. 9600,8,N,1 baud rate 9600 bit/s, data 8-bits, no parity control, 1 stop bit.

- Barcode scanners can send additional information apart from the expected barcode e.g. symbology (type of barcode). It is advisable to disable such information because RADWAG devices and software do not use it.
- Some RADWAG systems can omit unnecessary information by using parameters that mark the beginning and the length of the code required to analyse.
- A special protocol is required in order the code be received by RADWAG equipment. It is required to program an appropriate prefix and suffix. Prefix – one byte 01 hexadecimally, suffix one byte 0D hexadecimally.
- 6. Most barcode scanners allow to enable/disable different symbologies (barcode types).
- 7. Programming of scanners is usually performed by reading special barcodes or by using an external software tool.
- 8. Scanners marketed together with RADWAG systems are always configured according to the rules above.

Barcode with required prefix and suffix in hexadecimal format	Barcode without required –fixes in ASCII format	Code type
01 30 30 32 31 30 31 32 36 0D	00210126	EAN-8
01 30 31 32 33 34 35 36 37 38 39 0D	0123456789	2 of 5
01 43 4F 44 45 20 33 39 20 54 45 53 54 0D	CODE 39 TEST	CODE 39
01 31 31 30 31 32 33 34 35 36 37 38 39 31 0D	1101234567891	EAN-13
01 43 6F 64 65 20 31 32 38 20 54 65 73 74 0D	CODE 128 Test	CODE 128

52. APPENDIX 07 - Computer Program "ViewerKTP"


Computer program "ViewerKTP" is intended for viewing and printing reports from controls and average tare tests.

Caution:


Installation program "ViewerKTP" is recorded on the CD connected to this product.

Operation description:


• Run computer program "ViewerKTP". It starts with opening the following window:

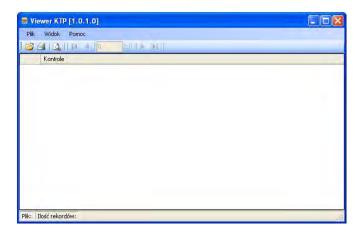

Button functions:

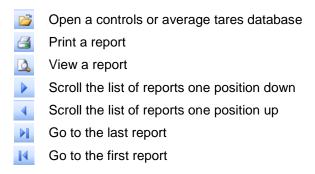

- Press , then window **<Open>** appears in which the wanted database can be located (extention *.tdb),
- Mark a report and click on
 Otworz
- The program automatically returns to the main window and in the field **Tests>** the list of reports is displayed:

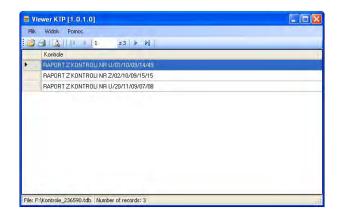

- Print the marked report on a connected printer by pressing <a>=
- Using button view the selected report.

53. APPENDIX 08 - Cooperation with HRP Weighing Platform

For detailed information on HRP weighing platform refer to "HRP Weighing Platform" user manual. Cooperation of PUE HY10 indicator with HRP weighing platform is carried out via RS232 or Ethernet interfaces using appropriate cables that come standard with the equipment.

Upon establishing connection between **HRP** platform and **PUE HY10** indicator, the following parameters are enabled in **< Weighing>** submenu:

- · External ambient conditions.
- Weighing instrument internal adjustment.
- LO threshold for automatic functions.

53.1. External ambient conditions

Parameters allowing you to adjust your weighing device to workstation ambient conditions.

Median Filter	The median filter is intended for eliminating short-lasting mechanical shocks. Accessible settings: None (median filter is off), 0.5 , 1 , 1.5 , 2 , 2.5 .
Filter	Enter this parameter to adjust your weighing device to ambient conditions. The higher filter level, the longer the indication takes to stabilise. Available values: Slow , Average , Fast .

Autozero	Enter this parameter to enable automatic control and correction of zero indication. There are, however, some cases when this function can be a disturbing factor for the measuring process. e.g. very slow placing of a load on the weighing pan (load adding, e.g. pouring, filling). In such case, it is recommended to disable the function. Available options: - function disabled, - function enabled.
Last digit	Enter this parameter to enable/disable display of the last digit (placed on the right of the decimal point) of the weighing result. Available values: Always: all digits are displayed; Never: last digit disabled; When stable: last digit displayed only when the result is stable.

53.2. LO Threshold for automatic functions

<LO threshold> parameter allows you to configure the function of automatic operation. The next measurement is saved when mass indication gets below the set net value of **<LO threshold>** parameter.

Procedure:

- Enter < Weighing / LO threshold> submenu, an on-screen keyboard is displayed.
- Enter LO threshold value and press button.

53.3. Automatic adjustment

Automatic adjustment using internal adjustment weight is carried out in 3 different cases:

- Triggered by plugging the instrument to the mains.
- Triggered by temperature change (by 3°C).
- Triggered by passage of specified time interval (every 3h).

Enabling < Automatic adjustment> parameter:

- Enter < Weighing> submenu.
- Select < Automatic adjustment> parameter and set respective value (function disabled, function enabled).

Automatic adjustment process:

 Upon detecting the need for carrying out an adjustment process, the following message is displayed:




Where:

Start in 26 s	Information about the remaining time to start the process.		
Unload the platform	Request to unload the weighing platform.		
*	Delay the adjustment by approx. 3 minutes. Adjustment can be delayed repeatedly, but you have to remember that too many delays cause larger errors during weighing. Errors are caused by temperature and sensitivity changes.		
*	Start adjustment process immediately		

• Adjustment process is signalled by the following message:



 Upon completed adjustment procedure the following message is displayed:

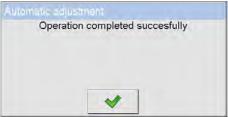

Press button to confirm.

Caution:

With enabled Automatic adjustment> parameter it is important to periodically carry out manual internal adjustment.

53.4. Internal adjustment


Internal adjustment is carried out by means of internal adjustment weight.

Procedure:

• Enter < Weighing / Internal adjustment> submenu, the following message is displayed:



 Upon completed adjustment procedure the following message is displayed:

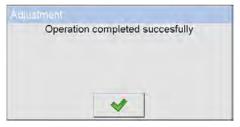

Press button to confirm.

Caution:

The adjustment has to be carried out when the weighing pan is unloaded and working conditions are stable (no drafts and vibrations).

53.5. Automatic adjustment time-triggered

The function enables carrying out automatic adjustment each day at a specific day and time. You can declare up to 5 values (hours) per day (e.g. 03.00, 8.00, 13.00, 18.00, 23.00).

Procedure:

- Enter Weighing / Automatic adjustment time-triggered submenu and select Automatic adjustment set time (h:m) parameter.
- Enter < Date> parameter and enter respective hour of automatic adjustment start (in the following order: hour, minute).
- Entered value is automatically set as the time of internal adjustment start.
- To disable the function, uncheck < tel ☐ Active> parameter (function disabled, function enabled).

